

ELITE PEST CONTROL cc

Specialising in: Termite Treatments, Wood borer, Marine & Warehouse fumigation, Bird Proofing, Industrial Cleaning & Building Maintenance

314 Mathews Meyiwa Road
Morningside
Durban

Tel: 031-332 0570
031-332 0593
Fax: 031-312 0431

EMAIL: elitepestcontrol@telkomsa.net

ENTOMOLOGIST REPORT

<u>Property:</u>	University Of Kwa Zulu Natal	<u>Date:</u>	04 April 2023
<u>Address:</u>	Chemistry Building Alan Paton Road Pietermaritzburg	<u>Inspection No.:</u>	1366710
		<u>Inspected By:</u>	A.Budhram
		<u>Estimated Age Of Blding:</u>	Unknown

Building Ref: Block-"A"

Type Of Building: Single Storey

Description Of Roof: Oregon Pine Roof Timbers with Marseille Tiles. Isolated wood Borer Activity

Joinery: Varnished Wooden Meranti Doors & Frames.
Steel Painted Windows & Frames.


Skirtings: Varnished Wooden

Ceilings: Painted Rhino Board Ceilings.

Floors: Lecture Venues & Laboratories Have Wooden Varnished Flooring. No Visible Activity Of Wood Borer/Termite.
Offices: Carpets On floors. (Not Lifted For Inspection)
Ablution Facilities: Tiles On Floors.

Findings: Isolated Activity Of Wood Borer in Main Roof Timbers – 4 Beams Have *Mild* Activity. No Fumigation Required
Room 12 Laboratory Instrument – has Visible Termite Activity in Door Frame.
Laboratory has Carpenter Ant Activity & furniture has Non Active Wood Borer.
Canteen: Active Termites Noted.

Recommendation: The Roof Trusses that have been identified with Wood Borer Activity be Drilled And Injected with approved Timber Preservative (CTX 103), Thereafter all roof Timbers be sprayed to Drip Of Rate Of Application as A Preventative Treatment. Laboratory Furniture be Sprayed as preventative. (No Active Infestation).
Termites Treatment: To Drill & Inject concrete slab from External thereafter Inject a High residual Termite Barrier. Entry points to the sealed to match existing surface finish. Upon completion of Termite Treatment, A minimum guarantee of 5 years to be issued against Re-Infestation.

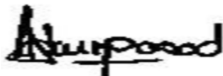

Mr A. Budhram
Reg: WDO No: 0139- SAPCA
Reg: P17935 – Dept. Of Agriculture



ELITE PEST CONTROL cc

Specialising in: Termite Treatments, Wood borer, Marine & Warehouse fumigation, Bird Proofing, Industrial Cleaning & Building Maintenance

314 Mathews Meyiwa Road
Morningside
Durban

Tel: 031-332 0570
031-332 0593
Fax: 031-312 0431

EMAIL: elitepestcontrol@telkomsa.net

ENTOMOLOGIST REPORT

<u>Property:</u>	University Of Kwa Zulu Natal	<u>Date:</u>	04 April 2023
<u>Address:</u>	Chemistry Building Alan Paton Road Pietermaritzburg	<u>Inspection No.:</u>	1366711
		<u>Inspected By:</u>	A.Budhram
		<u>Estimated Age Of Bldg:</u>	Unknown

Building Ref: Block-"B"

Type Of Building: Double Storey with Sub Floor.

Description Of Roof: Oregon Pine Roof Timbers with Asbestos Roof Sheeting. Isolated Activity of Wood Borer Noted

Joinery: Varnished Wooden Meranti Doors & Frames.
Steel Painted Windows & Frames.
Internal Portioning: Painted meranti with glass.


Skirtings: Varnished Wooden

Ceilings: Painted Rhino Board Ceilings.

Floors: Laboratories Have Wooden Varnished Flooring. No Visible Activity Of Wood Borer/Termites.
Offices: Carpets On floors. (Not Lifted For Inspection)
Ablution Facilities: Tiles On Floors.

Findings: Isolated Activity Of Wood Borer in Main Roof Timbers – 5 Beams Have *Mild* Activity. No Fumigation Required.
Laboratory Stores (Room 21), Have Active Termite Infestation in Door Farme.

Recommendation: The Roof Trusses that have been identified with Wood Borer Activity be Drilled And Injected with approved Timber Preservative (CTX 103), Thereafter all roof Timbers be sprayed to Drip Of Rate Of Application as A Preventative Treatment.
Termites Treatment: To Drill & Inject concrete slab from External thereafter Inject a High residual Termite Barrier. Entry points to be sealed to match existing surface finish. To Access The Sub-Floor And Spray Total Area Of Sub-Floor For Active Termites. Upon completion of Termite Treatment, A minimum guarantee of 5 years to be issued against Re-Infestation.

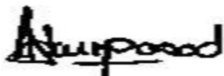

.....
Mr A. Budhram
Reg: WDO No: 0139- SAPCA
Reg: P17935 – Dept. Of Agriculture



ELITE PEST CONTROL cc

Specialising in: Termite Treatments, Wood borer, Marine & Warehouse fumigation, Bird Proofing, Industrial Cleaning & Building Maintenance

314 Mathews Meyiwa Road
Morningside
Durban

Tel: 031-332 0570
031-332 0593
Fax: 031-312 0431

EMAIL: elitepestcontrol@telkomsa.net

ENTOMOLOGIST REPORT

<u>Property:</u>	University Of Kwa Zulu Natal	<u>Date:</u>	04 April 2023
<u>Address:</u>	Chemistry Building Alan Paton Road Pietermaritzburg	<u>Inspection No.:</u>	1366712
		<u>Inspected By:</u>	A.Budhram
		<u>Estimated Age Of Bldg:</u>	Unknown

Building Ref: Block-“C”

Type Of Building: Double Storey. Sub Floor

Description Of Roof: Solid Concrete Slab (Water Proofed). No Timber Structures.

Joinery: Varnished Wooden Meranti Doors & Frames.
Steel Painted Windows & Frames.


Skirtings: Varnished Wooden

Ceilings: Nil.

Floors: Laboratories Have Marley Tiles On Floors. No Visible Activity Of Wood Borer/Termite.
Offices: Carpets On floors. (Not Lifted For Inspection)
Ablution Facilities: Tiles On Floors.

Findings: In Physical Chem Laboratory Wall Mounted Work Top has Active Infestation Of Wood Borer.
Visible Termite Activity in Door Frame. (x2).

Recommendation: The affected Timber that have been identified with Wood Borer Activity be Drilled And Injected with approved Timber Preservative (CTX 103).
Termites Treatment: To Drill & Inject concrete slab from External thereafter Inject a High residual Termite Barrier. Entry points to the sealed to match existing surface finish. To Access The Sub-Floor And Spray Total Area Of Sub-Floor For Active Termites. Upon completion of Termite Treatment, A minimum guarantee of 5 years to be issued against Re-Infestation.

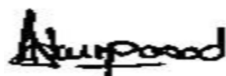

Mr A. Budhram
Reg: WDO No: 0139- SAPCA
Reg: P17935 – Dept. Of Agriculture

