

ENVIRONMENTAL MANAGEMENT PLAN

The Proposed Utilisation of Borrow Pits Road: DR08147 (OR Tambo District Municipality)

Department of Roads and Public Works Province of the Eastern Cape



Report Number 2011-R626

February 17, 2012

Biotechnology & Environmental Specialist Consultancy cc



PO Box 8241, Nagoon, 5210, East London, South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone 043 726 4242; Facsimile: 043 726 3199
E-mail: info@besc.co.za; Website: <http://www.besc.co.za>

Prepared on behalf of

**Department of Roads and Public Works
Province of the Eastern Cape**

by

Biotechnology and Environmental Specialist Consultancy cc

PO Box 8241, Nahoon, 5210, East London, South Africa
9 Douglas Road, Vincent, 5241, East London, South Africa

Telephone 043 726 4242; Facsimile: 043 726 3199

E-mail: info@besc.co.za; Website: <http://www.besc.co.za>

CONTENTS

1	Report Release Notice	8
2	Limitations	9
3	Limiting Conditions	9
4	Special conditions	9
5	Natural Science Professions Act.....	10
6	Primary Legislative Specifications	11
7	Legal Requirements.....	12
7.1	National Acts and Regulations	12
7.1.1	The Constitution of South Africa, Act No 106 of 1996	12
7.1.2	Mineral and Petroleum Resources Development Act.....	12
7.1.3	Mineral and Petroleum Resources Regulations	12
7.1.4	Mineral and Petroleum Resources Development Amendment Act	13
7.1.5	National Environmental Management Act.....	13
7.1.6	National Environmental Management Amendment Act.....	14
7.1.7	Environment Conservation Act.....	15
7.1.8	National Water Act	15
7.1.9	National Forests Act.....	15
7.1.10	Conservation of Agricultural Resources	16
7.1.11	National Environmental Management: Biodiversity Act.....	20
7.1.12	Provincial Nature Conservation Ordinance	20
7.1.13	Transkei Decree (9 of 1992).....	20
7.1.14	National Heritage Resources Act	21
7.1.15	National Environment Management: Air Quality Act	21
7.1.16	Explosives Act, 1956 (Act No 26 of 1956).....	22
7.1.17	Occupational Health and Safety Act.....	22
7.1.18	Mine Health and Safety Act.....	22
7.2	Plans, Policies & Guiding Principles	23
7.2.1	Provincial Spatial Development Plan	23
7.2.2	OR Tambo District Municipality - Integrated Development Plan (2010-2011).....	23
7.2.3	DWAF - Best Practice Guidelines	27
7.2.4	Department of Environmental Affairs Guidelines	28
8	Introduction	29
8.1	Objectives of the Environmental Management Plan	30
8.2	Integrated Environmental Management.....	30
8.3	Project Details	31
9	Project Description.....	32
9.1	Study Area	32
9.2	Current Land Use.....	33
9.3	Surrounding Land Use	33
9.4	Proposal.....	34

9.5	Borrow pit 147_BP01	36
9.6	Borrow pit 147_BP02	40
9.7	Need and Desirability	44
10	Environmental Setting	45
10.1	Landform & Geology	45
10.1.1	General Description:	45
10.1.2	Structural Geology:	45
10.2	Archaeology, Palaeontology & Heritage Sites	46
10.3	Topography and Drainage	46
10.4	Groundwater	47
10.5	Climate	47
10.6	Fauna	48
10.6.1	Reptiles & Amphibians	48
10.6.2	Mammals	50
10.6.3	Birds	51
10.6.4	Invertebrates	52
10.7	Flora	53
10.7.1	Eastern Cape Biodiversity Conservation Plan	53
10.7.2	General vegetation description	54
10.8	Socio - Economic Environment	56
11	The Affected Environment/ Site Descriptions	59
11.1	Geology and Soils	59
11.1.1	Erodibility Index	60
11.2	Archaeology, Palaeontology and Heritage Sites	61
11.3	Climate and Air Quality	62
11.4	Topography and Drainage	63
11.5	Fauna	66
11.6	Flora	66
11.6.1	Eastern Cape Biodiversity Conservation Plan (ECBCP)	66
11.6.2	Vegetation Description	68
11.6.2.1	Protection status and legislation and Species of Special Concern	69
11.6.2.1.1	Indigenous flora	69
11.6.2.1.2	Alien Invasive Plant species	69
11.7	Visual Aspects	70
11.8	Socio - Economic Environment	70
11.9	Existing Land-use	71
12	Potential Issues & Environmental Impacts	71
12.1	Geology & Soils	71
12.2	Topography & Drainage	72
12.3	Consumption of Non-renewable Resources	72
12.4	Surface Water/ Drainage lines	72
12.5	Groundwater	73
12.6	Vegetation Removal (Flora) and Habitat Disturbance	73
12.7	Air Quality	75
12.8	Noise	75
12.9	Visual Impact	75
12.10	Archaeology, Palaeontology & Heritage Sites	75
12.11	Land use	75

12.12	Socio-Economic Environment.....	75
12.13	Health and Safety.....	76
13	Environmental Impact Significance Assessment and Mitigation Measures	77
13.1	Environmental Impact Risk Assessment Methodology	77
13.2	Sensitivity.....	79
13.3	Impacts	79
14	Mitigatory Measures & Environmental Management	89
14.1	Responsibilities of the Role Players.....	89
14.1.1	Developer.....	89
14.1.2	Consulting Engineer.....	89
14.1.3	Contractor	90
14.1.4	Environmental Control Officer (ECO).....	90
14.1.5	Environmental Liaison Officer (ELO).....	91
14.2	General Requirements.....	91
14.2.1	Mining Plans.....	91
14.2.2	Demarcating the mining area	91
14.3	Infrastructural Requirements.....	92
14.3.1	Topsoil Management.....	92
14.3.1.1	Topsoil stripping	92
14.3.1.2	Soil stockpiling.....	93
14.3.2	Access to the Borrow Pit Sites	93
14.3.2.1	Establishment of Access Roads.....	93
14.3.2.2	Maintenance of Access Roads.....	94
14.3.2.3	Dust control on the access and haul roads	94
14.3.2.4	Rehabilitation of access roads	94
14.3.3	Office/Camp Sites	95
14.3.3.1	Establishing Office/Camp Sites.....	95
14.3.3.2	Toilet facilities, waste water and refuse disposal.....	95
14.3.3.3	Rehabilitation of the office/camp site.....	96
14.3.4	Maintenance Yard & Storage Areas.....	97
14.3.4.1	Establishing the vehicle maintenance yard and secured storage areas.....	97
14.3.4.2	Maintenance of vehicles and equipment	98
14.3.4.3	Waste disposal	98
14.3.4.4	Rehabilitation of vehicle maintenance yard and secured storages areas.	99
14.4	Operational Procedures	99
14.4.1	Limitations on mining	99
14.4.2	Water Use License	99
14.4.3	Excavations.....	100
14.4.4	Rehabilitation of excavation areas	100
14.5	Vegetation Removal and Habitat Disturbance	101
14.6	Surface Waters/Drainage Lines	102
14.7	Stormwater Management.....	102
14.8	Air Emissions	103
14.9	Noise Management.....	104
14.10	Visual Quality	104
14.11	Health and Safety (safety of all contractors, employees and the general public).....	104
14.12	Emergency Procedures & Remediation	105
14.13	Fire Risk & Burning	105
14.14	Accidental leaks & spillages.....	106

14.15	Archaeology, Palaeontology & Heritage Sites	107
14.16	Socio-economic.....	108
14.17	Community Relations	108
14.18	Work Stoppage	108
14.19	Site Closure/Decommissioning	108
15	Quantum of Financial Provision for Rehabilitation	109
16	Environmental Awareness	110
17	Monitoring & Performance of the EMP.....	110
18	Environmental Objectives and Goals.....	110
18.1	Mine Closure	110
18.2	Socio-Economic Aspects	111
18.3	Archaeological, Palaeontological & Heritage Aspects	111
19	Public Participation	112
19.1	Advertisement	112
19.2	Key Interested and Affected Parties.....	112
19.3	Registered Interested and Affected Parties	114
19.4	Public Draft Environmental Management Plan Report.....	114
20	Mining Plans	115
21	Specialist Report.....	117
21.1	Materials Investigation	117
21.2	Archaeological & Palaeontological Assessments	119
22	Appendix A: Letters of Confirmation, Retention Monies & Undertaking.....	121
23	Appendix B: Advertisement placed in Daily Dispatch	123
24	Appendix C: Signboard	124
25	Appendix D: Public Participation - Correspondence	125
25.1	Correspondence issued to and received from Key I & AP's during the Public Participation ..	125
25.2	Correspondence issued to and received from Registered Interested and Affected Parties ..	159
25.3	Correspondence issued to and received from Key & Registered Interested Affected Parties during the Public Draft Review Commenting Period.....	160
26	Appendix E: Site Photographs	168
26.1	Borrow pit 147_BP01	168
26.2	Borrow pit 147_BP02	168
27	Appendix F: Mammal species of the Eastern Cape region	169
28	Appendix G: Bird species of the Eastern Cape region.....	171
29	Appendix H: Threatened Birds of the Eastern Cape	175

30	Appendix I: Borrow pit Information.....	177
31	Appendix J: Curriculum Vitae.....	178
31.1	Dr Malcolme Logie	178
31.2	Ms Lee-Anne Proudfoot	180
31.3	Mr Conroy van der Riet	182

LIST OF FIGURES

Figure 1:	The location of the borrow pits (1: 50 000 map).	33
Figure 2:	Aerial Image - Road DR08147 & associated BP's.....	34
Figure 3:	Topographical Location of 147_BP01 - 1:50 000 map.....	36
Figure 4:	147_BP01	37
Figure 5:	Topographical Location of 147_BP02 - 1:50 000 map.....	40
Figure 6:	147_BP02.....	41
Figure 7:	General vegetation and the location of the borrow pits.....	56
Figure 8:	The geology of the area in which the Borrow pits are located (3128 Umtata)	60
Figure 9:	Erodibility Index	61
Figure 10:	Drainage of the area in which the proposed borrow pits are located.	64
Figure 11:	Terrain view indicating the position of the borrow pits in the landscape.	65
Figure 12:	Eastern Cape Biodiversity Conservation plan and the location of the Borrow pits.	68
Figure 13:	Daily Dispatch Notice.	123
Figure 14:	Image of the Signboards erected for DR08147	124
Figure 15:	Borrow Pit # 147-BP01.	168
Figure 16:	Borrow Pit # 147-BP02.	168

LIST OF TABLES

Table 1:	Projects planned 2010/2011 Financial Year	25
Table 2:	Borrow pit Summary Table	35
Table 3:	Terrestrial mammal Red Data Book (RBD) species.....	51
Table 4:	Important Taxa - Pondoland- Ugu Sandstone Coastal Sourveld	55
Table 5:	Limits to Acceptable Change thresholds for six key lands use impact indicators.	67
Table 6:	Alien Invasive plants present within the area of the borrow pit 147_BP01.	69
Table 7:	EIA-RA 05© - Risk Assessment Ratings.	78
Table 8:	Assessment of Significance of Environmental Impacts.	81
Table 9:	Identified Key Interested & Affected Parties.	113
Table 10:	Registered Interested and Affected Parties.	114
Table 11:	Summary of comments made during the public participation.	114

1 Report Release Notice

<i>Report Status</i>	<i>Date</i>	<i>Authorised</i>
1. Internal Draft	December 05, 2011	Ms Lee-Anne Proudfoot
2. Client Draft	December 06, 2011	Mr Conroy van der Riet
3. Public Draft	January 12, 2012	Ms Lee-Anne Proudfoot
4. Final Report	February 17, 2012	Ms Lee-Anne Proudfoot

This Environmental Management Plan Report has been prepared by BESC the trading name of Biotechnology & Environmental Specialist Consultancy cc, with all reasonable skill, care and diligence within the terms of the Contract with the client, incorporating our Standard Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client.

BESC disclaims any responsibility to the client and others in respect of any matters outside the scope of the above.

This Environmental Management Plan Report is exclusive to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies on the report at their own risk.

2 Limitations

BESC has prepared this report for the sole use of **DEPARTMENT OF ROADS & PUBLIC WORKS** in accordance with generally accepted consulting practises and for the intended purposes as stated in the agreement under which this work was completed. This report may not be relied upon by any other party without the explicit written agreement of **DEPARTMENT OF ROADS & PUBLIC WORKS** and **BESC**. No other warranty, expressed or implied, is made as to the professional advice included in this report.

The conclusions and recommendations contained in this report are based upon information provided by others and the assumption that all relevant information has been provided by those bodies from whom it has been requested. Where field investigations have been carried out, they have been restricted to a level of detail required to achieve the stated objectives of the work.

All items listed in BESC's Standard Terms and Conditions of Business are applicable to this report.

3 Limiting Conditions

This report was compiled from information obtained from the following sources:

1. Numerous site visits and assessments
2. Public participation
3. Information on biophysical environment - BESC
4. Information on Borrow pits - Controlab cc
5. Archaeological & Heritage Assessment - ArchaeoMaps
6. Palaeontological Impact Assessment -Metsi Metseng Geological & Environmental Services

4 Special conditions

None

5 Natural Science Professions Act

The Principal of BESC, Dr Malcolme Logie, is registered with the:

- South African Council for Natural Scientific Professions (SACNASP), in accordance with the Natural Sciences Professions Act (Act 27 of 2003), as a *Professional Natural Scientist - Environmental Scientist*. As such work undertaken by BESC in Environmental Management complies with the requirement of the Act, which states, “*only individuals registered may practice in a consulting capacity.*”
- The South African Institute of Ecologist & Environmental Scientist, and is registered as a *Professional Member - Environmental Scientist*.
- Certification Board of the Environmental Assessment Practitioners of South Africa (EAPSA), as a *Certified Environmental Assessment Practitioner*
- International Association of Impact Assessors - South Africa
- Senior Lead Auditor: Bureau Veritas (Safety, Health, Environment & Quality)
- Lead Auditor: TUV (Safety, Health, Environment)
- Lead Auditor: British Standard Institute (Safety, Health, Environment)

Senior Environmental Consultants:

Ms Lee-Anne Proudfoot, is registered with the:

- South African Council for Natural Scientific Professions (SACNASP), in accordance with the Natural Sciences Professions Act (Act 27 of 2003), as a *Professional Natural Scientist - Environmental Scientist*. As such work undertaken by BESC in Environmental Management complies with the requirement of the Act, which states, “*only individuals registered may practice in a consulting capacity.*”
- International Association of Impact Assessors - South Africa

Mr Conroy van der Riet is registered with the:

- South African Council for Natural Scientific Professions (SACNASP), in accordance with the Natural Sciences Professions Act (Act 27 of 2003), as a *Professional Natural Scientist - Environmental Scientist*. As such work undertaken by BESC in Environmental Management complies with the requirement of the Act, which states, “*only individuals registered may practice in a consulting capacity.*”
- International Association of Impact Assessors - South Africa

6 Primary Legislative Specifications

Primary Environmental Legislation governing the Scope of Work undertaken is:

- GN R.1273: Mineral and Petroleum Resources Development Act, 2002, No. 28 of 2002.
- GN R. 527: Mineral and Petroleum Resources Development Act, 2002, (No. 28 of 2002): Mineral and Petroleum Resources Development Regulations, 2004.
- GN R.543: Regulations in terms of Chapter 5 of the National Environmental Management Act, 1998;

for the proposed utilisation of borrow pits for the routine maintenance/re-gravelling of the DR08147.

The permitting of the materials sources required for the project will be undertaken in accordance with the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002). It must be noted that the applicant (Department of Roads and Public Works), as an organ of state, has obtained exemption from the provisions of sections 16, 20, 22 and 27 (application processes) of the M&PRDA in respect of any activity to remove any mineral for the construction and maintenance of dams, harbours, roads and railway lines and for purposes incidental thereto, as allowed for by the said Act in section 106 (1). As such the utilisation of the material sources is subject only to the preparation, submission and approval of an Environmental Management Plan compiled in accordance with requirements of the M&PRDA.

7 Legal Requirements

7.1 National Acts and Regulations

7.1.1 The Constitution of South Africa, Act No 106 of 1996

Chapter 2 of the Bill of Rights that forms part of The Constitution of South Africa provides for an 'environmental right', and in terms of Section 7, the State is obliged to respect, promote and fulfil the rights in the Bill of Rights. An obligation is therefore placed on the State to give effect to the environmental right and this is achieved through the right of everyone:

- To an environment that is not harmful to their health or well-being,
- To have the environment protected, for the benefit of present and future generations, though reasonable legislative and other measures that:
 - Prevent pollution and ecological degradation,
 - Promote conservation,
 - Secure ecologically sustainable development and use of natural resources while promoting justifiable economic and social development.

7.1.2 Mineral and Petroleum Resources Development Act

The Minerals and Petroleum Resources Development Act, 2002 (Act No 28 of 2002) was developed to ensure that provision is made for equitable access to, and sustainable development of, South Africa's mineral and petroleum resources and to provide insight, guidance and control for matters connected thereto. It seeks to provide management tools that ensure that all mining operations are undertaken in an environmentally sound manner according to government approved documents that hold the applicant responsible for any environmental degradation that their mining actions might cause. It also seeks to expand opportunities for historically disadvantaged South Africans and promote employment and welfare of SA citizens. It ensures that holders of mining and production rights contribute towards the socio-economic development of the areas in which they operate.

7.1.3 Mineral and Petroleum Resources Regulations

Regulations in terms of Section 107(1) of the Act were published in Government Notice No. R. 526 on the 23rd April 2004. The regulations provide details of the procedures to be followed in applying for or renewing mining and prospecting rights and permits and for the closure of mining operations as provided and described in the Mineral and Petroleum Resources Development Act (M&PRDA).

Department of Roads and Public Works, as an organ of state, has applied for exemption from certain provisions of the Act, as allowed in terms of Section 106(1). Utilization of any material sources is therefore subject to the preparation, submission and approval of an Environmental Management Plan compiled in accordance with Section 39(2) and Regulation 52 of the M&PRDA.

7.1.4 Mineral and Petroleum Resources Development Amendment Act

The Mineral and Petroleum Resources Development Act, 2009 (Act No 49 of 2009) was gazetted on the 21 April 2009 in order to amend the Mineral and Petroleum Resources Development Act, 2002, so as to make the Minister the responsible authority for implementing environmental matters in terms of the National Environmental Management Act, 1998 and specific environmental legislation as it relates to prospecting, mining, exploration, production and related activities or activities incidental thereto on a prospecting, mining, exploration or production area; to align the Mineral and Petroleum Resources Development Act with the National Environmental Management Act, 1998 in order to provide for one environmental management system, to remove ambiguities in certain definitions; to add functions to the Regional Mining Development and Environmental Committee; to amend the transitional arrangements so as to further afford statutory protection to certain existing old order rights; and to provide for matters connected therewith.

Any provision related to prospecting, mining, exploration and production and related activities comes into operation only 18 months after the commencement of the M&PDRA Amendment Act.

7.1.5 National Environmental Management Act

The National Environmental Management Act (Act 107 of 1998) (NEMA), has largely superseded the Environment Conservation Act (Act 73 of 1989), and now serves as a framework for environmental management, in which development must be socially, environmentally and economically sustainable.

Section 2(1) of NEMA sets out a range of environmental principles that are to be applied by all organs of state when taking decisions that significantly affect the environment. Included amongst the key principles is the directive that all development must be socially, economically and environmentally sustainable, and that environmental management must place people and their needs at the forefront of its concern, and serve their physical, psychological, developmental, cultural and social interests equitably. Therefore the proposed development must to consider the following principles:

- Environmental management must be integrated, taking into account the effects of decisions on all aspects of the environment and on all people;

- Environmental justice must be pursued to ensure that adverse impacts are not distributed in a manner so as to unfairly discriminate against any person, particularly vulnerable or disadvantaged persons;
- Equitable access to environmental resources, benefits and services to meet basic human needs and to ensure that human well-being is pursued;
- The participation of Interested & Affected Parties (I&AP's) in environmental governance must be promoted;
- Community well-being and empowerment must be promoted through environmental education;
- The social, economic and environmental impacts of activities, including disadvantages and benefits, must be considered, assessed and evaluated, and decisions must be appropriate in light of these considerations; and
- Decisions must be taken in an open and transparent manner.

In terms of the current regulations, Section 1 of Government Notice R544 (2010), Section 1 of Government Notice R545 (2010) and Section 1 of Government Notice R546 (2010), provides a schedule of activities which may have a substantial detrimental effect on the environment, and which require authorisation by the DWEA (formerly DEAT) before they may commence. With regards to the proposed utilisation of the identified borrow pits, no listed activities requiring environmental authorisation have been triggered.

7.1.6 National Environmental Management Amendment Act

On 1 May 2009 the National Environmental Management Amendment Act, 2008 (Act No. 62 of 2008) ("the NEMA Amendment Act"), came into operation. The NEMA Amendment Act has implications on the way in which the Environmental Impact Assessment ("EIA") process is implemented.

It serves to amend the National Environmental Management Act, 1998, so as to insert certain definitions and to substitute others; to further regulate environmental authorisations; to empower the Minister of Minerals and Energy to implement environmental matters in terms of the National Environmental Management Act, 1998, in so far as it relates to prospecting, mining, exploration, production or related activities on a prospecting, mining, exploration or production area; to align environmental requirements in the Mineral and Petroleum Resources Development Act, 2002, with the National Environmental Management Act, 1998, by providing for the use of one environmental system and by providing for environmental management programmes, consultation with State departments, exemptions from certain provisions of the National Environmental Management Act, 1998, financial provision for the remediation of environmental damage, the management of residue stockpiles and residue deposits, the recovering

of cost in the event of urgent remedial measures and the issuing of closing certificates as it relates to the conditions of the environmental authorisation; and to effect certain textual alterations; and to provide for matters connected therewith.

7.1.7 Environment Conservation Act

The Environmental Conservation Act (Act 73 of 1989) aimed “to provide for the effective protection and controlled utilization of the environment and for matters incidental thereto”, and predated NEMA as the country’s primary environmental statute. Much of the ECA was repealed with the promulgation of NEMA, with the environmental impact assessment regulations in turn being repealed when the regulations under NEMA mentioned in the previous section were adopted. The foundation before this promulgation consisted of Parts V and VI of the ECA that related to the “control of activities which may have detrimental effect on the environment”.

In addition, section 25 of the Act makes provision for the regulations regarding noise, vibration and shock. These regulations are provided for Noise Control.

7.1.8 National Water Act

The National Water Act (Act 36 of 1998) (NWA) provided fundamental law relating to water resources. The preamble to the Act recognises that the ultimate aim of water management is to achieve sustainable use of water for the benefit of all users, and that the protection of the quality of water resources is necessary to ensure sustainability of the nation’s water resources in the interests of all water users. The purpose of the Act is stated, in Section 2 as, *inter alia*:

- Promoting the efficient, sustainable and beneficial use of water in the public interest;
- Facilitating social and economic development;
- Protecting aquatic and associated ecosystems and their biological diversity; and
- Reducing and preventing pollution and degradation of water resources.

7.1.9 National Forests Act

The principles of the National Forests Act (Act 84 of 1998) (NFA) pertain to:

- The protection of natural forests (except under exceptional circumstances where the Minister determines that the proposed new land use is preferable in terms of its economic, social or environmental benefits);
- The conservation of a minimum area of each woodland type; and
- The management of forests to ensure sustainability of resources (wood, soil, biological diversity, etc).

No person may cut, disturb, damage or destroy any indigenous living tree in, or remove or receive any such tree from, a natural forest except in terms of-

- (a) A license issued under subsection (1) or section 23; or
- (b) An exemption from the provisions of this subsection published by the Minister in the Gazette on the advice of the Council.

The Minister may declare to be a natural forest a group of indigenous trees whose crowns are not largely contiguous; or where there is doubt as to whether or not their crowns are largely contiguous, if he or she is of the opinion based on scientific advice, that the trees make up a forest which needs to be protected in terms of this Part.

The Minister declares a forest to be a natural forest by publishing a notice in the Gazette; and publishing a notice in two newspapers circulating in the area; and airing a notice on two radio stations broadcasting to the area.

The Minister may issue a licence to cut, damage or destroy any indigenous, living tree in. or remove or receive any such tree from a natural forest.

7.1.10 Conservation of Agricultural Resources

The Conservation of Agricultural Resources Act (Act 13 of 1983) makes provision for the actions required with regard to any plant species depend on the *category* in which the plant appears of the amended regulations, and might differ from province to province. In certain cases, special conditions were added that apply only to that specific species.

Category 1 plants, or declared weeds

These are prohibited plants that will no longer be tolerated, neither in rural nor urban areas, except with the written permission of the executive officer or in an approved biocontrol reserve. These plants may no longer be planted or propagated, and all trade in their seeds, cuttings or other propagative material is prohibited. They may not be transported or be allowed to disperse.

Plant species were included in this list for one or more of the following reasons: they might pose a serious health risk to humans or livestock, cause serious financial losses to land users, be able to invade undisturbed environments and transform or degrade natural plant communities, use more water than the plant communities they replace or be particularly difficult to control.

Most of the plants in this category produce copious numbers of seeds, are wind or bird dispersed or have highly efficient means of vegetative reproduction. Whereas some of these plants were introduced inadvertently, have no obvious function to fulfil in South Africa and are generally regarded as undesirable, many of them are popular garden or landscaping plants. What they all have in common, however, is the fact that their harmfulness outweighs any useful properties they might have. Care was taken not to include a plant in this category if part of the population of South Africa would suffer because of its absence. The ornamentals in this category ought to be reasonably easy to replace with less invasive substitutes.

Plant invaders of Category 2

These are plants with the proven potential of becoming invasive, but which nevertheless have certain beneficial properties that warrant their continued presence in certain circumstances. CARA makes provision for Category 2 plants to be retained in special areas demarcated for that purpose, but those occurring outside demarcated areas have to be controlled. The exception is that Category 2 plants may also be retained or cultivated in biological control reserves, where the plants will serve as host plants for the breeding of biological control agents. The growing of Category 2 plants in a demarcated area qualifies as a water use, and is subject to the requirements of section 21 of the National Water Act, 1998 (Act No. 36 of 1998).

An area can only demarcated for the growing of Category 2 plants by the Executive Officer. The land user needs to obtain a water use license; the plants have to primarily serve a commercial or utility purpose, such as a woodlot, shelter belt, building material, animal fodder, soil stabilization, medicinal or own consumption; the conditions under which they are cultivated, have to be controlled; all reasonable steps have to be taken to curtail the spreading of seeds or vegetatively reproducing material outside the demarcated area, and all specimens outside the demarcated area have to be controlled. The Executive Officer has the power to impose additional conditions to ensure the adequate control of Category 2 plants in demarcated areas.

Seed or other propagative material of Category 2 plants may only be sold to, and acquired by, land users of areas demarcated for the growing of that species, or for the establishment of a biocontrol reserve. Category 2 plants may not occur within 30 m from the 1:50 year flood line of watercourses or wetlands, unless authorization has been obtained in terms of the National Water Act. The Executive Officer has the power to grant exemption from some of the above requirements.

Plant invaders of Category 3

These plants are undesirable because they have the proven potential of becoming invasive, but most of them are nevertheless popular ornamentals or shade trees that will take a long time to replace. A few of them were placed into this category instead of into category 1 because they do not cause problems in all situations. In terms of Regulation 15 of CARA, Category 3 plants will not be allowed to occur anywhere except in biological control reserves, unless they were already in existence when these regulations went into effect. The conditions on which these already existing plants may be retained are that they do not grow within 30 m from the 1:50 year flood line of watercourses or wetlands, that all reasonable steps are taken to keep the plant from spreading, and that the Executive Officer has the power to impose additional conditions or even prohibit the growing of Category 3 plants in any area where he has reason to believe that these plants will pose a threat to the agricultural resources.

Propagative material of these plants, such as seeds or cuttings, may no longer be planted, propagated, imported, bought, sold or traded in any way. It will, however, be legal to trade in the wood of Category 3 plants, or in other products that do not have the potential to grow or multiply. The Executive Officer will have the power to grant exemption from some of the above requirements.

Control methods

The amended regulations stress that, when controlling plants that occur in areas where they are not allowed, methods should be used that are appropriate for the species concerned as well as to the ecosystem in which they occur. One or a combination of the following control methods may be used: uprooting, felling, cutting, burning, treatment with registered herbicides, biological control or any other recognized and appropriate method. Repetitive follow-up actions will be mandatory until the required control has been achieved.

The aim of control is to reach a point where, ideally, the plants concerned do no longer occur in that particular area or, at least, where the plants can no longer grow, produce viable seeds or spores, coppice, sprout or produce root suckers, reproduce vegetatively, propagate themselves in any other way, or spread into other areas. If this is not possible, the plants have to be contained and their multiplication limited as far as possible.

When controlling weeds and invaders, damage to the environment has to be limited to the minimum. CARA does not specify the types of environmental damage that might be caused by control actions, but a few examples would be:

1. The removal of or herbicidal damage to non-target plants
2. The chemical pollution of soil or water or any other threat to non-target organisms
3. The irresponsible use of fire
4. The creation of a fire hazard by allowing flammable material to accumulate in fire-sensitive areas
5. Unnecessary or irresponsible disturbance of the soil, especially on riverbanks or slopes
6. Failure to rehabilitate denuded areas so as to prevent soil erosion and invasion by other undesirable species
7. Any other action that might upset the ecological balance of the environment.

Biological control of weeds is subject to rigorous regulations, and will be recognized by CARA as a valid control method only if it is practiced in accordance with all these regulations. Biological control involves the use of host-specific natural enemies of weeds or invaders from the plant's country of origin, to either kill or remove the invasive potential of these plants. It may only be initiated by and carried out under the supervision of an academic or research institute or organization established by legislation, which practises and researches biological control of weeds and invader plants. In order to prevent the waste of biocontrol research effort, money and natural enemies, CARA also lays down certain rules for the protection of biological control agents. In areas where biological control is effective, no additional control methods should be used that would harm the biocontrol agents. Provision is made for certain areas to be set aside as biological control reserves, i.e. areas in which a number of invasive plants are maintained as host plants for the biological control agents, to ensure the continued presence of the agents in that area. Only the Executive Officer may designate a biological control reserve, on condition that it is used by a biocontrol expert to rear and redistribute biocontrol agents. In such a biological control reserve, no measures may be applied that would render the biocontrol agents ineffective.

Nothing contained in Regulation 15 may be used as a reason for ignoring or circumventing any other laws.

7.1.11 National Environmental Management: Biodiversity Act

The Biodiversity Act (Act 10 of 2004) falls within the framework of the National Environmental Management Act and provides for:

- The management and conservation of biological diversity and of components of such biodiversity;
- Protection of species and ecosystems that warrant National protection;
- Sustainable use of indigenous biological resources;
- The fair and equitable sharing of benefits arising from bio-prospecting including indigenous biological resources; and
- The establishment of a National Biodiversity Institute.

Furthermore it gives affect to ratified international agreements relating to biodiversity which are binding on the Republic, it provides for co-operative governance in biodiversity management and conservation, and provides for a South African National Biodiversity Institute to assist in achieving the objectives of this Act.

7.1.12 Provincial Nature Conservation Ordinance

Protected indigenous plants in general are currently controlled under the relevant provincial Ordinances or Acts dealing with nature conservation. The Eastern Cape falls under the Cape Nature and Environmental Conservation Ordinance (1974). In terms of this Ordinance, a permit must be obtained from Department of Economic Affairs Environment and Tourism (DEDEA) to remove or destroy any plants listed as 'endangered', and a letter of consent form the landowner must be obtained to remove or destroy any plants listed as 'protected' in the Ordinance.

7.1.13 Transkei Decree (9 of 1992)

The purpose of the Transkei Decree is to consolidate and amend laws relating to the conservation, management, protection and commercial utilization of indigenous fauna and flora and their habitats on land, in fresh water and in the sea; excluding national parks. To provide for the establishment of national wildlife reserves, protected natural environments, limited development areas, camping areas, hiking trails and coastal conservation areas.

In terms of this decree, the coastal conservation areas applies to the 1 km strip along the entire former Transkei coastline (excluding Municipal land), which is measured from the high water mark of the seashore and relevant tidal estuaries to 1 km inland. The Decree makes provision for various forms of legislation to manage development and conserve, protect and control the utilisation of indigenous fauna

and flora within the coastal strip. This implies that any development within the 1 km coastal strip requires approval in terms of the Transkei Decree, 1992. The administration of this Decree is the responsibility of the Eastern Cape DEDEA. In the event of an environmental authorization being authorised (in terms of the EIA procedures), a development permit will be issued by DEDEA based on such environmental authorization. However the development site is not located within this 1 km strip.

This decree provides a number of schedules which protect indigenous endangered & protected Fauna & Flora. According to Chapter 3 permits are required from the Eastern Cape DEDEA should a person hunt, kill, capture, sell, buy, donate, receive, remove, disturb, interfere etc any endangered or protected fauna listed in the schedules of the Transkei Decree. According to Chapter 4 no person may without a permit from the Eastern Cape DEDEA be in possession of, pick, sell etc any endangered or protected flora listed in the schedules of the Transkei Decree.

7.1.14 National Heritage Resources Act

The purpose of the National Heritage Resources Act (Act 25 of 1999) is to:

- Introduce an integrated and interactive system for the management of the national heritage resources;
- Promote good government at all levels, and empower civil society to nurture and conserve their heritage resources so that they may be bequeathed to future generations;
- Introduce an integrated system for the identification, assessment and management of the heritage resources of South Africa;
- Control the export/import of nationally significant heritage objects;
- Enable the province to establish heritage authorities which must adopt powers to protect and manage certain categories of heritage resources; and
- Provide for the protection and management of conservation worthy places and areas by local authorities.

Part 2 of the Act provides for the protection and preservation of structures, sites of archaeological and palaeontological sites, meteorite sites, burial grounds and graves, public monuments and memorials. It also includes the procedures and requirements for heritage resources management.

7.1.15 National Environment Management: Air Quality Act

The Atmospheric Pollution Prevention Act has been repealed by the National Environmental Management: Air Quality Act, 2004 (Act No 39 of 2004). The purpose of the National Environmental Management: Air Quality Act (Act 39 of 2004) is to regulate air quality in order to protect the

environment by providing reasonable measures for the prevention of pollution and ecological degradation and for securing ecologically sustainable development while promoting justifiable economic and social development; to provide for national norms and standards regulating air quality monitoring, management and control by all spheres of government; for specific air quality measures; and for matters incidental thereto.

7.1.16 Explosives Act, 1956 (Act No 26 of 1956)

For blasting, a permit must be obtained from the Department of Mineral Resources in accordance with this Act.

7.1.17 Occupational Health and Safety Act

The Occupational Health and Safety Act, 1993 (No 85 of 1993) provides for the health and safety of persons at work; for the health and safety of persons in connection with the use of plant and machinery; and the protection of persons other than persons at work against hazards to health and safety arising out of or in connection with the activities of persons at work. A number of regulations are published under this Act, including:

- Environmental Regulations for Workplaces (GN R2281 of 1987-10-16)
- Regulations for Hazardous Chemical Substances (GN R1179 of 1995-08-25)
- Asbestos Regulations, 2002 (GN R155 of 2002-02-10)
- Explosives Regulations (GN R109 of 2003-01-17)

7.1.18 Mine Health and Safety Act

The Mine Health and Safety Act, 1996 (No 26 of 1996) provides for the protection of health and safety of employees and other persons at mines and serves -

- To promote a culture of health and safety;
- To provide for the enforcement of health and safety measures;
- To provide for appropriate systems for employee, employer and state participating in health and safety matters;
- To provide effective monitoring systems and inspections, investigations and inquiries to improve health and safety;
- To promote training and human resource development;
- To regulate employers' and employees' duties to identify hazards and eliminate, control and minimise the risk to health and safety;
- To entrench the right to refuse to work in dangerous conditions; and

- To give effect to public international law obligations of the Republic relating to mine health and safety.

7.2 Plans, Policies & Guiding Principles

7.2.1 Provincial Spatial Development Plan

The Eastern Cape has approved a Provincial Spatial Development Plan. The plan supports the view that the focus of development should be on developing nodes and areas where economic opportunities can be stimulated, particularly in the central and eastern areas of the province. The plan identifies key spatial development issues, main development nodes and zones where development should be encouraged. It aims to encourage consolidated settlement through the improved provision of infrastructure and facilities in targeted areas reinforcing the strategic advantages offered by coastal tourism nodes. For the coast in general the plan discourages linear development and places emphasis on the establishment of nodal developments to build on existing strengths and minimize environmental impacts. The plan also outlines environmentally sensitive areas where development should not be permitted. These are:

- State forests
- Dune forests and estuaries
- Within 30 meters of watercourses along major rivers
- Game reserves and nature sanctuaries
- Slopes steeper than 1:6
- Historic heritage sites
- River basin catchment areas

7.2.2 OR Tambo District Municipality - Integrated Development Plan (2010-2011)

The Municipal Systems Act 32 of 2000, Chapter 5 - part 3 prescribes that Municipal Council must review its Integrated Development Plan (IDP) annually in accordance with its performance measurements to the extent that changing circumstances so demand. This involves an assessment of the Municipality's performance and achievement of its targets and strategic objectives. The Council must also amend its IDP in accordance with a prescribed process. The IDP is annually reviewed to reflect the impact of successes, while corrective measures are applied to address development problems that may arise. This is done to ensure its relevance as the Municipality's Strategic Plan, informing other components of the municipal business processes including institutional development, financial planning, cyclical inter-governmental planning and budgeting. Section 26 of the MSA prescribes the following peremptory components that an IDP must reflect on:

- The municipal council's vision including the municipal critical developmental and transformation needs;
- An assessment of existing level of development in the municipality;
- The council's developmental priorities and objectives including its local economic development aims;
- The councils' development strategies which must be aligned to national and provincial sector plans;
- A spatial development framework which must include the provisions of basic guidelines for a land use management system;
- The council's operational strategies;
- Applicable disaster management plans;
- A financial plan, which must include a budget projection for the next three years; and
- The key performance indicators and performance targets determined in terms of section 41.

The Municipal Planning and Performance Management Regulations (2001) set out the following further requirements for an IDP:

- An institutional framework for implementation of the IDP and to address the municipality's internal transformation;
- Investment initiatives must be clarified;
- Development initiatives including infrastructure, physical, social and institutional development and;
- All known projects, plans and programmes to be implemented within the municipality by any organ of state.

The Municipal Finance Management Act (MFMA) provides for closer alignment between the Annual Budget and the compilation of the IDP.

To give effect to the said mandates, the IDP has been legislated as a planning mechanism to be adopted by municipalities (Chapter 5 of the MSA No. 32 of 2000). The council of O.R Tambo district municipality is reviewing an Integrated Development Plan (IDP) to adopt it for implementation during (2010/2011) financial year. The IDP as a strategic development plan is reviewed annually to guide all development in a municipal area and inform municipal budgeting and resource allocation. It also plays a pivotal role in informing all planning processes of the other spheres of government (National and Provincial) as well as all state owned enterprises. The development of an IDP as legislated in chapter 5

of the Local Government Municipal Systems Act No.32 of 2000, amongst others prescribes the content of such a plan (section 27 of this Act), as follows:

- The municipal council's vision for the long-term development of the municipality with special emphasis on the municipality's most critical development and internal transformation needs;
- An assessment of the existing level of development in the municipality, including identification of communities which do not have access to basic services;
- The council's development priorities and objectives for its elected term, including its local economic development aims and its internal transformation needs;
- The council's development strategies aligned with those of national and provincial sectoral plans and planning requirements binding on the municipality in terms of legislation;
- A spatial development framework including basic guidelines for land use management system for the municipality;
- The council's operational strategies;
- Applicable disaster management plans;
 - A financial plan and budget projection for the next three year; and
 - The key performance indicators and performance targets determined in terms of section 41 of the Municipal Systems Act.

The main purpose of an IDP is to foster more appropriate service delivery by providing the framework for economic and social development within the municipality. In doing so it:-

- i. Contributes towards eradicating the development legacy of the past.
- ii. Operationalizes the notion of developmental local government.
- iii. Foster a culture of co-operative governance.

Projects related to Roads and Transport includes the following:

Table 1: Projects planned 2010/2011 Financial Year

Department of Roads and Transport Projects planned 2010/2011 Financial Year					
Name of project	Indicative Budget	Location of project	Implementing agent	Project output	Duration
Wild Coast Meander Zithulele to Coffee Bay (Ph 1)	13,000	Port St Johns,	DORT	Tarred roads / Surfaced roads	Mar-11
Wild Coast Meander: Madwaleni Hospital Road (Ph 2)	20,000	KSD	DORT	Tarred roads / Surfaced roads	Mar-11
Greenville Hospital Road (Ph 2)	20,000	Mbizana	DORT	Tarred roads / Surfaced roads	Mar-11

R61 to Holy Cross Hospital	18,200	Mbizana	DORT	Surfaced Road	Mar-10
Continuation to Holy Cross Hospital	7,800	Mbizana	DORT	Surfaced Road	Aug-10
Ngqeleni to Mthatha Mouth	10,400	KSD	DORT	Surfaced Road	Nov-09
R61 Sitshayela to Tembukazi	11,700	Ngquza	DORT	Surfaced Road	Nov-10
Bizana to Port Edward (Magusheni-Mzamba)	600,000	Mbizana	DORT	Tarred roads / Surfaced roads	Mar-15
Phakade to Magusheni	220,000	Bizana , Ngquza	DOR	Tarred roads / Surfaced roads	Mar-11
T125: Siphetu Hospital	350,000	Ntabankulu	DOR	Tarred roads / Surfaced roads	Mar-11
Hluleka Road Project	28,000	Nyandeni	DORT	Tarred roads / Surfaced roads	Mar-11
Urban Renewal Lusikisiki	13,000	Ngquza	DORT	Tarred roads / Surfaced roads	Mar-11
Household Contractor Road Maintenance	34,000	KSD, Mhlontlo	DORT	Minor maintenance works (culverts cleaning, surface maintenance, grass cutting, control stray animals, etc.)	Mar-11
EPWP projects	8,360	7 Local Municipalities	DORT	Minor maintenance works (surface maintenance, fencing, grass cutting and bush clearing, etc).	Mar-11
DR 08313 to Canzibe Hospital	33,800	Nyandeni	DORT	Tarred roads / Surfaced roads	Jun-11
DR 08170 to Lutana Clinic	23,400	Mhlontlo	DORT	Tarred roads / Surfaced roads	Dec-10
DR 08026 & DR 08149 to Magwa Tea Plantation	22,100	Quakeni	DORT	Tarred roads / Surfaced roads	Oct-10
DR 08269 (Lindile)	5,200	KSD	DORT	Tarred roads / Surfaced roads	Sep-11
DR 08288 & DR 08033 & DR 08289 Mvezo Great Place and Museum	33,800	KSD	DORT	Tarred roads / Surfaced roads	Nov-12
DR 08167 to Tina Falls	19,500	Mhlontlo	DORT	Tarred roads / Surfaced roads	Jan-12
DR 08019 to Ntabankulu Town	14,300	Quakeni	DORT	Tarred roads / Surfaced roads	May-12
Flagstaff to Lusikisiki	300,000	Qaukeni	DORT	Tarred roads / Surfaced roads	Mar-12
Pt St Johns to Ntafufu	20,000	Port St Johns	DORT	Tarred roads / Surfaced roads	Nov-11
Mampube to Pt St Johns	35,000	Port St Johns	DORT	Tarred roads / Surfaced roads	Nov-11
N2 to Tabankulu	20,000	Ntabankulu	DORT	Tarred roads / Surfaced roads	Apr-12
Lusikisiki to Mbotyi	40,000	Ngquza	DORT	Tarred roads / Surfaced roads	Nov-11
Vidiesville to Mqaunduli	40,000	King Sabata Dalinyebo	DORT	Tarred roads / Surfaced roads	Feb-11
Magusheni to Flagstaff	20,000	Ngquza/ Mbizana	DORT	Tarred roads / Surfaced roads	Nov-12
Lusikisiki Bambisane Hospital	35,000	Ngquza	DORT	Tarred roads / Surfaced roads	Mar-12

Mthatha Airport	R60, 000	KSD LM	DORT	Civil Works, Fencing, Terminal Bldg Upgrade, Fire detectors, Lift installation, Air conditioning and ventilation	Mar-12
Qumbu Bus and Taxi Rank	R 2 million	Mhlontlo	DORT	Bus and Taxi Rank	July 10 - June 2012

7.2.3 DWAF - Best Practice Guidelines

The Department of Water Affairs & Forestry developed a series of Best Practice Guidelines (BPG's) for mines that was released in 2009 in line with the international Principles and Approaches towards sustainability. These guidelines have been grouped as follows:

- BPG's dealing with aspects of DWAF's water management hierarchy, namely,
 - H1: Integrated Mine Water Management
 - H2: Pollution Prevention and Minimization of Impacts
 - H3: Water Reuse and Reclamation
 - H4: Water Treatment
- BPG's dealing with General water management strategies, techniques & tolls, namely,
 - G1: Storm Water Management
 - G2: Water and Slat Balances
 - G3: Water Monitoring Systems
 - G4: Impact Prediction
 - G5: Water Management Aspects for Mine Closure
- BPG's dealing with specific mining activities or aspects, namely,
 - A1: Small-Scale Mining
 - A2: Water Management for Mine Residue Deposits
 - A3: Water Management in Hydrometallurgical Plants
 - A4: Pollution Control Dams
 - A5: Water Management for Surface Mines
 - A6: Water Management for Underground Mines

The development of the guidelines is an inclusive consultative process that incorporates the input from a wide range of experts, including specialist within the and outside the mining industry and government.

The BPG's form the following main functions:

- Utilization by the mining sector as input for compiling water use license applications (and other legally required documents such as EIA's, EMP's, closure plans, etc) and for drafting license conditions.
- Serve as a uniform basis for negotiations through the licensing process prescribed by the National Water Act.
- Used specifically by DWAF personnel as a basis for negotiation with the mining industry, and likewise by the mining industry as a guideline as to what the DWAFG considers as best practice in resource protection and waste management.
- Inform Interested & Affected Parties on good practice at mines.

7.2.4 Department of Environmental Affairs Guidelines

The Department of Environmental Affairs has also produced a series of guidelines to assist potential applicants and interested and affected parties (I&AP's) to understand what is required of them and what is required of them and what their role may be. The guidelines are intended to guide only and should be read in conjunction with NEMA and the regulations. They are not intended to be a substitute for the provisions of NEMA or the regulations in any way. The guidelines form part of the department's Integrated Environmental Management Guideline Series and consist of -

- Guideline 5: Companion to the National Environmental Management Act Environmental Impact Assessment Regulations of 2010
- Guideline 6: Environmental management framework
- Guideline 7: Public Participation

8 Introduction

The **Department of Roads and Public Works** is responsible for the maintenance of the gravel roads network in the Eastern Cape Province through routine maintenance or regravelling contracts. The Department of Roads and Public Works has appointed a consortium of Engineering Consultants (RAMS Management Consultants) to manage the Road Asset Management System (RAMS) which includes the borrow pit management system. **Controlab cc** is the Professional Services for the conducting of Geotechnical Borrow pits. **BESC** have been appointed as independent environmental consultants by **Controlab cc** on behalf of **Department of Roads and Public Works** to undertake the necessary investigations and applications in order to obtain authorisation from the relevant authorities for the proposed works. To this end, an Environmental Management Plan as defined and required by the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002), has been prepared for the proposed utilisation of the borrow pits for the routine maintenance/regravelling of the DR08147.

It is proposed that road construction materials be sourced from existing borrow pits located in the vicinity of the DR08147. As mentioned previously, the utilisation of the material sources required for the project will be undertaken in accordance with the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002). Since the applicant, Department of Roads and Public Works, is an Organ of State, exemption has been obtained previously from the application process in terms of the Act. In terms of this exemption only an Environmental Management Plan for the utilisation of the borrow pits is required to be compiled in accordance with Section 39(2) and Regulation 52 of the M&PRDA.

The purpose of the Environmental Management Plan is to identify and assess potential impacts associated with the project through a process of stakeholder and public consultation and environmental investigations, and to provide sufficient detail on the project to the Department of Minerals Resources (DMR), in order to allow DMR to make an informed decision on the project.

It is also appropriate to highlight at this point that the Department of Mineral Resources may, in their Decision, reserve their rights to initiate criminal proceedings against the Consulting Engineer, contractor and/or any sub-contractors.

8.1 Objectives of the Environmental Management Plan

The overall objectives of the Environmental Management Plan are defined as follows:

- To fulfil the requirements of Sections 39 of the Minerals and Petroleum Resources Development Act;
- To fulfil the criteria described in regulations 52 of the Minerals and Petroleum Resources Development Regulations, 2004, Government Notice No. 527.
- To inform the public and key stakeholders of the Project and to provide them with an opportunity to express any concerns or issues and to participate in the process;
- To identify and assess potential impacts associated with the activity. A “fatal flaw” constitutes an impact of HIGH significance and which cannot be managed to an acceptable level;
- Identify proposed mitigation and management measures to minimize adverse impacts and benefits; and
- Planned monitoring and performance assessment of the environmental management plan.

8.2 Integrated Environmental Management

The Integrated Environmental Management (IEM) procedure, which is outlined in Chapter 5 of the National Environmental Management Act (Act 107 of 1998) (NEMA), provides a framework for the integration of environmental issues into the planning, design, decision-making and implementation of plans and development proposals. The general objectives of Integrated Environmental Management are to:

- Promote the integration of the principles of environmental management in the making of all decisions, which may have a significant effect on the environment;
- Identify, predict and evaluate the actual and potential impacts on the environment, socio-economic conditions and cultural heritage; the risks and consequences and alternatives and options for mitigation of activities, with a view to minimising negative impacts and maximizing benefits and promoting compliance with the principles of environmental management;
- Ensure that the effects of activities on the environment received adequate consideration before actions are taken in connection with them
- Ensure adequate and appropriate opportunity for public participation in decisions that may affect the environment;
- Ensure the consideration of environmental attributes in management and decision-making which may have a significant effect on the environment; and
- Identify and employ modes of environmental management best suited to ensure that the particular activity is pursued in accordance with the principles of environmental management.

8.3 Project Details

Applicant:

The Department of Roads & Public Works

Private Bag X0023

BHISHO

5605

Tel No.: (043) 604 7636

Fax No.: (086) 532 3972

Contact Person: Mr CJ Xoko/Mr C Boshoff

Environmental Consultant

Biotechnology and Environmental Specialist Consultancy cc

P O Box 8241

Nahoon

5210

Tel: (043) 726 4242

Fax: (043) 726 3199

Email: lee-anne@besc.co.za

Contact Person: Ms Lee-Anne Proudfoot

Landowner

The Borrow pits fall within Farm Land. The Department of Rural Development and Land Reform is the legal custodian of the identified land on which the borrow pits are located.

Rd_Nr_	No_	Farm #	Landowner
DR08147	147_BP01	Farm RE/89	Department of Rural Development and Land Reform
DR08147	147_BP02	Farm RE/89	Department of Rural Development and Land Reform

9 Project Description

9.1 Study Area

The DR08147 is situated within the Ingquza Local Municipality located in the OR Tambo District Municipality. DR08147 is a gravel road situated approximately 20 km east of the town of Lusikisiki within the Province of the Eastern Cape. The section of DR08147 assessed is approximately 15 km long and runs in a north to south direction. The road starts at the intersection with the DR08024 (Figure 1). The start co-ordinates are as follows:

- o Start co-ordinate - S31° 20' 10.59" E29° 45' 53.52"

Two (2) borrow pits were identified in the initial investigation for material sources along the DR08147; and, were identified to be suitable for utilisation as material sources for the re-gravelling. The location of the borrow pits are as follows:

Road #	Borrow Pit #	Latitude	Longitude
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E

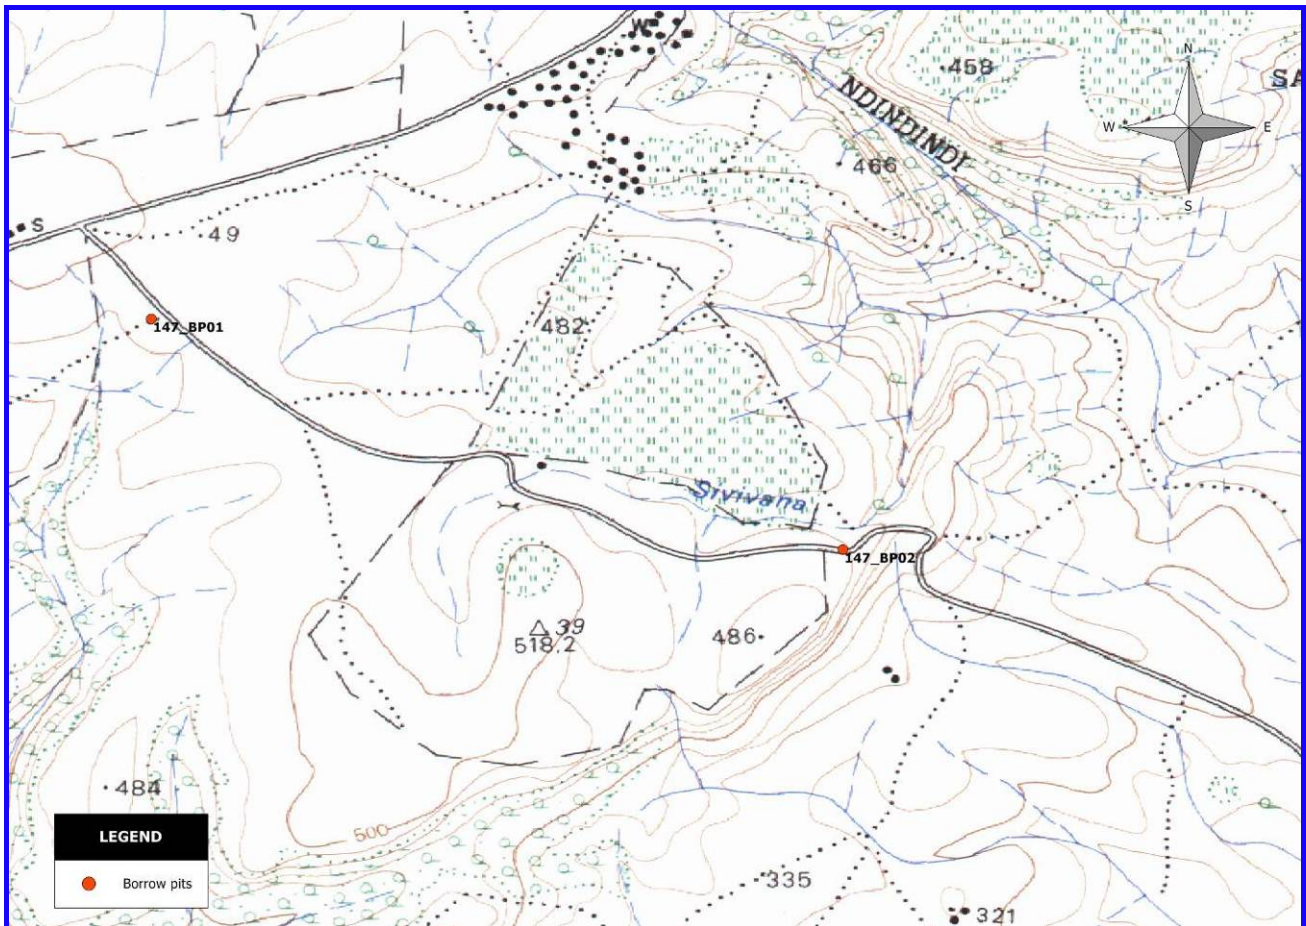


Figure 1: The location of the borrow pits (1: 50 000 map).

9.2 Current Land Use

Both of the borrow pits are existing and were previously used for road construction activities.

9.3 Surrounding Land Use

The surrounding land use includes Rural / Communal Land and Natural Landscapes.

9.4 Proposal

The **Department of Roads and Public Works** is responsible for the maintenance of the gravel roads network in the Eastern Cape Province through routine maintenance or regravelling contracts. As such the Department has embarked on an investigation to identify borrow pits situated along or in close proximity to the district roads identified in the OR Tambo District Municipality which require routine maintenance in order to source materials for the proposed re-gravelling/maintenance of these roads.

It is proposed here to utilise two (2) borrow pits identified along the DR08147, for the routine maintenance/re-gravelling of this district road. The nearest formal town is Lusikisiki. The borrow pits are located adjacent to the DR08147.

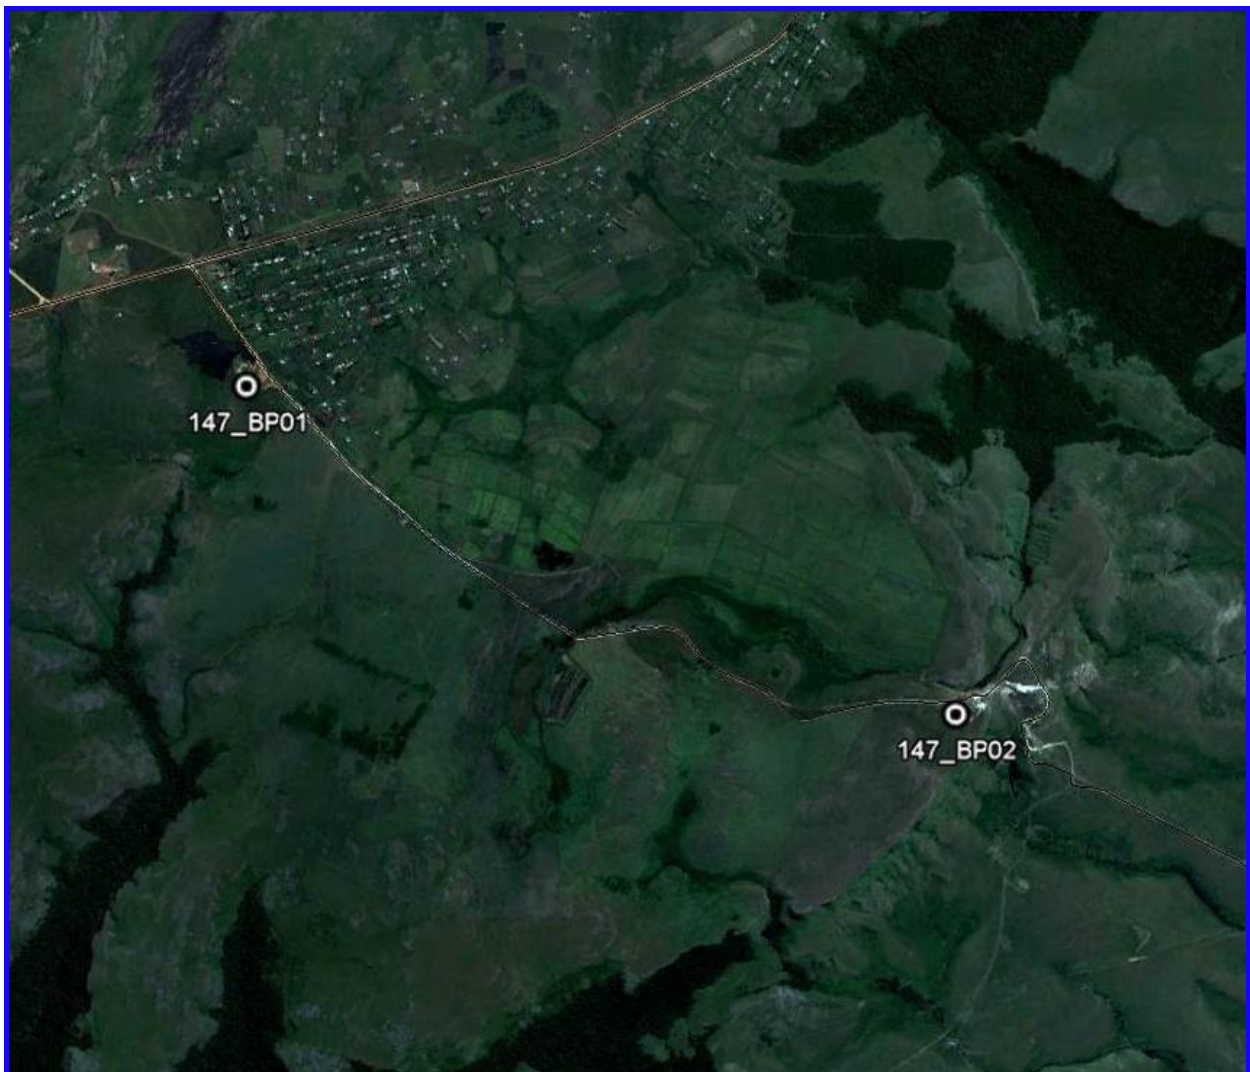


Figure 2: Aerial Image - Road DR08147 & associated BP's.

Table 2: Borrow pit Summary Table

Information		Borrow pits	
		147_BP01	147_BP02
Ownership		Farm Land - Department of Rural Development and Land Reform	Farm Land - Department of Rural Development and Land Reform
Type of Material		Sandstone	Sandstone
Existing or new		Existing	Existing
Co-ordinates	South	31°20'23.6"	31°20'56.7"
	East	29°46'01.9"	29°47'40.5"
Distance to DR08147		+/- 20 m	+/- 10 m
Access		Yes	Yes
River Catchment		Mlambomkulu River	Mkweni River
Nearest Village		Ntlavukazi	Ntlavukazi
Distance to Nearest Houses		+/- 60 m	+/- 350 m
Presence of servitudes		Powerline on the opposite side of the DR08147; and informal sports field adjacent to borrow pit	None
Proposed End Use		Closed and Rehabilitated	Closed and Rehabilitated

9.5 Borrow pit 147_BP01

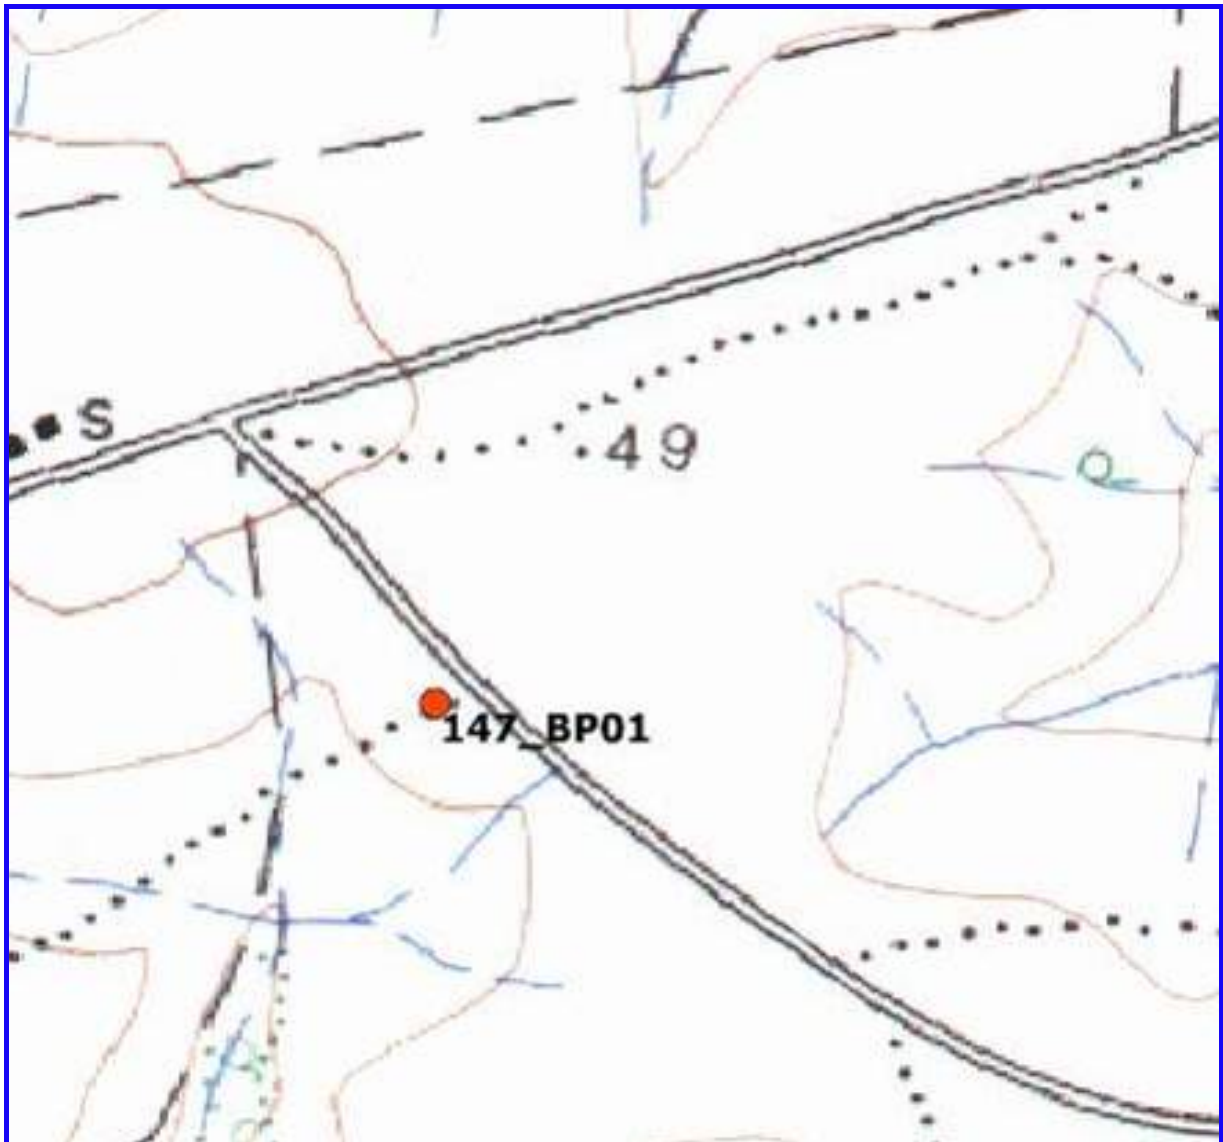


Figure 3: Topographical Location of 147_BP01 - 1:50 000 map



Figure 4: 147_BP01

General Description

147_BP01 is an existing borrow pit which has been utilized extensively in the past. The borrow pit comprises of a series of excavations made into relatively flat land. The area in which the borrow pit is located has a predominant south west slope. The site is accessed directly from the DR08147. The nearest village is Ntlavukazi, with the nearest household located approximately 60 m from the borrow pit. It is the intension that the borrow pit will be mined within the existing borrow pit footprint and extended a westerly and northerly direction away from the DR08147 and the households as indicated on the mining plan in SECTION 20. It will not be necessary to relocate any households; however noise control and dust control measures will need to be implemented. Cognisance must be taken of the Powerline on the opposite side of the DR08147 and the informal sports field adjacent to the borrow pit footprint.

Prior to mining the access road will be demarcated to prevent vehicles damaging natural vegetation. The existing access to the borrow pit will be utilised to allow for trucks to access the working face. The entire mining area will be fenced to prevent unauthorized access of both humans and animals. The area to be fenced will be bigger than the area to be mined to allow for a storage area for topsoil. As a result of the past excavations drainage has become a problem creating large pools of standing water within the borrow pit footprint. These areas are probably utilised by the surrounding residents. As such the mining plan excludes some of these standing water bodies, while within the proposed mining area, standing water within the designated area must be pumped out and discharged on to the grassy flats into the adjacent grasslands prior to the mining activities commencing.

Site preparation will consist of the stripping of topsoil and overburden into stockpiles, which are to be stored separately. Existing topsoil stockpiles will be shifted out of the way to allow for mining of the material beneath. The topsoil and overburden material will be stockpiled on site and after the mining is complete this material will be spread over again. Once the whole area is open the stockpile can be moved around so as not to interfere with the mining process.

The material will be excavated from the face and floor of the borrow pit and if possible loaded directly onto haul trucks. The material to be mined will be Sandstone. It is proposed that the extent of the area to be mined (existing and new) will be approximately 2.187 ha.

Stormwater control is viewed as a critical component of the borrow pit development. It is suggested that a cutoff-berm be located above the borrow pit face, protecting the active mining area and topsoil and overburden stockpiles from erosion. This storm water will then be channelled towards the natural

drainage in the area. A diversion berm with dissipation beds should be installed down slope of the mining area to filter out any sediment washed off the site during heavy rainfall.

Proposed Rehabilitation Measures:

On completion of mining, the faces must be sloped to a 1:2 - 1:3 slope and overburden and then topsoil (imported if required) will be spread over the surface of the mining area. The access roads will be ripped. The entire area will be fertilized and seeded with an indigenous grass mix which includes quick-growing pioneers and climax species. The stormwater berms will be retained on closure.

Additionally, near vertical slopes (1:1 to 1:2) should be stabilised by natural rock wall structures using conventional building methods or in forms with slurry forced between the structures. All structures must have a 'natural' look and facilities for plants to grow in.

All areas where the slopes are 1:3 to 1:6 should be logged or otherwise stepped (using stabilisation cylinders or similar) in order to prevent soil erosion. Logs/ cylinders should be laid in continuous lines following the contours and spaced vertically 0.8-1.2 m apart, depending on the steepness of the slope. These logs/ cylinders must be secured by means of steel pegs and wire in rocky areas, and treated wooden pegs in other areas.

Inspections will be undertaken during the project liability period (one year after completion of the contract) to ensure that no erosion has taken place and to monitor the success of the revegetation. Should any damage occur, the necessary repair works will be undertaken. The intention is to establish an 80% grass cover within two years of rehabilitation. Should this not be achieved, it may be necessary to lightly rip, fertilise and reseed the site. The fence will be maintained by the contractor until the end of the contracts liability period.

9.6 Borrow pit 147_BP02

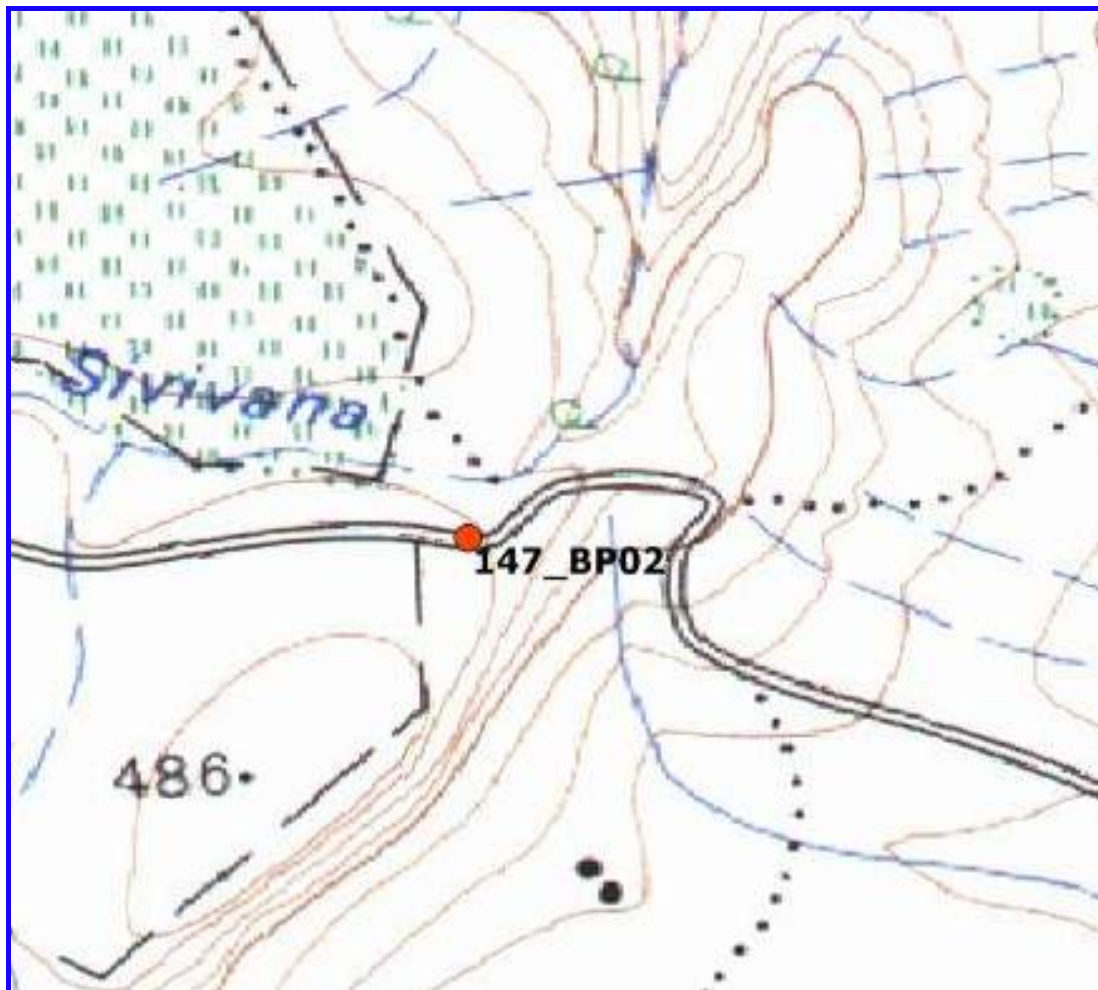


Figure 5: Topographical Location of 147_BP02 - 1:50 000 map



Figure 6: 147_BP02

General Description

147_BP02 is an existing borrow pit which has been utilized in the past. The borrow pit is located on a north east facing hill slope. The site is accessed directly from the DR08147. The nearest village is Ntlavukazi, with the nearest settlement located approximately 350 m from the borrow pit. It is the intention that the borrow pit will be mined from its existing borrow pit footprint and extended into the hill slope in a south westerly direction away from the DR08147 as indicated on the mining plan in SECTION 20. It will not be necessary to relocate any households; however noise control and dust control measures will need to be implemented.

Prior to mining the access road will be demarcated to prevent vehicles damaging natural vegetation. The existing access to the borrow pit will be utilised to allow for trucks to access the working face. The entire mining area will be fenced to prevent unauthorized access of both humans and animals. The area to be fenced will be bigger than the area to be mined to allow for a storage area for topsoil. Water located within the borrow pit must be pumped out and discharged on to the grassy flats into the adjacent grasslands prior to the mining activities commencing.

Site preparation will consist of the stripping of topsoil and overburden into stockpiles, which are to be stored separately. Existing topsoil stockpiles will be shifted out of the way to allow for mining of the material beneath. The topsoil and overburden material will be stockpiled on site and after the mining is complete this material will be spread over again. Once the whole area is open the stockpile can be moved around so as not to interfere with the mining process.

The material will be excavated from the face and floor of the borrow pit and if possible loaded directly onto haul trucks. The material to be mined will be Sandstone. It is proposed that the extent of the area to be mined (existing and new) will be approximately 0.868 ha.

Stormwater control is viewed as a critical component of the borrow pit development. It is suggested that a cutoff-berm be located above the borrow pit face, protecting the active mining area and topsoil and overburden stockpiles from erosion. This storm water will then be channelled towards the natural drainage in the area. A diversion berm with dissipation beds should be installed down slope of the mining area to filter out any sediment washed off the site during heavy rainfall.

Proposed Rehabilitation Measures:

On completion of mining, the faces must be sloped to a 1:2 - 1:3 slope and overburden and then topsoil (imported if required) will be spread over the surface of the mining area. The access roads will be ripped. The entire area will be fertilized and seeded with an indigenous grass mix which includes quick-growing pioneers and climax species. The stormwater berms will be retained on closure.

Additionally, near vertical slopes (1:1 to 1:2) should be stabilised by natural rock wall structures using conventional building methods or in forms with slurry forced between the structures. All structures must have a 'natural' look and facilities for plants to grow in.

All areas where the slopes are 1:3 to 1:6 should be logged or otherwise stepped (using stabilisation cylinders or similar) in order to prevent soil erosion. Logs/ cylinders should be laid in continuous lines following the contours and spaced vertically 0.8-1.2 m apart, depending on the steepness of the slope. These logs/ cylinders must be secured by means of steel pegs and wire in rocky areas, and treated wooden pegs in other areas.

Inspections will be undertaken during the project liability period (one year after completion of the contract) to ensure that no erosion has taken place and to monitor the success of the revegetation. Should any damage occur, the necessary repair works will be undertaken. The intention is to establish an 80% grass cover within two years of rehabilitation. Should this not be achieved, it may be necessary to lightly rip, fertilise and reseed the site. The fence will be maintained by the contractor until the end of the contracts liability period.

9.7 Need and Desirability

The existing gravel roads in the OR Tambo District Municipality are in serious need of maintenance and re-gravelling. The region in particular has recently experienced severe weather conditions which has resulted in severe deterioration of the road conditions and has exacerbated the need for maintenance and re-gravelling of the existing gravel roads. The proposed maintenance/re-gravelling of the DR08147 will be a benefit to the users of the road by providing proper infrastructure, improving overall road safety and reducing the risk of erosion that is occurring at present. The proposed borrow pits will provide material for the maintenance/re-gravelling of the DR08147. The identification of these sources follows a materials identification/investigation undertaken by Controlab (Section 21.1). A number of borrow pits were investigated. A selection process was undertaken whereby the borrow pits having fatal flaws or limited resources were eliminated during the planning process using indicators such as materials present, volume of available material, distances to water courses, land capability, vegetation sensitivity, surrounding erosion, visibility, slopes, etc. The material from the borrow pits was concluded to be suitable for use and that they would yield high quantities of material for the maintenance of the road. As part of the measures to be taken for the borrow pits, rehabilitation is required on closure of the mining, this rehabilitation would be a benefit as this should improve the overall aesthetics of the borrow pits.

10 Environmental Setting

10.1 Landform & Geology

10.1.1 General Description:

The area is underlain by the sedimentary strata belonging to the Cape Supergroup, the Karoo Sequence and the Cretaceous System. The Cape Supergroup is represented in this area by the Natal Group. The Karoo sequence comprises the Dwyka formation (500 m tillite), the Ecca Group (\pm 1000 m shale and sub-ordinate sandstone), the Beaufort Group (up to 3000 m mudstone), the Molteno Formation (500 m sandstone, mudstone and shale), the Elliot Formation (500 m mudstone and sandstone), the Clarens Sandstone (up to 250 m) and the Drakensberg Group (over 700 m basaltic lava and subordinate agglomerate and tuff). Cretaceous rocks occupy very small areas and are represented by the Mbotyi (300 m conglomerates) and Mgazana Formations (conglomerates with fossiliferous lenses).

10.1.2 Structural Geology:

The map area can be divided into two structurally distinct regions:

- (i) the gently dipping inland area;
- (ii) the structurally more complicated coastal strip

The inland area consists mainly of gently dipping Karoo sediments. Dips vary from 1 to 3° northwest with localised steeper dips near dolerite intrusions. Major faults are rare.

The coastal strip has been disturbed by numerous faults, generally striking east-west near the coast and curving north-east to south-west inland. In general the downthrow side is to the south and east of the faults, with the downthrow sediments dipping eastwards at 20° or more. Hence, downfaulted outliers of younger formations occur, the Molteno outlier at Mgazana being the most notable.

The downthrow along the faults ranges up to 3000 m. A horst of upfaulted Natal Group sandstones is exposed in "The Gates" at Port St Johns.

The age of the faulting can be deduced from the occurrence of Cretaceous rocks. It is probable that faulting commenced in the Early Cretaceous and was completed by the end of the Cretaceous.

10.2 Archaeology, Palaeontology & Heritage Sites

The study area falls within the Natal Group. The Palaeozoic Natal Group probably represents a record of more than 130 million years from the Ordovician (~ 490 Ma) to the Devonian (~ 360 Ma). However, the tectonic overprint of the Cape Folding Event when lateral compression produced zones of intense folding, and the subsequent creation of the African Land Surface in the region, had a detrimental effect on the preservation of fossils. In addition, the removal of the upper portions of the Natal Group is considered to have been caused partially by subaerial erosion and partially by Dwyka glacial activity. Post-Cretaceous epeirogenic events caused further warping and periodic seaward tilting of the coastal belt.

No general listing of the sites of palaeontological, archaeological and historical significance within the area is available. The South African Heritage Resources Agency does possess a database of National Monuments within each province, but this is only of limited use since it only lists National Monuments (as declared within the Government Gazette), and the vast majority of these occur within urban areas which are unlikely to be impacted upon by borrow pit projects.

10.3 Topography and Drainage

The topography of the area is described as being table lands. The general topography of the area is characterised by undulating to rolling terrain with deeply incised river valleys. In some areas, e.g. between Ntlaza (793 m), Port St Johns (10 m) and Lusikisiki (610 m), the terrain is very rugged and mountainous with deep and steep-sided river valleys. The landform becomes more steeply rolling as the coast is approached. Where slopes are not too steep, deep soils can be found on Ecca and Dwyka Group sediments.

Ingquza Hill lies within the northern section of the Wild Coast. The most prominent geographical and topographical feature is the rugged plateau of the Msikaba sandstone formation which is congruent with the Pondoland Centre of Endemism. The rugged plateau of the Msikaba sandstone formation is deeply incised by narrow river gorges and limited sandy beaches, which form the 'Tablelands'. In some parts this leads to dramatic landforms such as Waterfall Bluff and Cathedral Rock. The sandstone formation comes to a clear cut termination at the Egosu fault, which lies just north of Mbotyi and extends 18km inland from the coast. The landform between Mbotyi and Port St Johns is more varied but generally poor, shallow and highly susceptible to erosion.

The study area is located within the Mzimvubu to Keiskamma Water Management Area. It consists of three large drainage basins and the catchments of a number of smaller rivers that lie between the major

drainage basins and the Indian Ocean. The major drainage basins are the Great Kei (Drainage Region S), the Mbashe (part of Drainage Region T), and the Mzimvubu (part of Drainage Region T).

The study area falls within the Drainage Region T. The whole of the central and north-eastern portions of the WMA lie within Drainage Region T, which extends into the Mvoti to Mzimkulu WMA. The portion of Drainage Region T within the WMA area falls in the Pondoland Coastal Catchments; this is catchments of the Msikaba, Mtentu, Mzumba Rivers and adjacent smaller rivers which rise in the coastal strip between the Mzimvubu River Basin and the north-eastern boundary of the WMA. Both the rivers and the estuaries in this area are of high conservation value.

The topography is hilly to mountainous throughout the WMA with the high mountains of the Drakensberg along the north-eastern boundary.

10.4 Groundwater

The natural quality of groundwater in the water management area is variable, with elevated salinities in some areas. There is a high risk of microbial contamination of both surface water and groundwater in most parts of the densely populated tribal areas of the water management area, and this poses a health threat to those rural communities who rely on untreated supplies of potable water.

10.5 Climate

Due to its location at the confluence of several climatic regimes, the most important of which are temperate and subtropical, the Eastern Cape has a complex climate. There are wide variations in temperature, rainfall and wind patterns, largely as a result of movements of air masses, altitude, mountain orientation and distance from the Indian Ocean. Exceptionally high temperatures may be experienced during berg wind conditions, which occur frequently during the winter, with maximums of well over 30°C not being uncommon. Extreme temperatures also occur during summer, with little accompanying wind. Areas closer to the coast experience cooling due to onshore sea breezes.

The climate of the coastal lowlands of the East Cape region is generally moderate, warm temperate and humid and does not experience wide fluctuations in temperature due to the influence of the warm Agulhas current.

The general climate for the area is described as moderate for most of the year, but with hot periods from December to February. The climate ranges from cool, humid and subtropical at the coast to hot and sub-arid inland. Temperature ranges in the OR Tambo District from a mean minimum of 14.3 - 19.8 °C

in January and 1.8 -13.4 °C in July to a mean maximum in 14.3 - 25.3 °C in January and 19.5 - 21.4 °C in July.

Rainfall in the area occurs mainly in summer, but the winter months are not completely dry, with about 30% of the annual rainfall occurring between April and September. There is a great variation of the quantity of rainfall throughout the area. The mean annual precipitation (MAP) along the coastal region ranges from a low of 600mm in the west to a high of 1 208mm in the east, and varies from 400mm to 1200mm in the central plateau and along the northern areas. The rainfall is generally higher in the east than in the west.

The relative humidity is higher in summer than in winter. It is generally highest in February (the daily mean ranges from 60% in the north-west to 82% in the south-east) and lowest in July (the daily mean ranges from 50% in the north-west to 72% in the south-east). Average potential mean annual gross evaporation (MAE) (as measured by Symons-pan) for the WMA ranges from 1700mm in the north-west to less than 1200mm in the south-eastern parts.

10.6 Fauna

10.6.1 Reptiles & Amphibians

Of the 480 reptiles recorded from South Africa at least 144 of these occur within the Eastern Cape, and comprise eleven chelians (including sea-turtles, terrapins and tortoises), eighty-two lizards, and forty-six snakes. Reptiles form an important component of vertebrate diversity within the area. This is particularly true in light of their low mobility and high habitat specificity, particularly lizards and tortoises.

Approximately 60 species of reptiles may occur in the area. Whilst some are wide-ranging species (e.g. snakes such as the boomslang and puff adder), others have relatively restricted distributions. Sensitive and localised species may include the common slug-eating snake (*Duberria lutrix*) and the giant legless skink (*Acontias plumbeus*). Venomous snakes in the area include the Boomslang (*Dispholidus typus*), Ringhals (*Hemachatus haemachatus*), Cape Cobra (*Naja nivea*), Common Night Adder (*Causus mombeatus*) and Puff Adder (*Bitis arietans*); however there are few bites to humans and livestock.

The Province contains 19 threatened reptiles, of which 18 are endemic to the Eastern Cape, none of which are included in the SA RDB for reptiles and amphibians.

Species such as the Natal Black Snake (*Macrelaps microlepidotus*), occurring in coastal forests, reaches its southern limit in the East London area, the Green Sea turtle (*Chelonia mydas* - SA RDB status -vulnerable), the Loggerhead Sea Turtle (*Caretta caretta* -SA RDB status - vulnerable), the Hawksbill Sea Turtle (*Eretmochelys imbricate* - SA RDB status - vulnerable) and the Leatherback Sea Turtle (*Dermochelys coriacea* - SA RDB status - vulnerable) occur in the Eastern Cape coastal waters.

There are 102 amphibian species recorded in South Africa and about 47% of these occur in the Eastern Cape. One of these is an Artholeptid (frog), one is a Pipid (aquatic frog), three are Helephrynids (frogs which live in mountain streams and are endemic to South Africa), nine are Bufonids (true frogs) three are Bevicepids (stout bodied frogs), twenty-one are Ranids (frog family) and nine are Hyperolids (reed frogs). The amphibians of the province are an important component of the vertebrate diversity of the province. There are six threatened and four endemic frog species in the Eastern Cape Province. The Pondoland amphibian fauna is relatively poorly known, as is much of that of the former Transkei. This is unfortunate as the region falls at an important transition zone between a southern temperate amphibian fauna, and a tropical fauna that extends along the coastal littoral in association with the warm waters of the Agulhas Current (Poynton, 1990). The known amphibian fauna includes approximately 31 species. New taxa may well still exist in the poorly studied forest patches, river gorges and coastal grasslands. Species currently known only from coastal locations may also have relict inland populations.

One species, *Heleophryne hewitti*, is critically endangered and known for only four rivers in the Elandsberg range.

Five amphibian species of special concern have been identified i.e.:

- *Afrivalus knysnae* (Data Deficient),
- *Leptopelis natalensis* (Sensitive),
- *Natalobatrachus bonebergi* (Endangered),
- *Cacosterum striatum* (Data Deficient) and
- *Pyxicephalus adspersus* (Near Threatened).

Both the taxonomy and conservation of *Afrivalus knysnae* has changed, *Afrivalus knysnae* is restricted to the southern Cape region, and *Afrivalus spinifrons* applied to dwarf leaf-folding frogs of the Eastern Cape and KwaZulu-Natal. This taxon is now considered Endangered.

Near Threatened status for the Giant Bullfrog is a regional assessment, and the species is not considered threatened elsewhere in Africa.

A number of regional endemics occur, including:

- Bush squeaker (*Arthroleptis wahlbergi*) - KwaZulu-Natal, reaching its southern limit at Port St. John's;
- Natal ghost frog (*Heleophryne natalensis*) - Eastern Cape to Mpumalanga escarpment, reaching its southern limit Mtamvuna Gorge;
- Natal chirping frog (*Arthroleptella hewitti*) - KwaZulu-Natal, reaching its southern limit at Mkambati NR;
- Forest tree frog (*Leptopelis natalensis*) - KwaZulu-Natal, reaching its southern limit at Port St. Johns;
- Natal spiny reed frog (*Afrivalus spinifrons*) - Port Edwards, Port St Johns, Butterworth-Qolora; and
- Kloof frog (*Natalobatrachus bonebergi*) - Port St. John's to Ngoye Forest.

A number of tropical species reach their southern limit in the region and these populations are therefore also sensitive. They include:

- Long reed frog (*Hyperolius acuticeps*) - reaches its southern limit at Mkambati;
- Water lily frog (*Hyperolius pusillus*) - reaches its southern limit at Dwesa;
- Dwarf puddle frog (*Phrynobatrachus mababiensis*) - reaches its southern limit at East London;
- Sharp-nosed grass frog (*Ptychadena oxyrhynchus*) - reaches its southern limit at East London; and
- Striped grass frog (*Ptychadena porosissima*) - reaches its southern limit at East London.

10.6.2 Mammals

A total of two hundred and ninety two terrestrial mammals recorded for South Africa, of which 128 (44%) are recorded from the Eastern Cape. Of this 128 species, only one species is endemic to the Eastern Cape. This species is the Giant Golden Mole (*Chrysoxalax trevelyani*) that inhabits the indigenous forests of the Eastern Cape and is locally abundant in some regions. A list of recorded mammal species of the Eastern Cape region is presented in Appendix B. Of the 80 terrestrial species recorded, including 11 species of insectivores, 19 bats, three primates, two lagomorphs, 19 rodents, 15 carnivores, one ant bear, two hyrax, one bush pig and five to six small antelope species. Species which have been extirpated within historical times in the Eastern Cape include the cheetah, hunting dog, hippopotamus, lion, warthog and red hartebeest. These have however been extensively reintroduced into the province in provincial and private game reserves. Few of the large and medium- sized mammal fauna that previously occurred now occur naturally in the wild. Most are locally extinct or occur in small,

fragmented populations in forest reserves or in protected areas. Few mammals of conservation concern now survive in the study area. The few large megaherbivores surviving in the study area include bushbuck, common duiker and Cape Grysbok. In addition, the Chacma baboon, Vervet Monkey, bush pig and a variety of small carnivores (viverids, genets, Cape Clawless Otter, etc.) survive in small pockets. All are non-threatened and many have successfully adapted to surviving in peri-urban areas.

In the Eastern Cape area the dominant small mammal species associated with Coastal Grasslands and Acacia Savannah are *Rhabdomys pumilio* (Striped mouse) and *Otomys irroratus* (vlei rat). Other relatively common animals include various mole species, mole rats, *Orycteropus afer* (Aardvark) and *Cynictis penicillata* (Yellow Mongoose).

Fifteen threatened large- to medium-sized mammals occur in the Eastern Cape Province (Table 3).

Table 3: Terrestrial mammal Red Data Book (RDB) species.

SPECIES	COMMON NAME	CONSERVATION STATUS
<i>Proteles cristatus</i>	Aardwolf	Least Concern
<i>Felis serval</i>	Serval	Near Threatened
<i>Philantomba monticola</i>	Blue duiker	Vulnerable
<i>Mellivora capensis</i>	Honey badger	Near Threatened
<i>Felis lybica</i>	African wild cat	Least Concern
<i>Orycteropus afer</i>	Aardvark	Least Concern
<i>Ourebia ourebi</i>	Oribi	Endangered
<i>Cercopithecus mitis</i>	Samango Monkey	Endangered
<i>Mystromys albicaudatus</i>	White-tailed Rat	Endangered
<i>Chrysospalax trevelyani</i>	Giant golden mole	Vulnerable
<i>Dendrohyrax arboreus</i>	Tree hyrax	Vulnerable
<i>Poeciligale albinucha</i>	Africa striped weasel	Data Deficient
<i>Otolemur crassicaudatus</i>	Thick-tailed bushbaby	Least Concern
<i>Equus zebra</i>	Cape Mountain zebra	Vulnerable
<i>Diceros bicornis</i>	Black rhinoceros	Vulnerable
<i>Panthera pardus</i>	Leopard	Rare
<i>Manis temminckii</i>	Pangolin	Vulnerable

10.6.3 Birds

The former Transkei region has a rich avifauna, with nearly 500 species recorded from the region (approximately half of the species recorded from the subcontinent). They include numerous sensitive and threatened species. The coastal mosaic of grassland and forest habitats serves as an important area for montane species in winter. Many Intra-African summer migrants also use the region both for breeding and in transit to more southerly areas. The Eastern Cape Province contains 62 threatened bird species (Appendix H).). A significant number of threatened species occur in the area. These include

one Critically Endangered, two Nationally Endangered, one Globally Endangered, three Endangered, 13 Vulnerable and 12 Near-Threatened species.

The threatened status of some taxa has been upgraded in the NEMBA list (DEAT 2007), e.g.:

- Cape Parrot (*Poicephalus robustus*) - Critically Endangered
- Blue Crane (*Anthropoides paradiseus*) - Endangered
- Grey Crowned Crane (*Balearica regulorum*) - Endangered
- Cape Griffon Vulture (*Gyps coprotheres*) - Endangered - The Msikaba and Mthentu Gorge Vulture colonies are situated in the area between Lusikisiki and the Mthamvuna River

Many of the birds are associated with wetlands or are grassland species, highlighting the declining condition of these ecosystems. As can be expected from this highly mobile group there are no Eastern Cape endemic birds, although nine bird species are South African endemics. Only *Accipter melanoleucus* (Black sparrow hawk) has Red Data Book status, but this species is no longer considered threatened. A list of recorded bird species of the Eastern Cape region is presented in Appendix G.

10.6.4 Invertebrates

Although no regional Red Data Book exists for many invertebrate groups, a number of species in diverse groups have been identified as being of conservation concern and are discussed below.

- A number of rare butterflies from the Pondoland region are included in the South African Butterfly Red Data Book (Henning and Henning, 1989), including:
 - Pondoland Charaxes (*Charaxes pondoensis*) - Rare, Port St. Johns, Mkambati NR. Amakoza Rocksitter (*Durbania amakosa albescens*), Rare, Margate.
 - Southern Aslauga (*Aslauga australis*) - Rare, East London, Mbashe River, Doutza Pass, Port St. John's.
 - Bicolored Abantis (*Abantis bicolor*) - Rare, East London, Mbashe River, Port St. John's.
- Pulmonate Molluscs - Two terrestrial slugs have been indicated as candidates for inclusion in the IUCN 'Red List' of threatened species (Herbert, 1997). These include:
 - Chlamydephorus burnupi - known from a few scattered localities in KwaZulu-Natal, and with a single record from Port St. Johns.
 - Chlamydephorus dimidius - known from a few scattered localities in KwaZulu-Natal, and with a single southern record from Mtamvuna Gorge.
- Cicadas - Due to their long, unusual life cycles, cicadas are known to be sensitive to habitat fragmentation (Rodenhouse et al., 1997). These large, noisy and enigmatic insects show high levels of endemism and a number of new, highly-localised species have been described from

the former Transkei region (Villet, 1997, 1999). Both are recorded from coastal forest, thicket and forest fringes.

- *Stagira pondoensis* is known only from Port St John and nearby Vernon Crookes Nature Reserve in KwaZulu-Natal.
 - *Nyara thanatotica* occurs at Port St Johns and Bosbokstrand. This taxon is taxonomically more important as it is a monotypic genus.
- Millipeds - Like cicadas, millipeds often show high levels of endemism. Moreover, the distribution of endemism is often discordant with that of other groups (Burgess et al., 1998). Although there is no updated review of southern African millipeds highlighting threatened taxa, a new species has recently been described from forest habitat in the Lusikisiki District (Alderweireldt, 1998).
 - Archaeid spiders - The Afrotropical Archaeidae is a small family of very rare spiders known from southern Africa, Madagascar and Australia. In the subcontinent is represented by two genera and 12 species. *Eriauchenius coronatus* is known from only two specimens and is endemic to the Vernon Crookes Nature Reserve where it inhabits grassland at the forest-grassland ecotone. Two endemic species of *Afrarchaea* have been described (Lotz 2007) from leaf litter in isolated coastal forests in the Eastern Cape, including *A. haddadi* (Komga, Kei Mouth) and *A. woodae* (Komga and Cwebe Nature Reserve).

10.7 Flora

10.7.1 Eastern Cape Biodiversity Conservation Plan

The Eastern Cape is globally recognized for its high biodiversity value and scenic beauty. It has the highest biome diversity of any province, with no less than seven biomes: Forest, Fynbos, Nama Karoo, Savanna, Succulent Karoo and Thicket. The Province is also unique among provinces in that it overlaps with three centres of biological endemism: the Albany Centre, the Drakensberg Centre and the Pondoland Centre.

Recognizing the need to ensure that important natural resources are conserved, the Department of Economic Development and Environment Affairs (DEDEA) together with the Department of Water Affairs and Forestry (DWAF) collaborated to draw up the Eastern Cape Biodiversity Conservation Plan (ECBCP).

The ECBCP addresses the urgent need to identify and map critical biodiversity areas and priorities for conservation in the Province. Critical Biodiversity Areas (CBAs) are “terrestrial and aquatic features in the landscape that are critical for conserving biodiversity and maintaining ecosystem functioning”.

The ECBCP is a broad-scale biodiversity plan. Its aim is to integrate information from existing biodiversity plans (STEP, SKEP, C.A.P.E., the NSBA, DWAF Forest Conservation Planning, Wild Coast Conservation Plan, Pondoland Systematic Conservation Plan, Grasslands Programmes and the Maloti Drakensberg Transfrontier project), and to fill in the gaps, thereby providing a single, user friendly, biodiversity land use decision support tool for the whole Province (CBA maps). In turn it also provides land use planning guidelines, recommending biodiversity-friendly activities in priority areas. The ECBCP is intended for use by technical users and decision-makers in the spheres of planning (for example integrated development planning & spatial development frameworks (IDP/SDF)), development and environment. Mapped information can be used both reactively and strategically to guide future development away from sensitive and priority biodiversity areas.

However, it is important to note the following: the “ECBCP has no legal status”, (it has however been designed to serve as the basic biodiversity layer in Strategic Environmental Assessments, State of Environment Reports, SDFs, Environmental Management Frameworks and Bioregional Plans), “the ECBCP itself is not a bioregional plan”, “the information should always be verified with a site visit”, “the ECBCP is not a substitute for a full evaluation” and “the ECBCP should not be used for urban and fine-scale planning” (as it is a broad framework plan) (*Eastern Cape Biodiversity Conservation Plan Handbook, 2007*).

10.7.2 General vegetation description

The landscape within the river valleys of the Eastern Cape can be described as undulating, with steep river valleys and flat-topped ridges. Valley thicket, which is the predominant vegetation type, is found in river valleys with savanna and open grasslands on the plateaus and spurs between the rivers. The grasslands and savanna have been greatly impacted upon by settlements and grazing of domestic animals.

The proposed borrow pits fall within the Pondoland-Ugu Sandstone Coastal Sourveld vegetation unit as according to Mucina & Rutherford (2006) (Figure 7).

The **Pondoland- Ugu Sandstone Coastal Sourveld** is found in the Kwa-Zulu Natal and Eastern Cape Provinces on elevated coastal sandstone plateaus from Port St Johns on the Pondoland coast (Eastern

Cape) to the vicinity of Port Shepstone (Ugu District, KwaZulu Natal), incl the sourveld of the well known Oribi Gorge. Altitude ranges from about 0 - 600 m.

The vegetation unit is found on coastal peneplains and partly undulating hills with flat table-lands and very steep slopes of river gorges. These sites support natural, species - rich grassland punctuated with scattered low shrubs or small trees. Rocky outcrops and krantzes are common and dramatic sea cliffs occur. Protaceous trees (*Protea, Faurea*) can be locally common where conditions allow.

The vegetation unit has been described as being “Vulnerable” and is listed not listed as an ecosystem which is threatened according to the National List of Ecosystems that are Threatened and in need of protection (2011), with only about 7% of the unit being statutorily conserved in the Mkambati Wildlife Reserve and Marine Sanctuary, and Umtamvuna, Mbumbazi and Oribi Gorge Nature Reserves. About 29% has been transformed for cultivation, plantations and urban development. In the Eastern Cape the land use is mostly subsistence farming. The conservation target is 25%

Table 4: Important Taxa - Pondoland- Ugu Sandstone Coastal Sourveld

Trees & Tall Shrubs		
<i>Euryops brevipapposus</i>	<i>Syzygium cordatum</i>	
Low Shrubs		
<i>Athrixia phyllicoides</i>	<i>E. natalensis</i>	<i>Gnidia Kraussiana</i>
<i>E. natalitia</i>	<i>Gnidia anthylloides</i>	<i>Gnidia nodiflora</i>
<i>Leonotis intermedia</i>	<i>Polygala hottentotta</i>	
Semi-parasitic shrubs		
<i>Thesium acutissimum</i>	<i>Thesium cupressoides</i>	
Graminoids		
<i>Alloteropsis semialata</i>	<i>Aristida junciformis</i>	<i>Cymbopogon nardus</i>
<i>Themeda triandra</i>	<i>Tristachya leucothrix</i>	<i>Cyperus rupestris</i>
<i>Diheteropogon amplexens</i>	<i>Elionurus muticus</i>	<i>Eragrostis capensis</i>
<i>Eragrostis plana</i>	<i>Eulalia villosa</i>	<i>Heteropogon contortus</i>
<i>Panicum natalense</i>	<i>Trachypogon spicatus</i>	
Herbs		
<i>Chaetacanthus burchellii</i>	<i>Cyanotis speciosa</i>	<i>Helichrysum allioides</i>
<i>Helichrysum appendiculatum</i>	<i>Helichrysum krebsianum</i>	<i>Helichrysum spiralepsis</i>
<i>Pentanisia angustifolia</i>	<i>Rhynchosia totta</i>	<i>Tephrosia macropoda</i>
<i>Berkheya speciosa</i>	<i>Cephalaria oblongifolia</i>	<i>Chamaecrista mimosoides</i>
<i>Eriosema salignum</i>	<i>Euphorbia ericoides</i>	<i>Helichrysum adenocarpum</i>
<i>Helichrysum aureum</i>	<i>Helichrysum herbaceum</i>	<i>Helichrysum nudifolium</i>
<i>Helichrysum pallidum</i>	<i>Indigofera hiliaris</i>	<i>Pentanisia prunelloides</i>
<i>Pimpinella tenellum</i>	<i>Veronia capensis</i>	
Geophytic Herb		
<i>Brachystelma tenellum</i>	<i>Eriospermum mackenii</i>	

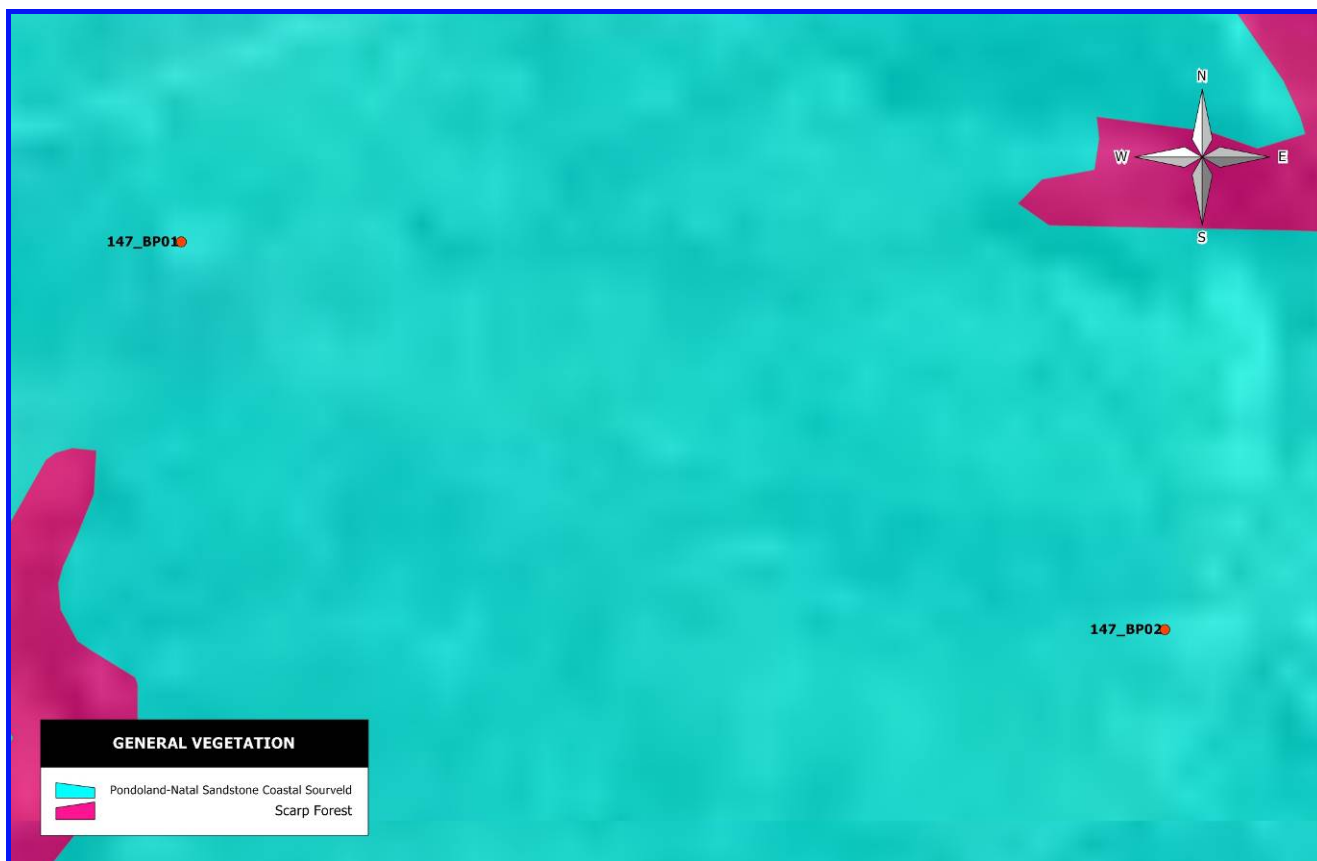


Figure 7: General vegetation and the location of the borrow pits.

10.8 Socio - Economic Environment

In the provincial context, the Eastern Cape is one of the poorer provinces in South Africa. Its economy has been characterised in the Province’s 2004-2014 Provincial Growth and Development Plan (PGDP) as having “extreme levels of uneven development”. It is situated in the south-east of the country and includes the former Eastern Province, Border, north-eastern Cape areas and the former “homelands” of Transkei and Ciskei. Spatially, it is the second largest province, covering almost 14 % of the total surface area of South Africa.

It has urban industrial manufacturing centres in Buffalo City and the Nelson Mandela Metropolitan Municipality, a well-developed commercial farming sector and high concentrations of developed socioeconomic infrastructure in the western parts. In contrast to this is the undeveloped rural hinterland in the former Transkei and Ciskei homelands, which consist of weak subsistence agriculture and very limited socio-economic growth. The coastal area known as the “Wild Coast” is very sparsely populated, mainly due to limited infrastructure and inadequate access to the coastal nodes.

Annual average economic growth for the provincial economy over the last decade was 2.2 % against the national average of 2.8 %. Farming is an important contributor to household livelihoods in the former Transkei where the proposed toll highway would be developed, but it is largely a subsistence activity. Two harbours, at East London and Port Elizabeth, are located along its coastline and a modern deepwater port has recently been constructed at Coega.

In 2007 the province had a population of about 6.90 million, comprising approximately 14 % of the national population. The province has an average density of 67 - 80 people per km². The Eastern Cape has the third lowest urbanised population, at 42.9 % (Development Bank of Southern Africa - DBSA, 2000).

The Gross Geographic Product (GGP) of the Eastern Cape was just more than R 81 billion in 2001, equalling 8.2 % of South Africa's Gross Domestic Product (GDP). The three most important sectors at the intra-provincial level are manufacturing, commerce and community services. The province possesses comparative economic advantages with regard to textiles, leather products, rubber products and vehicles.

The Eastern Cape has the highest unemployment rate in South Africa, with almost half of its labour force being unemployed. The unemployment rate of 48.4 % is 14.6 percentage points higher than the national average. These figures exclude large numbers of people who left the province to find employment in other provinces such as the Western Cape and Gauteng. Average annual household income in 2001 for South Africa as a whole was R 46 291, while for the Eastern Cape it was R 28 468 (Stats SA Census, 2001).

OR Tambo District Municipality

The O.R. Tambo DM is classified as a Category C2 municipality, indicating a largely rural character (it is estimated that some 93% of the district population resides in rural areas with a consequent dispersed settlement pattern) and low urbanization rate, as well as limited municipal staff and budget capacity.

All, but King Sabata Dalindyebo (KSD), local municipalities are classed as Category B4 (rural, mainly subsistence) reflecting limited institutional capacity and areas characterized by small centres, limited SMME's and market opportunities, dependence on public support and LED activities that are principally at the level of the small project. KSD is classed as a Category B2 (large core town/s with surrounding agricultural areas) municipality reflecting reasonably adequate budgets and staff, urban centre(s) with associated resources where LED activities are emerging into strategies and programmes to take

advantage of economic potential, as well as substantial numbers of SMMEs, considerable market opportunities, but limited private sector business development services.

The total population of O.R Tambo district amounted to 1,843,135million in 2007, (growing at an average of 0.5% per annum) which is approximately 26, 6% of the total for the Eastern Cape Province. At least more than 75% of the people live below the minimum poverty level. The highest concentrations of people living poverty are found in Flagstaff 85.3%, Mqanduli 84.5%, Port St Johns 83.6%, and Tabankulu 83.2%.

Since 2001, the following annual average economic growth rates (in terms of GDP) have been measured in each of O.R.Tambo's local municipalities (2001 to 2007 at constant 2000 prices):

- Mbizana 2.4%
- Ntabankulu 1.6%
- Ingquza Hill 2.2%
- Port St Johns 3.1%
- Nyandeni 2.1%
- Mhlontlo 1.5%
- King Sabata Dalindyebo 3.7%

The economic sectors that dominate the economy of the district are community services, financial and business services, and wholesale and retail trade. Between 2006 and 2007, the following growth rates were observed in O.R. Tambo per broad economic sector (based on GVA at constant 2000 prices):

- Agriculture 1.0%
- Mining -7.8%
- Manufacturing 0.7%
- Electricity -1.4%
- Construction 25.2%
- Trade 6.8%
- Transport 5.7%
- Finance 12.9% and
- Community services 3.2%


11 The Affected Environment/ Site Descriptions

11.1 Geology and Soils

According to the geological map (3128 Umtata) the area in which the borrow pits are located falls within the Natal Group, which belongs to the Cape Supergroup (Figure 8). The area is underlain with light grey quartzitic sandstone.

The Natal Group is represented by between 900 m (in the north) and 1300 m (in the south) of white to grey, siliceous quartzose and subfeldspathic sandstone with the subordinate conglomerate. Scattered small pebbles of white or greyish vein quartz and less commonly, white and black chert are present. Cross-bedding is common. The sandstones are composed largely of quartz, with feldspar and small amounts of muscovite making up the remainder.

The investigation undertaken by Controlab (section 21.1) indicated that the type of material found at the borrow pits was Sandstone.

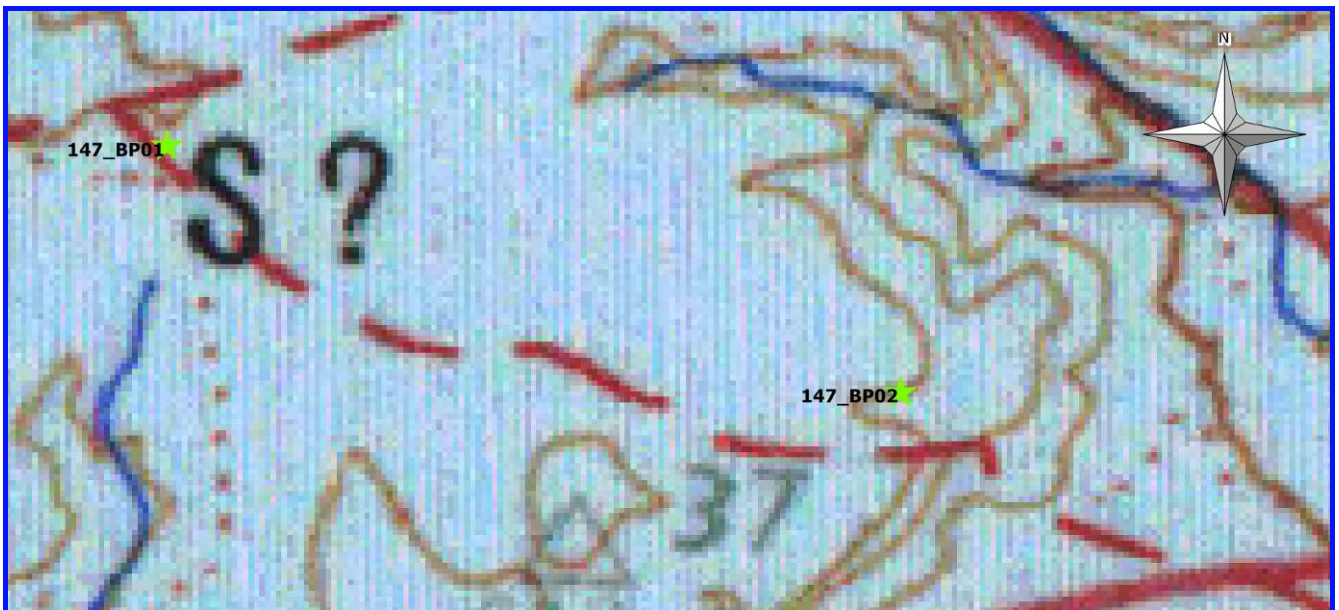

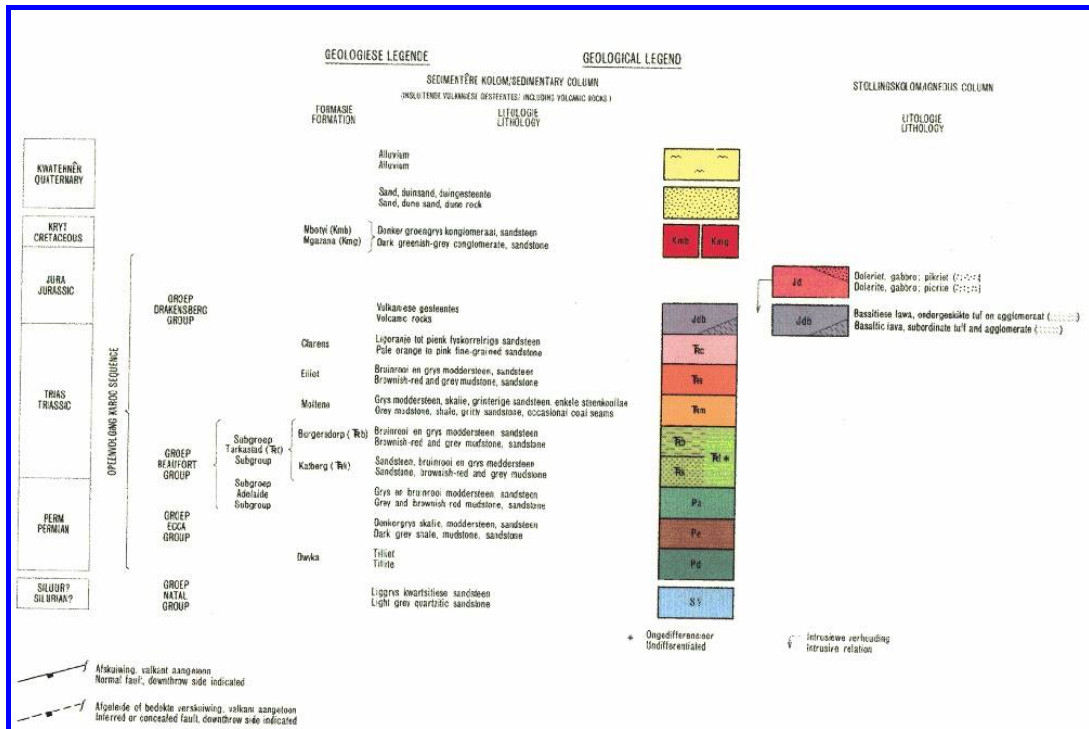


Figure 8: The geology of the area in which the Borrow pits are located (3128 Umtata)

11.1.1 Erodibility Index

Erodibility of soils can be described as the sensitivity of soils to the effects of wind and water on the soil structure. This property is expressed as an erodibility index, where low values indicate high potential for erosion, and high values correspondingly indicate a low potential for erosion.

The erodibility index is determined by combining the effects of slope and soil type, rainfall intensity and land use. These aspects are represented by terrain morphology, mean annual rainfall and broad land use patterns.

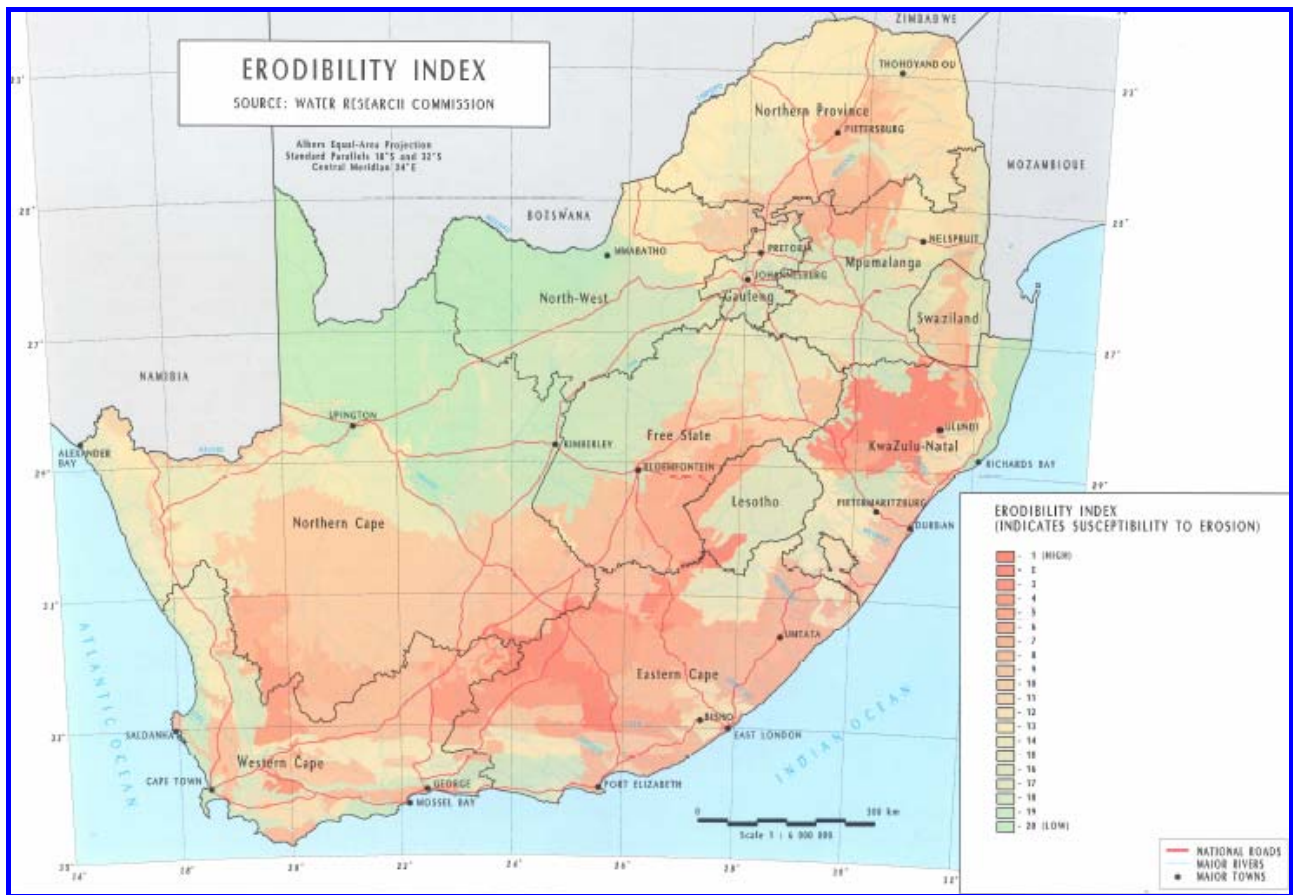


Figure 9: Erodibility Index

According to the Environmental Potential Atlas for South Africa, the study area falls within an Erodibility Index of between 7 and 9, which is at the lower end of the scale (1 being High and 20 being Low), indicating that the area is moderately to highly susceptible to erosion (Figure 9).

11.2 Archaeology, Palaeontology and Heritage Sites

A Phase 1 Archaeological Impact Assessment was undertaken on the identified borrow pits by Archaeomaps Archaeological Consulting (section 21.2). The findings of this assessment were as follows:

Rd_Nr_	No_	AIA Finding	AIA Recommendation
DR08147	147_BP01	No archaeological or cultural heritage resources, as defined and protected under the NHRA 1999, were identified on the surface or within exposed sub-surface sections during the Phase 1 AIA assessment of borrow pit 147_BP01.	It is recommended that use of borrow pit 147_BP01 proceeds as applied for without the developer having to comply with additional heritage compliance requirements.

DR08147	147_BP02	No archaeological or cultural heritage resources, as defined and protected under the NHRA 1999, were identified on the surface or within exposed sub-surface sections during the Phase 1 AIA assessment of borrow pit 147_BP02.	It is recommended that use of borrow pit 147_BP02 proceeds as applied for without the developer having to comply with additional heritage compliance requirements.
---------	----------	---	--

A Phase 1 Palaeontological Impact Assessment was undertaken on the identified borrow pits by Metsi Metseng Geological & Environmental Services (section 21.2). The findings of the assessments were as follows:

Borrow Pit	Rock type	Potential impact / significance	Irreplaceable loss of palaeontological resources?	Mitigation required and measures
147_BP01	<i>S? (Natal Group)</i>	low	no	Igneous/metamorphic rocks or Quaternary alluvial deposits underlie these zones, with no potential for fossils – no mitigation required.
147_BP02	<i>S? (Natal Group)</i>	low	no	Igneous/metamorphic rocks or Quaternary alluvial deposits underlie these zones, with no potential for fossils – no mitigation required.

11.3 Climate and Air Quality

Lusikisiki normally receives about 874mm of rain per year, with most rainfall occurring mainly during summer. It receives the lowest rainfall (12mm) in July and the highest (124mm) in February. The average midday temperatures for Lusikisiki range from 20.2°C in July to 25.5°C in February. The region is the coldest during July when the mercury drops to 8°C on average during the night.

Wienerts climatic N number for the area is less than 2, which should indicate that the rocks would decompose implying that chemical weathering would dominate over mechanical weathering.

The Eastern Cape Province does not appear to be a priority area as far as air quality is concerned, as is evidenced by the number and type of industries in the Province. Monitoring of air quality in the Province is performed on a fragmented basis as no co-ordinated network exists. No comprehensive assessment of air quality is therefore possible.

There is however currently no major sources of air pollution in this region, aside from the contribution that domestic fires and vehicle emissions make along existing roads. Ploughed fields, unpaved roads and unvegetated land are all sources of wind-generated dust. The majority of households, particularly

those in the rural areas, rely on fossil fuels such as paraffin and wood for domestic energy. Indoor air pollution is therefore a concern in the area, although it has not been quantified. The highest concentration of motor vehicles and their associated emissions in the area is likely to occur around Lusikisiki.

11.4 Topography and Drainage

The topography of the area is described as being table-lands.

147_BP01 is located at an elevation of 491 m above mean sea level (amsl). The drainage of the borrow pit is to the south west and south east towards non-perennial drainages lines. These non-perennial drainage lines drain south to the perennial Mlambomkulu River. The Mlambomkulu River has not been classed in terms of its ecological sensitivity. The nearest non-perennial drainage line is located approximately 100 m away from the borrow pit.

147_BP02 is located at an elevation of 485 m above mean sea level (amsl). The current drainage of the borrow pit is to the north east towards a non - perennial drainage line. This non-perennial drainage line drains north where it intercepts the perennial Mkwani River. The Mkwani River has not been classed in terms of its ecological sensitivity. The nearest non- perennial drainage line is located approximately 50 m away from the borrow pit.

As borrow pits are existing and have been utilised previously, the topography has been altered by the excavation of material from the hill slopes.

The study area falls in the primary drainage area T60. Within the primary drainage T60, the borrow pits fall within the quaternary catchment area of T60H. The mean annual precipitation of T60H quaternary is 1277.17 mm with a mean annual runoff of 389.9 mm.

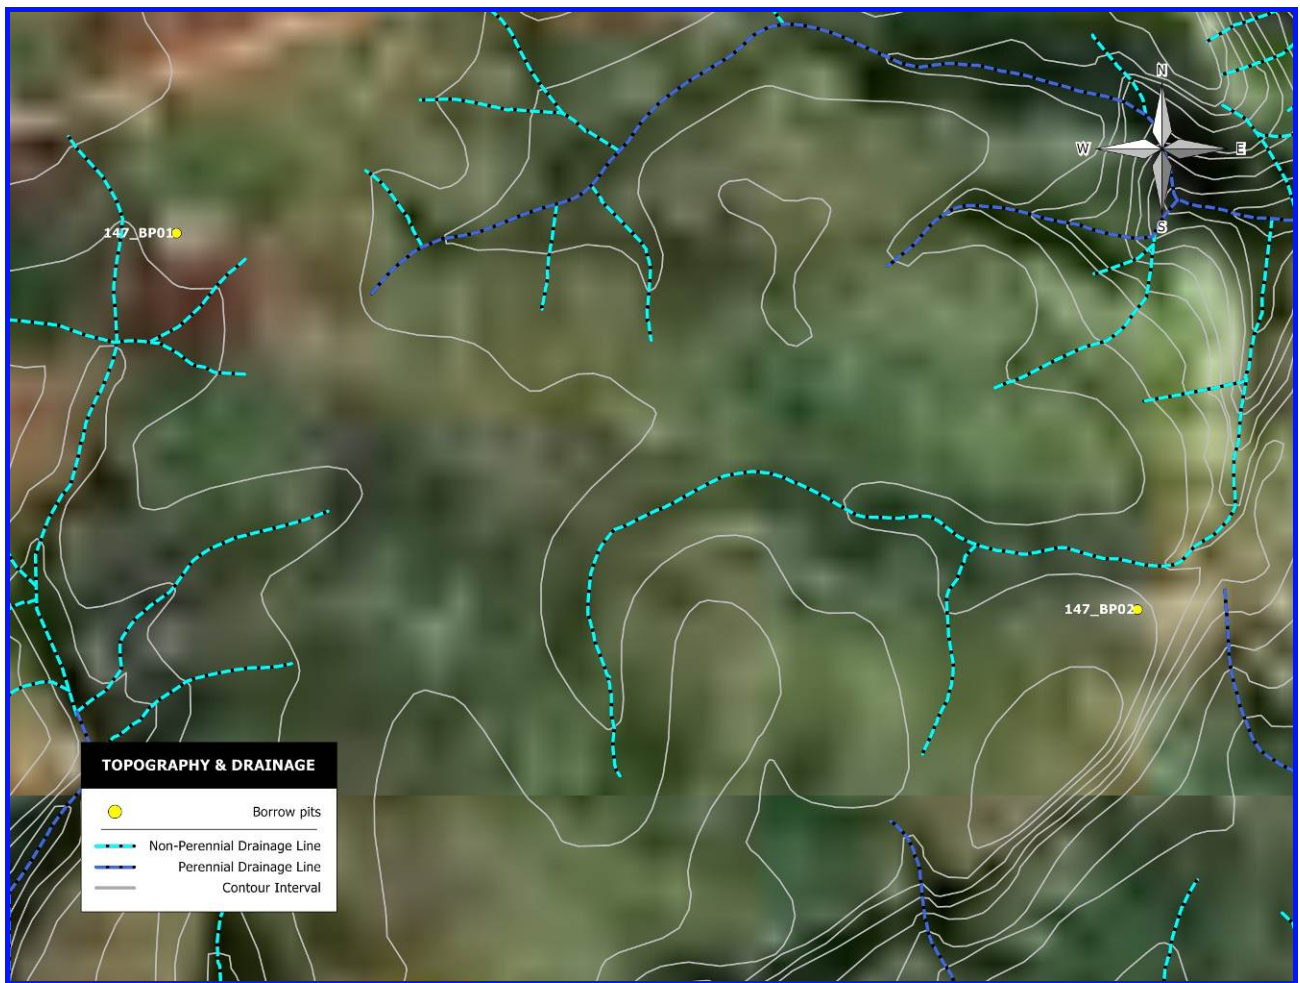


Figure 10: Drainage of the area in which the proposed borrow pits are located.



Figure 11: Terrain view indicating the position of the borrow pits in the landscape.

The topography may be impacted upon by the excavation of the existing borrow pits which in turn could have an effect on the storm water runoff and drainage of the immediate surrounding area. Areas of concentrated storm water runoff could be subject to increased erosion if not mitigated against appropriately by means of erosion control techniques and/or structures dissipating the velocity and flow of storm water runoff. The non-perennial drainage lines are referred to as such due to the fact that they are dry for the majority of the year, and some instance only flow during periods of high rainfall.

11.5 Fauna

Although a detailed faunal assessment was not undertaken, during the site visit the only fauna encountered were livestock and birds in the surrounding lands. The natural diversity of animal species and animal numbers within the site area may have been severely affected by the degradation of habitat, subsistence hunting and trapping as well as from displacement by livestock. There may however be some mammals, reptiles, amphibians in the surrounding areas, especially within areas still presenting natural landscapes. The current land use of the borrow pit sites does not present a unique habitat for rare or endangered fauna and No Red Data List mammals were observed.

The terrestrial mammal, reptile and amphibian fauna are not likely to be materially impacted on by the proposed activity, however any such fauna that is present on or near the site is likely to be displaced into the surrounding areas and into the natural areas.

11.6 Flora

11.6.1 Eastern Cape Biodiversity Conservation Plan (ECBCP)

According to the ECBCP the area in which the proposed borrow pits are located is identified as being predominantly Biodiversity Land Use Management Class 1 (BLMC 1 or CBA 1 - Maintain Near Natural State) (Figure 12).

A Biodiversity Land Management Class (BLMC) refers to the desired ecological state that a parcel of land should be kept in so as to ensure biodiversity persistence (designations may be at the scale of habitat patch, landscape or catchment). It can be described using sets of ecosystem condition indicators, referred to as Limits to Acceptable Change indicators (or LACs). LAC values are assigned for each BLMC to describe upper limits for the degree of acceptable ecological change or impact that any proposed land-use change may bring about without compromising the designated ecological state. In the table below four BMLC's are defined using Limits to Acceptable Change of six key land-use impact indicators.

Table 5: Limits to Acceptable Change thresholds for six key lands use impact indicators.

BLMC	Permissible transformation (per land parcel considered)	Change in ecosystem structure (fragmentation index)	Change in species composition and dominance	Overall change in natural disturbance regimes (fire, hydrology etc)	Resource extraction (% of Net Primary Production per annum)
Class 1	0%	0%	0%	Little or none	< 5%
Class 2	0% - 10%	0 to 10%	0 to 5%	Some	5 to 30%
Class 3	10 to 70%	10 to 50%	5 to 80%	Significant	> 30%
Class 4	70-100%	> 50%	> 80%	Significant	Any

Terrestrial Critical Biodiversity Area 1 (CBA 1) are areas identified as critically endangered vegetation types (ecosystems) through the ECBCP systematic conservation assessments, critically endangered vegetations types from STEP, critically endangered forest patches in terms of the National Forest Assessment, areas essential for meeting biodiversity targets for biodiversity features (SA vegetation types, expert mapped priority areas) and forest clusters identified as critical in the forestry planning process. The land use objective for this BLMC 1/ CBA 1 should be to maintain biodiversity in as natural state as possible and to manage for no biodiversity loss. It is thus suggested by the ECBCP that this land class be used for conservation land use purposes only.

The ECBCP may however have significant limitations in that there may be significant differences between the ECBCP description of land use and condition and the actual land use, condition and environmental status. The borrow pits are existing sites that have been degraded in the past.

No more than 0.98 hectares of indigenous vegetation will be removed from the borrow pit mining footprints.

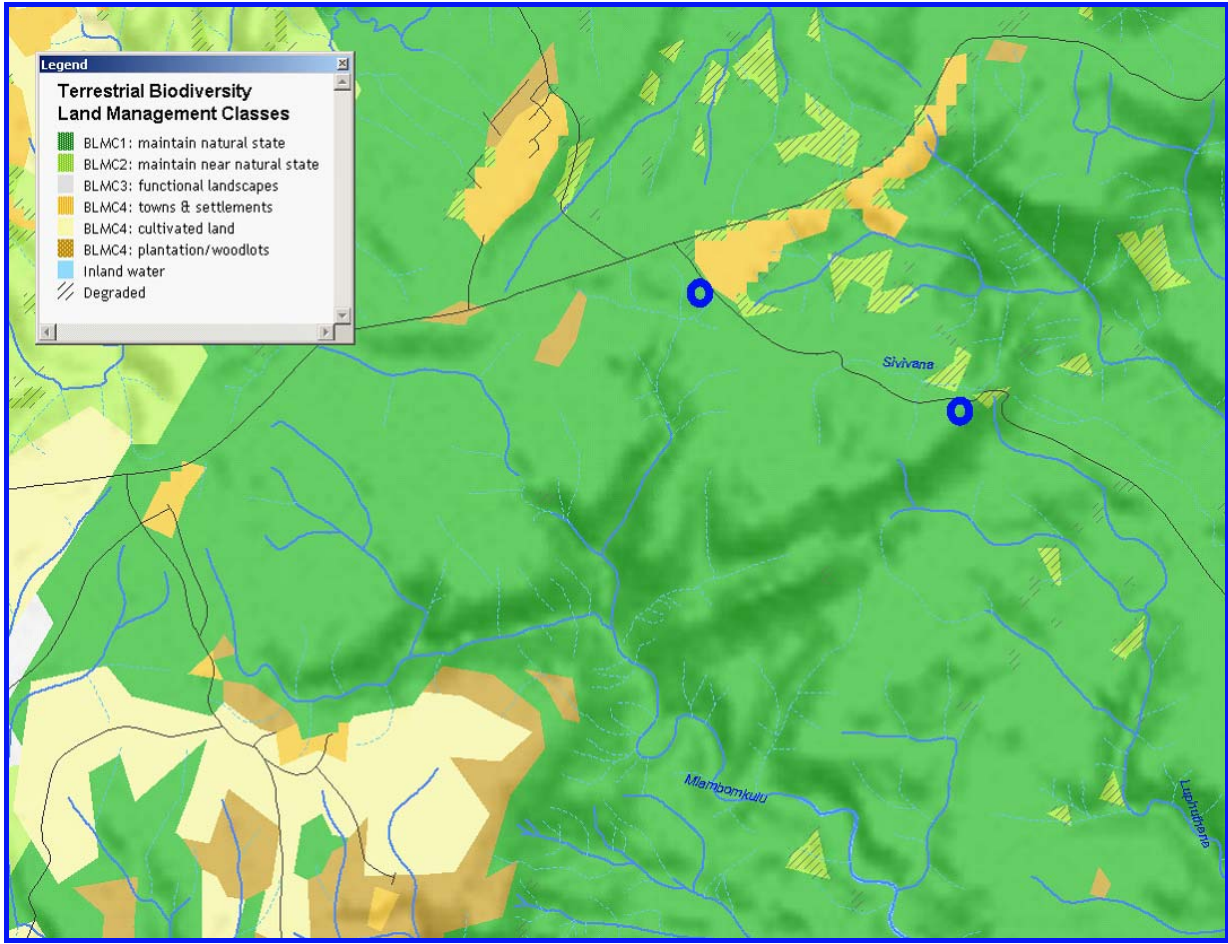


Figure 12: Eastern Cape Biodiversity Conservation plan and the location of the Borrow pits.

11.6.2 Vegetation Description

While the area in which the proposed borrow pits are located has been identified as the Pondoland Centre of Endemism and is located in the Pondoland-Ugu Sandstone Coastal Sourveld the vegetation unit as such has been transformed in the immediate area of the proposed borrow pits, particularly at borrow pit 147_BP01, as a result of the surrounding communal settlement and agricultural activities/practices, for example grazing and cultivation. Grazing is also indicative at borrow pit 147_BP02, however the vegetation in the area of this borrow pit is less degraded. The proposed borrow pits have between 60 - 80 % indigenous vegetation cover. The utilisation of the proposed borrow pits is not expected to have a significant impact on the vegetation of the area.

The vegetation present in the area of the existing borrow pits tends to be dominated by a low diversity grassland with herbaceous and shrub species.

11.6.2.1 Protection status and legislation and Species of Special Concern

11.6.2.1.1 Indigenous flora

While only a preliminary botanical investigation was undertaken, it was observed that present in the area of the borrow pit 147_BP02 was the orchid species *Disa woodii*. All species of the family *Orchidaceae* are protected under the Cape Nature and Environmental Conservation Ordinance of 1974 and the Transkei Decree of 1992. As this species is protected, it is required that consent is obtained from the landowner to remove them. It must be noted that while *Disa woodii* is protected under the various schedules, this species is identified as being of least concern under the Red Data List. It is recommended that the *Disa woodii* present in the area of the borrow pit either be left alone or rescued and relocated to outside of the borrow pit footprint prior to mining activities.

While a number of herbaceous species were noted at borrow pit 147_BP02, no other endangered or protected species under the various schedules were observed in the area and thus the conservation status of the vegetation present in the area of the proposed borrow pit 147_BP02 is seen as being moderate. No endangered or protected species under the various schedules were observed in the area of borrow pit 147_BP01 and thus the conservation status of the vegetation present in the area of the borrow pit is seen as being low.

No more than 0.98 hectares of indigenous vegetation will be removed from the borrow pit mining footprints.

11.6.2.1.2 Alien Invasive Plant species

Few declared alien invasive plant species are present within the area of the borrow pits, in fact alien species were only identified at 147_BP01 (Table 6). The borrow pit tended to have an alien invasive vegetation cover of < 5%. The proposed borrow pit 147_BP01 thus has a very low density of alien species, which has a low overall impact. These invasive species require removal according to the Conservation of Agricultural Resources Act 43 of 1983 and methods of their removal and treatment should be undertaken according to the Working for Water Guidelines.

Table 6: Alien Invasive plants present within the area of the borrow pit 147_BP01.

No.	Botanical Name	Common Name	Family	Category
1	<i>Solanum spp</i>	-	Solanaceae	CARA 1
2	<i>Achryranthes aspera</i>	Burweed	Amaranthaceae	CARA 1
3	<i>Cirsium vulgare</i>	Scotch thistle	Asteraceae	CARA 1

11.7 Visual Aspects

The proposed borrow pits have been mined in the past and are located within proximity to public access roads, as a result, these sources are visible and currently have or will have a moderate impact on the aesthetics of the area. The area is typically rural “Transkei” and much of the natural environment has been degraded by human impacts. However the scenery is pleasant.

11.8 Socio - Economic Environment

Land use and settlement patterns of the area are influenced by the previous political division of the area with the right bank of the Great Kei being part of South Africa and the left bank being part of the former Transkei. The right bank of the great Kei is predominantly commercial, privately owned farming while on the left bank the dominant form of settlement is communal, with communal forms of tenure. The former Transkei is characterized by dispersed rural settlements and communal subsistence farming and grazing.

The proposed borrow pits fall within Ward 23 of the Ingquza Hill Local Municipality. According to Stats SA (Census 2001) the demographics of this ward is as proceeds.

Within ward 23 of the Ingquza Hill Local Municipality, the population group tends to be predominantly African (99.7%) and as a result the predominantly spoken language in this ward is consequently Xhosa. Unemployment levels within this ward are very high at approximately 78%, with a large proportion of the ward being economically inactive. The average annual household income is predominantly no income or between R0 - 9 600.

Thus the surrounding area is predominantly lower income settlement areas occupied by “previously disadvantaged” families.

The proposed project is unlikely to change the socio - economic structure of the wards. However, the labour intensive construction of roads and the utilization of the borrow pit may result in the creation of temporary employment, and will be of particular benefit should the local community be provided with these employment opportunities. The socio-economic benefits of these jobs could also percolate through historically disadvantaged communities. There are thus positive socio-economic impacts in terms of creation of employment opportunities, skills transfer to the local community and providing a higher quality of access to the surrounding residents.

11.9 Existing Land-use

The existing land use in the area of the proposed borrow pits consists of settlement, rural homesteads and subsistence/rural agriculture and open space/natural areas.

Landuse practices in the area have resulted in some degradation of the natural environment in places. The majority of the study area is communal farm land. The Department of Rural Development and Land Reform is the legal custodian of the land on which the proposed borrow pits are located. The utilisation of the proposed borrow pits will for the most part not impact on any land uses and on closure will be rehabilitated and thus will not impede any landuses.

12 Potential Issues & Environmental Impacts

The following have been identified as potential environmental impacts associated with the utilisation of the borrow pits. The significance of the identified impacts is assessed in Table 8.

12.1 Geology & Soils

During the construction and operational phase soil loss/topsoil loss may arise as a result of vegetation removal and soil erosion which could impact negatively. The topsoil is a particularly scarce resource in this environment, and must therefore be protected against wind, erosion, compaction, alien invasive plant species and pollution as the topsoil will be needed for rehabilitation purposes.

Activities such as the removal of vegetation and earth moving activities may result in erosion in the area of the proposed borrow pits. During the closure phase, areas disturbed during the operational phase which have not be appropriately rehabilitated, may result in the continued erosion of soils in the area of the proposed borrow pits. Appropriate erosion control must be provided and vegetation cover must be established as quickly as possible following shaping and closure of the sites in order to protect the soil from erosion.

During the construction and operational phases soil pollution as a result of spillages and loss of viability due to compaction may potentially impact negatively. Spillage of hazardous/ chemical substances stored and leakage from construction equipment/machinery as well as the servicing of vehicles on site, washing of vehicles (soaps & greases) etc may result in the contamination of soils. In addition spillage from chemical toilets provided for construction staff will result in soil pollution.

The borrow pits are not normally associated with blasting activities and should therefore not have a significant impact on the geology of the area.

12.2 Topography & Drainage

During the operational phase, the topography may be impacted upon by extensive excavation of sections during mining activities, thus potentially changing the landscape. However it must be noted that the landscape/topography at the borrow pits is currently impacted by the past excavation/mining activities of these existing borrow pits. Rehabilitation during the closure phase would improve the topography/landscape from its current state.

In addition, the excavation activities during the mining activities could in turn have an effect on the storm water runoff and drainage of the immediate surrounding areas.

12.3 Consumption of Non-renewable Resources

The mining activities during the operational phase may impact on the local and regional natural resources as soil and hard rock will be used during construction activities. The proposed quantities mined from the borrow pits can be seen as relatively low and should therefore not deplete local or regional resources significantly.

12.4 Surface Water/ Drainage lines

Surface water may become polluted via point source and/or diffuse discharge such as oil, fuel and chemical spills. Improper disposal of solid waste generated may pollute the aquatic environments. In addition, improper transportation and storage of fuels may potentially result in surface water pollution. Storage and maintenance of the construction machinery may potentially result in surface water pollution.

Construction & Operational activities may also lead to soil erosion, which could lead to sedimentation of the rivers, and subsequently, the water quality. This may lead to an impact on downstream biota of the river/stream. No new mining excavations will take place within 32 m of a water course.

If any surface water is to be abstracted for construction/operational/closure purposes then the contractor must obtain a permit from the Department of Water Affairs prior to any abstraction taking place.

12.5 Groundwater

Groundwater may also become polluted via point source and/or diffuse discharge such as oil, fuel and chemical spills. Petroleum products released to the environment migrate through soil via two general pathways, namely, as bulk flow infiltrating the soil under the forces of gravity and capillary action, and, as individual compounds separating from the bulk petroleum mixture and dissolving in air or water. As the products migrate through the soil column, a small amount of the product mass is retained by soil particles.

The bulk product retained by the soil particles is known as “residual saturation”, and depending upon the persistence of the products, residual saturation can potentially reside in the soil for years. Residual saturation is important as it determines the degree of soil contamination and can act as a continuing source of contamination for individual compounds to separate from the bulk product and migrate independently.

If any groundwater is to be abstracted for construction/operation/closure purposes then the contractor must obtain a permit from the Department of Water Affairs prior to any abstraction taking place.

If any groundwater is to be abstracted for construction/operational/closure purposes then the contractor must obtain a permit from the Department of Water Affairs prior to any abstraction taking place.

12.6 Vegetation Removal (Flora) and Habitat Disturbance

The loss of vegetation cover, loss of protected species, spread of alien invasive vegetation and loss of animal habitat during the construction and operational phases may impact negatively. The proposed borrow pits show more than 60% vegetation cover.

During the construction and operational phase as a result of vegetation clearing the permanent loss of indigenous vegetation will occur. However all construction and operation activities will be within the area already disturbed and where the vegetation to be removed is predominantly of a low to moderate sensitivity, thus the impact on indigenous vegetation will be minimal.

As a result of vegetation clearing for the utilisation of the proposed borrow pits, natural habitat may be lost. However all disturbance in the area of the proposed borrow pit has been identified where the habitat has already been degraded and is predominantly of low to moderate sensitivity.

During the construction and operational phase species of special concern may be removed, however species of special concern identified within the mining footprint of the proposed borrow pits tends to be of least concern species in terms of the Red Data List. In addition it is recommended that these be relocated prior to mining activities

As a result of disturbance during the construction and operational phase, there may be increased risk of alien invasion. However during the construction and operational activities clearing of alien invasives from the proposed borrow pit areas will result in a positive impact. The presence of alien invasives is however very low, <5%.

In a regional context the vegetation unit identified is Pondoland-Ugu Sandstone Coastal Sourveld, which is classified as being “vulnerable”. The ECBCP has identified that the proposed borrow pits are predominantly located in a BLMC 1- Maintain Natural State. It must be noted that while the proposed borrow pits are located in Pondoland-Ugu Sandstone Coastal Sourveld, the area has been degraded as a result of the past mining activities and past and current communal agricultural land practices (grazing & cultivation), thus the impact on the vegetation unit should be minimal.

Most impacts in the above respect are of minor significance and can be managed (i.e. through use of existing pathways and disturbed areas). No impacts of critical significance to the vegetation are present.

Rehabilitation should form an integral part of the post operational phase in order to avoid further soil erosion, vegetation removal and alien invasive weeds.

Mining activities may result in the disruption of habitat and thus disruption to fauna. Noisy construction activities and the increase in human activity on the site are likely to disturb resident faunal species and cause them to leave the area. Animals could also be killed by construction activities if they take cover in their nests in areas where mining activities are taking place and are then destroyed or covered by collapsed material. The construction and operational phase may also result in staff actively hunting, trapping and disrupting fauna. Mining activities will however be limited to the already transformed/disturbed area and therefore impact on fauna should be minimal. The significance of the various issues identified with regards to fauna is anticipated to be low. The surrounding area is disturbed by settlements.

12.7 Air Quality

The air quality may be impacted upon by the mining activities due to dust generation and fugitive emissions from operation, excavation & hauling vehicles. Air quality may be reduced as a result dust generation and emissions from construction vehicles and construction equipment, this impact however is short term.

12.8 Noise

The proposed mining activities will result in increased noise levels as a result of increased construction vehicles and equipment; however this will be restricted to working hours and is relatively short term.

12.9 Visual Impact

Borrow pit activities during the construction and operational phase may lead to dust and noise generation and vegetation removal and change in landform which could have a visual impact on the rural character of the area. This however is seen as a short term impact. Visual impact associated with the utilisation of the borrow pits will be more severe to the immediate residents than at distances further than 2 km where the visual impact should be minimal as the topography and the vegetation present should create a visual screen. Areas not rehabilitated and revegetated properly may become unsightly.

Visual impacted will be largely mitigated on closure. Rehabilitation of the existing borrow pits will ultimately improve the aesthetics of the area.

12.10 Archaeology, Palaeontology & Heritage Sites

An Archaeological Impact Assessment was conducted on the proposed borrow pits. Assessment of the borrow pits yielded no archaeological or heritage resources as defined and protected by the NHRA 1999. A Palaeontological Impact Assessment was conducted on the proposed borrow pits. Assessment of the borrow pits yielded no palaeontological resources.

12.11 Land use

The proposed borrow pits and surrounding areas are currently utilised predominantly for agricultural grazing or open land purposes, however the temporary loss is not considered significant. Landuse will be restored on closure. The borrow pits will be restored and rehabilitated on closure thereby enhancing the landuse capabilities.

12.12 Socio-Economic Environment

The project is unlikely to have any significant effects on the socio-economic structure of the area. However the local community could benefit through employment, income generation, skills development

and small business enterprises (i.e. fencing companies). These benefits may be enhanced with focused procurement and by employing labour intensive methods during construction, operation and rehabilitation of the borrow pits. Labour should be sourced from the target area so that those affected stand to benefit the most.

The proposed project may impact positively by the creation of temporary employment opportunities to the local community. In addition, the employment of the local community would result in skills development which will impact positively.

12.13 Health and Safety

During the construction/operational/closure phases there are certain risks posed to human health & safety via exposure to high noise and dust levels, as well as steep and/or unstable faces formed during mining activities. In addition, the use of heavy machinery in close proximity to households also poses a threat. Community health and safety risks should be controlled through the implementation of a Health & Safety Management Plan to be implemented by the contractor. Existing unsafe excavations (with vertical faces) should be "made safe" on closure.

13 Environmental Impact Significance Assessment and Mitigation Measures

13.1 Environmental Impact Risk Assessment Methodology

Environmental impact is assessed using an in-house methodology and software (EIA-RA 05 [©]), developed by BESC, which operates a 3-D risk assessment protocol based on severity of impact, duration of impact and confidence of impact occurring.

The first step in assessing any environmental impact to listed possible activities or processes that are likely to occur and then identify any resultant or consequential environmental issue. The potential impact associated with an environmental issue is then identified as is the spatial range that any such impact would effect or take place in. The assessment is undertaken under two primary conditions, namely:

- Degree of impact WITHOUT environmental management protocols in place
- Degree of impact WITH environmental management protocols in place

To achieve this, information on severity of impact, duration of impact and confidence of impact occurring are entered, with a risk assessment output for each environmental impact being computed. The environmental impacts are thus categorised into ten negative impact categories and a four positive impact categories.

The ten negative categories are arranged on a scale of importance from category 1 being most negative and category 10 being least negative. Whilst the positive impact categories are arranged on a similar scale whereas category A is most positive and category D being least positive. In order to place a degree of significance to each impact (positive and negative), significance of impact has been defined as (Table 7).

Table 7: EIA-RA 05© - Risk Assessment Ratings.

Significance	Categories	Definition
Very High	1 & 2	<p>These impacts would be considered by society as constituting a major and usually permanent change to the (natural and/or social) environment.</p> <ul style="list-style-type: none"> ○ Example: The loss of a species would be viewed by informed society as being of VERY HIGH significance.
High	3 & 4	<p>These impacts will usually result in long term effects on the social and/or natural environment. Impacts rated as HIGH will need to be considered by society as constituting an important and usually long term change to the (natural and/or social) environment. Society would probably view these impacts in a serious light.</p> <ul style="list-style-type: none"> ○ Example: The loss of a diverse vegetation type, which is fairly common elsewhere, would have a significance rating of HIGH over the long term, as the area could be rehabilitated.
Moderate	5, 6 & 7	<p>These impacts will usually result in medium to long term effects on the social and/or natural environment. Impacts rated as MODERATE will need to be considered by society as constituting a fairly important and usually medium term change to the (natural and/or social) environment.</p> <ul style="list-style-type: none"> ○ Example: The loss of a sparse, open vegetation type of low diversity may be regarded as MODERATELY significant.
Low	8, 9 & 10	<p>These impacts will usually result in medium to short term effects on the social and/or natural environment. Impacts rated as LOW will need to be considered by the public and/or the specialist as constituting a fairly unimportant and usually short term change to the (natural and/or social) environment. These impacts are not substantial and are likely to have little real effect.</p> <ul style="list-style-type: none"> ○ Example: The temporary change in the water table of a wetland habitat, as these systems are adapted to fluctuating water levels. <p>or,</p> <p>There are no primary or secondary effects at all that are important to scientists or the public.</p> <ul style="list-style-type: none"> ○ Example: A change to the geology of a particular formation may be regarded as severe from a geological perspective, but is of NO significance in the overall context.
Positive	A, B, C, D	<p>Any beneficial impact to the environment:</p> <p>A = Very Beneficial</p> <ul style="list-style-type: none"> ○ Example: Protection of an environmental asset or removal of an existing/latent negative environmental impact; <p>B = Beneficial</p> <ul style="list-style-type: none"> ○ Example: Improve management of the environment; <p>C = Moderately Beneficial</p> <ul style="list-style-type: none"> ○ Example: Removal of alien species from the property; <p>D = Slightly Beneficial</p> <ul style="list-style-type: none"> ○ Example: Minor improvement that has no material significance to the immediate environment.

13.2 Sensitivity

An overall sensitivity assessment will be made to include condition or state of degradation, invasion status, extent and relative importance of the vegetation types as well as the degree to which successful rehabilitation can take place. Three sensitivity scores are allocated as follows:

1. Areas scoring a low sensitivity are those areas that tend to be highly degraded and it is unlikely that they could be rehabilitated to a normal functioning state without extreme effort and expense.
2. Areas of moderate sensitivity are those areas that contain reasonably intact habitat with low or no alien infestation.
3. Areas scoring a high sensitivity on site are those having an important ecological function.

13.3 Impacts

Four factors need to be considered when assessing the significance of impacts, namely:

- A. the relationship of the impact to temporal scales
 - B. the relationship of the impact to spatial scales
 - C. the actual significance of the impact, and
 - D. the probability of the event occurring
- A. The **temporal scale** defines the significance of the impact at various time scales, as an indication of the duration of the impact.
1. **Short term:** less than 5 years. Many construction phase impacts will be of a short duration.
 2. **Medium term:** between 5-20 years, the approximate duration of the mining operation.
 3. **Long term:** between 20-40 years, and from a human perspective essentially permanent.
 4. **Permanent:** over 40 years, and resulting in a permanent and lasting change that will always be there.
- B. The **spatial scale** defines physical extent of the impact.
1. **Site:** having an impact only within the confined of the development.
 2. **Local:** having an impact within the local area of the development.
 3. **Municipal:** having an impact within the municipal area (i.e. the Ingquza Hill Local Municipality)
 4. **Regional:** having an impact within the regional context (Eastern Cape)
 5. **National:** having an impact at the National Level (South Africa)

- C. The **Environmental Significance** scale is an attempt to evaluate the importance of a particular impact. This evaluation needs to be undertaken in the relevant context, as an impact can either be ecological or social, or both. The evaluation of the significance of an impact relies heavily on the values of the person making the judgment. For this reason, impacts of especially a social nature need to reflect the values of the affected society. SIGNIFICANCE will need to be evaluated with and without mitigation. In many cases, mitigation will take place, as it will have been incorporated into project design. A five-point significance scale has been applied (Table 7).
- D. It is also necessary to state the **probability** with which the likelihood of the event/impact will occur.
1. **Definite:** More than 90% sure of a particular fact. To use this one will need to have substantial supportive data.
 2. **Probable:** Over 70% likelihood of that impact occurring.
 3. **Possible:** Only over 40% likelihood of an impact occurring.
 4. **Unsure:** Less than 40% likelihood of an impact occurring.

Table 8: Assessment of Significance of Environmental Impacts.

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
Geology & Soils	Soil Erosion	Negative	Construction, Operational & Closure	Site Specific	3	4	2	High	Minimise the areas of disturbance or vegetation clearance. Revegetate areas that have been disturbed as soon as possible. Cut and fill slopes shall be made stable and be revegetated as soon as possible during the operational phase.	Site Specific	5	4	2	Moderate
Geology & Soils	Soil Pollution	Negative	Construction & Operational	Site Specific	5	4	2	Moderate	Under no circumstances shall hazardous substances be disposed of on site or into the surrounding environment. Accidental pollution incidents shall be reported to the Project Manager/ECO immediately and shall be cleaned up by the Contractor or a nominated clean-up organisation at the expense of the contractor. Vehicles should be well maintained. Chemical toilets are to be emptied on a regular basis and disposed of at the licensed water treatment facility	Site Specific	5	4	4	Low
Geology & Soils	Soil Compaction	Negative	Construction, Operational & Closure	Site Specific	5	4	2	Moderate	Minimise the areas of disturbance or vegetation clearance. Scarify & Revegetate areas that have been compacted as soon as possible.	Site Specific	5	7	5	Low
Geology & Soils	Topsoil Loss	Negative	Construction, Operational & Closure	Local	3	4	3	Moderate	Minimise the areas of disturbance or vegetation clearance. Topsoil to be stockpiled in designated areas and is to be used during rehabilitation. Topsoil only to be stripped from required areas and done in a way to minimize wind erosion. Stockpiles must be protected from erosion and contamination	Site Specific	5	4	3	Low
Topography & Drainage	Cut & Fill/Excavations	Negative	Construction & Operational	Site Specific	5	3	4	Low	Cut and fill slopes/Excavations shall be made stable and be revegetated as soon as possible	Site Specific	7	6	4	Low

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
Topography & Drainage	Increased Stormwater Runoff	Negative	Construction & Operational	Site Specific	5	8	3	Low	All areas of stormwater release must be suitable stabilized	Site Specific	8	9	5	Low
Topography & Drainage	Increased Soil Erosion	Negative	Construction & Operational	Site Specific	3	4	2	High	Minimise the areas of disturbance or vegetation clearance. Revegetate areas that have been disturbed as soon as possible. Cut and fill slopes/Excavations shall be made stable and be revegetated as soon as possible during the construction phase.	Site Specific	5	7	4	Low
Non-renewable Resources	Consumption of Non-renewable Resource	Negative	Operational	Municipal	3	2	3	High	The proposed quantities mined should not exceed limits specified in the mining plans/permits issued by DMR	Local	5	4	2	Moderate
Non-renewable Resources	Material Resources for roads not imported from far off distances	Positive	Operational	Municipal	5	5	2	Low	No Mitigation Required	N/A				#N/A
Surface Water	Surface water contamination	Negative	Construction & Operational	Local	4	5	5	Low	Areas of spillages and/or contamination shall be cleaned up immediately and disposed of at a licensed landfill site. Release of chemicals directly into the environment is strictly prohibited. Waste is to be removed from the area on a regular basis.	Site Specific	8	5	8	Low
Surface Water	Sedimentation	Negative	Construction & Operational	Local	3	4	3	Moderate	Minimise the areas of disturbance or vegetation clearance. Revegetate areas that have been disturbed as soon as possible. Cut and fill slopes/excavations shall be made stable and be revegetated as soon as possible during the construction phase. A stormwater cut-off berm shall be provided upslope from the mining areas. Gabions shall be provided at stormwater release areas	Site Specific	4	5	5	Low

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
Surface Water	Decreased water quality	Negative	Construction & Operational	Local	5	6	5	Low	A stormwater cut-off berm shall be provided upslope from the mining areas. Gabions shall be provided at stormwater release areas	Site Specific	8	5	8	Low
Surface Water	Decrease in Benthic microalgae	Negative	Construction & Operational	Local	5	6	5	Low	A stormwater cut-off berm shall be provided upslope from the mining areas. Gabions shall be provided at stormwater release areas	Site Specific	8	5	8	Low
Surface Water	Decrease in Submerged macrophytes	Negative	Construction & Operational	Local	5	6	5	Low	A stormwater cut-off berm shall be provided upslope from the mining areas. Gabions shall be provided at stormwater release areas	Site Specific	8	5	8	Low
Surface Water	Decrease in Macroenthos	Negative	Construction & Operational	Local	5	6	5	Low	A stormwater cut-off berm shall be provided upslope from the mining areas. Gabions shall be provided at stormwater release areas	Site Specific	8	5	8	Low
Surface Water	Change in fish community structure	Negative	Construction & Operational	Local	5	6	5	Low	A stormwater cut-off berm shall be provided upslope from the mining areas. Gabions shall be provided at stormwater release areas	Site Specific	8	5	8	Low
Surface Water	Surface water abstraction	Negative	Operational	Local	3	5	2	Moderate	Applications for a water use license must be made in terms of the National Water Act, (Act 36 of 1998). Conditions contained in the approval(s) must be strictly adhered to. Abstraction rates should not exceed those specified in the water use license	Local	4	5	4	Low
Groundwater	Groundwater contamination	Negative	Construction & Operational	Local	4	3	3	Moderate	Areas of spillages and/or contamination shall be cleaned up immediately and disposed of at a licensed landfill site	Site Specific	5	4	5	Low

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
Groundwater	Groundwater abstraction	Negative	Operational	Local	3	5	2	Moderate	Applications for a water use license must be made in terms of the National Water Act, (Act 36 of 1998). Conditions contained in the approval(s) must be strictly adhered to. Abstraction rates should not exceed those specified in the water use license	Local	4	5	4	Low
Vegetation and Habitat	Loss of indigenous vegetation	Negative	Construction & Operational	Local	3	4	3	Moderate	Minimise the areas of disturbance or vegetation clearance. Revegetate areas that have been disturbed as soon as possible.	Site Specific	6	5	5	Low
Vegetation and Habitat	Disturbance of habitat	Negative	Construction & Operational	Site Specific	5	4	3	Low	Minimise the areas of disturbance or vegetation clearance. Revegetate areas that have been disturbed as soon as possible. No hunting/trapping of any animals is strictly forbidden.	Site Specific	8	8	5	Low
Vegetation and Habitat	Alien Invasive Plant Species	Negative	Construction, Operational & Closure	Local	3	4	3	Moderate	All alien invasive plant species should be removed according to the Conservation of Agricultural Resources Act.	Site Specific	5	7	8	Low
Vegetation and Habitat	Removal of alien invasive species	Positive	Construction, Operational & Closure	Local	7	5	5	Low	No Mitigation Required	N/A				#N/A
Air Quality	Dust Generation	Negative	Construction & Operational	Local	3	5	2	Moderate	Avoid dust generating activities during periods of medium to high winds. Cover and/or maintain appropriate freeboard on trucks hauling any loose material that could produce dust when travelling. Limit the areas that need to be cleared of vegetation. Revegetate disturbed areas as soon as possible after clearing.	Site Specific	4	5	3	Low
Air Quality	Fugitive Emissions	Negative	Construction & Operational	Site Specific	8	8	3	Low	Vehicles should be properly maintained and serviced.	Site Specific	8	8	5	Low

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
Noise	Noise Pollution	Negative	Construction & Operational	Local	3	5	2	Moderate	All noise sources shall be controlled at the source; Vehicle silencers should be in good working order and should be maintained. No construction/operational work should be done after working hours or on Sundays and Public Holidays.	Local	4	5	3	Low
Visual	Change in Sense of Place	Negative	Construction, Operational & Closure	Local	3	2	3	High	Borrow Pits are to be rehabilitated to represent the former habitat/surrounding land use character.	Local	5	4	6	Low
Visual	Decreased Visual Quality	Negative	Construction, Operational & Closure	Local	4	2	4	Moderate	Protect and maintain the vegetated slopes as a natural screen. Ensure that any signage (i.e. at entrance gate of construction camp site) is visible but not visually intrusive. Ensure good housekeeping at the construction campsite and control litter and general site cleanliness. Ensure that adequate ablution facilities are in place, that the workforce utilises these facilities and that they are placed where they are not visible to the public.	Local	8	5	6	Low
Visual	Rehabilitation of existing borrow pits	Positive	Closure	Local	4	4	2	Moderate	No Mitigation Required	N/A				#N/A

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
Archaeology, Palaeontology & Heritage Sites	Disturbance of sites	Negative	Construction & Operational	Local	4	3	3	Moderate	All finds of human remains shall be reported to the nearest police station. Human remains from the graves of victims of conflict, or any burial ground or part thereof which contains such graves and any other graves that are deemed to be of cultural significance may not be destroyed, damaged, altered, exhumed or removed from their original positions without a permit from the South African Heritage and Resource Agency (SAHRA) Work in areas where artefacts are found shall cease immediately and SAHRA notified. Under no circumstances shall the Contractor, employees, subcontractors or subcontractors' employees remove, destroy or interfere with archaeological artefacts. All recommendations made in the Specialist reports and in the SAHRA A&PRC must be adhered to	Local	8	6	7	Low
Archaeology, Palaeontology & Heritage Sites	Loss of sites	Negative	Construction & Operational	Local	3	3	2	High	All finds of human remains shall be reported to the nearest police station. Human remains from the graves of victims of conflict, or any burial ground or part thereof which contains such graves and any other graves that are deemed to be of cultural significance may not be destroyed, damaged, altered, exhumed or removed from their original positions without a permit from the South African Heritage and Resourc Agency (SAHRA) Work in areas where artefacts are found shall cease immediately and SAHRA notified. Under no circumstances shall the Contractor, employees, subcontractors or subcontractors'	Local	5	6	7	Low

ASSESSMENT				PRIOR TO MITIGATION					POST MITIGATION					
Environmental Issue	Environmental Impact	Positive or Negative	Phase	Spatial	Severity	Duration	Probability	Significance Assessment	Mitigation Measures	Spatial	Severity	Duration	Probability	Significance Assessment
									employees remove, destroy or interfere with archaeological artefacts. All recommendations made in the Specialist reports and in the SAHRA A&PRC must be adhered to.					
Archaeology, Palaeontology & Heritage Sites	Discovery of new/buried sites	Positive	Construction & Operational	Municipal	2	3	5	Moderate	No Mitigation Required	N/A				#N/A
Land Use	Change in land use	Negative	Construction, Operational & Closure	Local	3	3	4	Moderate	Borrow Pits are to be rehabilitated to represent the former habitat/surrounding land use character.	Local	8	4	8	Low
Socio -Economic	Disturbance to rural character	Negative	Construction, Operational & Closure	Local	5	3	3	Low	Borrow Pit is to be rehabilitated to represent the former habitat/surrounding land use character.	Local	8	5	6	Low
Socio -Economic	Job Creation	Positive	Construction & Operational	Municipal	4	3	3	Moderate	No Mitigation Required	N/A				#N/A
Socio -Economic	Skills Development	Positive	Construction & Operational	Municipal	4	3	3	Moderate	No Mitigation Required	N/A				#N/A
Socio -Economic	Improved Road Quality	Positive	Operational	Municipal	4	3	3	Moderate	No Mitigation Required	N/A				
Socio -Economic	Safety Risk	Negative	Construction & Operational	Local	2	2	3	Very High	The mining area shall be fenced off and access to the site shall be restricted by means of a gate. All Occupational Health & Safety Standards shall be strictly adhered to. Excavations should be made safe prior to closure.	Site Specific	2	2	8	Moderate

The No-Go Alternative

The “no-go” alternative simply involves leaving the sites in their current condition and not undertaking the proposed mining operations at the proposed borrow pits. This means that the impacts identified as a result of the construction/operational phase would not occur, these being impacts related to vegetation removal, soil erosion and pollution, surface water, groundwater and terrestrial pollution, air quality and visual impacts. Although no negative environmental issues identified for the construction/operational phase would occur, the existing borrow pits would not be rehabilitated thus leaving them in their current visual state and without the use of these sources the financial feasibility to regravell/maintain the district road would be jeopardized, thus potentially resulting in the road remaining in a poor condition, and in all likelihood deteriorating further, resulting in further soil erosion and unsafe road conditions.

14 Mitigatory Measures & Environmental Management

The guidelines, operating procedures and rehabilitation/pollution control requirements contained in this Environmental Management Plan will be binding on the holder of the mining permit permission after approval of the Environmental Management Plan by the Department of Mineral Resources. It is essential that this portion be carefully studied, understood, implemented and adhered to at all times. The mitigation measures which will apply during the Site Establishment, Operation and Rehabilitation phases are provided in the following Sections.

14.1 Responsibilities of the Role Players

14.1.1 Developer

The Developer (Department of Roads and Public Works in this instance) remains ultimately responsible for ensuring that the activity is implemented according to the requirements of the EMP. Although the developer appoints specific role players to perform functions on his/her behalf, this responsibility is delegated. The developer is responsible for ensuring that sufficient resources (time, financial, human, equipment, etc.) are available to the other role players (e.g. the ECO, ELO and contractor) to efficiently perform their tasks in terms of the EMP. The developer is liable for restoring the environment in the event of negligence leading to damage to the environment. The developer shall ensure that the EMP is included in the tender documentation so that the contractor who is appointed is bound to the conditions of the EMP. The developer shall appoint an independent Environmental Control Officer (ECO) during the planning phase to oversee all the environmental aspects relating to the development.

14.1.2 Consulting Engineer

The Consulting Engineer, is bound to the EMP conditions through his/her contract with the developer, and is responsible for ensuring that she/he adheres to all the conditions of the EMP. The Consulting Engineer shall thoroughly familiarise him/herself with the EMP requirements before coming onto site and shall request clarification on any aspect of these documents, should they be unclear. The Consulting Engineer shall ensure that he/she has provided sufficient budget for complying with all EMP conditions at the tender stage. The Consulting Engineer shall comply with all orders (whether verbal or written) given by the ECO, Project Manager or DMR in terms of the EMP.

14.1.3 Contractor

The Contractor, as the developer's agent on site, is bound to the EMP conditions through his/her contract with the developer, and is responsible for ensuring that she/he adheres to all the conditions of the EMP. The Contractor shall thoroughly familiarise him/herself with the EMP requirements before coming onto site and shall request clarification on any aspect of these documents, should they be unclear. The Contractor shall ensure that he/she has provided sufficient budget for complying with all EMP conditions at the tender stage. The Contractor shall comply with all orders (whether verbal or written) given by the ECO, Project Manager, Consulting Engineer or DMR in terms of the EMP.

The Department of Mineral Resources have reserved their rights to initiate criminal proceedings against the Consulting Engineer, contractor and/or any sub-contractors.

14.1.4 Environmental Control Officer (ECO)

The Environmental Control Officer (ECO) is appointed by the developer as an independent monitor of the implementation of the EMP. He/she shall form part of the project team and shall be involved in all aspects of project planning that can influence environmental conditions on the site. The ECO shall attend relevant project meetings, conduct inspections to assess compliance with the EMP and be responsible for providing feedback on potential environmental problems associated with the development. In addition, the ECO is responsible for:

- Liaison with relevant authorities;
- Liaison with contractors regarding environmental management; and
- Undertaking routine monitoring and appointing a competent person/institution to be responsible for specialist monitoring, if necessary
- Has the authority to halt any activity or process related directly or indirectly to the project, which in the view of the ECO may have undue or significant impact the environment
- The ECO has the right to enter the site and undertake monitoring, auditing and assessment at any time.

The ECO shall be responsible for liaising with the DMR.

Monitoring of Compliance with the EMP

The ECO shall conduct internal monthly environmental audit reports for the applicant/developer and will supply quarterly audit reports to the authorities. These audit reports shall contain information on the contractor and developer's levels of compliance with the EMP. The audit report shall also include a

description of the general state of the site, with specific reference to sensitive areas and any matters of non-compliance. The ECO is to suggest corrective action measures to eliminate the occurrence of the non-compliance incidents. In order to keep a record of any non-compliance, an Environmental Incident Record shall be kept.

An Environmental Control Officer (ECO) should be appointed prior to any mining activities commencing in order to ensure compliance with this Environmental Management Plan.

14.1.5 Environmental Liaison Officer (ELO)

The contractor shall appoint an Environmental Liaison Officer (ELO) to assist with day-to-day monitoring of the construction activities. Any issues raised by the ECO shall be routed to the ELO for the contractors' attention. The ELO shall be *permanently* on site during the construction phase to ensure daily environmental compliance with the EMP and shall be ideally be a senior member of the contractor's management team. The ECO shall be responsible for ensuring that all staff members are adequately trained and aware of the EMP. The ELO shall be responsible for undertaking weekly environmental inspections (according to the criteria specified in the EMP), and accompany the ECO during site visits, audits or assessments.

The ECO shall be notified of this appointment and furnished with the contact details of the ELO.

14.2 General Requirements

14.2.1 Mining Plans

- A copy of the mining plan shall be available at the mining site for scrutiny when required.
- A final layout plan must be submitted at closure of the mine or when operations have ceased.

14.2.2 Demarcating the mining area

- The mining area must be clearly demarcated by means of beacons at its corners and by fencing off the mining area.
- Permanent beacons as indicated on the mining plans must be firmly erected and maintained in their correct position throughout the life of the operation.
- Mining operations shall only take place within this demarcated area.
- Mining is to take place according to the proposed mine development plans. Mined out areas are to be used as spoil site thereby facilitating rehabilitation.

14.3 Infrastructural Requirements

14.3.1 Topsoil Management

- Stripping of topsoil shall be undertaken in such a manner as to minimise erosion by wind or runoff.
- Topsoil shall be stripped to a depth not exceeding 300 mm from the original ground level unless otherwise specified by the Project Manager in consultation with ECO.
- Areas from which the topsoil is to be removed shall be cleared of any foreign material which may come to form part of the topsoil during removal including bricks, rubble, any waste material, litter, excess vegetation and any other material which could reduce the quality of the topsoil.
- The Contractor shall ensure that subsoil and topsoil are not mixed during stripping, excavation, reinstatement and rehabilitation. If mixed with sub-soil the usefulness of the topsoil for rehabilitation of the site shall be lost.
- The topsoil stockpiles shall be clearly demarcated with appropriate signage.
- Topsoil should under no circumstances be used to create diversion berms or for general erosion control measures.
- Soils should be exposed for the minimum time possible once cleared.
- Topsoil shall be temporarily stockpiled, separately from subsoil and rocky materials.
- Topsoil shall be stockpiled in the Top Soil designated storage areas.
- Soil shall not be stockpiled near drainage lines, watercourses or on steep slopes.
- The topsoil removed, shall be stored in a bund wall on the high ground side of the mining area outside the 1:50 flood level within the boundaries of the mining area/ prospecting.
- Topsoil shall not be used for building or maintenance of access roads.
- The topsoil stored in the bund wall shall be adequately protected from being blown away or being eroded.
- Stockpiles shall either be vegetated with indigenous grasses or covered by a suitable fabric to prevent erosion and invasion of weeds.
- Stockpiled topsoil shall not be compacted.
- Topsoil shall be used for rehabilitation of disturbed areas only.

14.3.1.1 Topsoil stripping

- Prior to the stripping of topsoil, as much as possible of the aboveground grass layer shall be removed and stockpiled. This is to be placed on top of the topsoil once the topsoil has been replaced and shall be stored separately from the topsoil. The purpose of using this vegetation material is that it contains grass seed and would therefore assist with re-establishment of the indigenous grasses that naturally occur in the area. Aside from this, the grass covering of the soil

would also assist in preventing erosion prior to the re-establishment of a dense vegetation covering. Should insufficient grass covering be available to cover the soil, grass cuttings must be obtained from areas of natural grassland in the immediate vicinity of the particular area, with the consent of the affected landowner, or hydroseeding must be conducted.

- Topsoil shall be stripped from all areas that are to be utilised during the mining period and where permanent structures and access' is required. Topsoil shall be stripped after clearing of vegetation and before excavation commences.
- While topsoil is being stripped, it should be scanned for the presence of bulbous plants. Should bulbous plants be detected, they shall be removed from the topsoil and an ecologist shall be contacted to provide advice on suitable habitats and methods for replanting.
- The topsoil is regarded as the top 300mm of the soil profile, unless there is a clearer shallower boundary between the topsoil and subsoil indicated by texture, colour or structure.
- No topsoil which has been stripped shall be buried or in any other way be rendered unsuitable for further use by mixing with spoil or by compaction using machinery.
- Topsoil shall preferably be stripped when it is in a dry condition in order to prevent compaction.

14.3.1.2 Soil stockpiling

- Stripped topsoil shall be stockpiled in areas, which have been approved by the ECO.
- Topsoil stripped from different soil zones shall be stockpiled separately and clearly identified as such.
- Soil stockpiles shall not be higher than 2.5m or stored for a period longer than one month. The slopes of soil stockpiles shall not be steeper than 1 vertical to 5 horizontal.
- No vehicles shall be allowed access onto the stockpiles after they have been placed. Topsoil stockpiles shall be clearly demarcated in order to prevent vehicle access and for later identification when required.
- Soil stockpiles shall not be allowed to become contaminated with oil, diesel, petrol, litter or any other material that may later inhibit the growth of vegetation in the soil.
- After topsoil removal has been completed, the Contractor shall apply soil conservation measures to the stockpiles where and as directed by the Environmental Control Officer. This may include the use of erosion control fabric or grass seeding.

14.3.2 Access to the Borrow Pit Sites

14.3.2.1 Establishment of Access Roads

- The access road to the mining areas and the camp-site/site office must be via existing access roads/ jeep tracks.
-

- Should a portion of the access road be upgraded or newly constructed the following must be adhered to:
 - The route shall be selected that a minimum number of bushes or trees are felled and existing fence lines shall be followed as far as possible.
 - Water courses and steep gradients shall be avoided as far as is practicable.
 - Adequate drainage and erosion protection in the form of cut-off berms or trenches shall be provided where necessary.
- No other routes will be used by vehicles or personnel for the purpose of gaining access to the site.

14.3.2.2 Maintenance of Access Roads

- The maintenance of access roads will be the responsibility of the holder of the mining permit.
- Newly upgraded access roads shall be adequately maintained so as to minimize dust, soil erosion or undue surface damage (i.e. adequate storm water control).

14.3.2.3 Dust control on the access and haul roads

- The liberation of dust into the surrounding environment shall be effectively controlled by the use of, inter alia, water spraying and/or other dust-allaying agents.
- The speed of haul trucks and other vehicles must be strictly controlled to avoid dangerous conditions, excessive dust generation or excessive deterioration of the road being used.
- A freeboard of 0.5m shall be maintained by haul trucks. The load should also be covered during travel in order to avoid loss of material and dust generation.

14.3.2.4 Rehabilitation of access roads

- Whenever a mining permit is suspended, cancelled or abandoned or if it lapses and the holder does not wish to renew the permit or right, any access road or portions thereof, constructed by the holder and which will no longer be required by the landowner/tenant, shall be removed and/or rehabilitated in order to represent the former habitat.
- Any gate or fence erected by the holder which is not required by the landowner/tenant, shall be removed and the situation restored to the pre mining situation.
- Roads shall be ripped or ploughed, and if necessary, appropriately fertilized to ensure the regrowth of vegetation. Imported road construction materials which may hamper regrowth of vegetation must be removed and disposed of in an approved manner prior to rehabilitation.
- If a reasonable assessment indicates that the re-establishment of vegetation is unacceptably slow, the ECO may require that the soil be analyzed and any deleterious effects on the soil arising

from the mining operation be corrected and the area be seeded with a seed mix to the ECO specification.

14.3.3 Office/Camp Sites

14.3.3.1 Establishing Office/Camp Sites

- Should any office/ camp sites be established, these are to be established within the boundaries of the mining area.
- No camp or office site shall be located closer than 100 meters from a stream, river, spring, dam or pan.
- The area chosen for these purposes shall be the minimum reasonably required in order to remove as little vegetation as possible.
- Topsoil shall be handled as described in this EMP. This topsoil is to be used for rehabilitation of the area once the office/camp sites have been removed.
- Only gas cooking facilities shall be allowed for purposes of making food. No open fires shall be allowed.
- Lighting and noise disturbance or any other form of disturbance that may have an effect on the public living in the vicinity shall be kept to a minimum by avoiding work after hours.

14.3.3.2 Toilet facilities, waste water and refuse disposal

- The contractor shall provide suitable ablution facilities for employees and proper hygiene measures shall be established.
- Chemical toilet facilities are to be used and sited on the camp site at least 100 meters away from any river/stream/watercourse. The construction of “long drop” toilets is forbidden. Under no circumstances may open areas or the surrounding bush be used as a toilet facility. A minimum of 1 toilet per 20 persons must be provided. Chemical Toilets should be emptied on a regular basis and the contents disposed of at a licensed sewage treatment works.
- All temporary / portable toilets shall be secured to the ground to prevent them toppling due to wind or any other cause. The Contractor shall ensure that no spillage occurs when the toilets are cleaned, or emptied, and that the contents are properly stored and removed from Site. Discharge of waste from toilets into the environment, and burial of waste, is strictly prohibited.
- All effluent water from the camp washing facility shall be disposed of in a properly constructed French drain, situated as far as possible, but not less than 200 meters, from any stream, river, pan, dam or borehole.
- Only domestic type wash water shall be allowed to enter this drain and any effluents containing oil, grease or other industrial substances must be collected in a suitable receptacle and removed

from the site for appropriate disposal at a licensed disposal facility. Records of safe disposal shall be kept on site and presented to the ECO.

- Spills should be cleaned up immediately to the satisfaction of the ECO by removing the spillage together with the polluted soil and by disposing of them at a licensed waste disposal facility.
- Non-biodegradable refuse such as glass bottles, plastic bags, metal scrap, etc., shall be stored in a container at a collecting point and collected on a regular basis and disposed of at a licensed waste disposal facility.
- All other waste shall also be removed from site on a regular basis and disposed of at a licensed waste disposal facility.
- Waste containers shall be provided with lids or netting to prevent waste from being disturbed by scavengers or being blown away by wind.
- Specific precautions shall be taken to prevent refuse from being dumped on or in the vicinity of the camp site. This could include environmental awareness training and the provision of a suitable number of refuse bins.
- No burning of refuse is to take place on site.
- Materials shall be appropriately secured to ensure safe passage between destinations. Loads including, but not limited to sand, fine vegetation, refuse and paper shall have appropriate cover to prevent them spilling from the vehicle during transit. The Contractor shall be responsible for any clean-up resulting from the failure of his employees, or suppliers, to properly secure transported materials.

14.3.3.3 Rehabilitation of the office/camp site

- When the mining permit lapses, is cancelled or is abandoned or when any prospecting or mining operation comes to an end, the holder of any such right or permit may not demolish or remove any building, structure, object -
 - which may not be demolished in terms of any other law;
 - which has been identified in writing by the Minister; or
 - which is to be retained in terms of an agreement between the holder and the owner or occupier of the land, which agreement has been approved by the Minister in writing.
- Where office/camp sites have been rendered devoid of vegetation/grass or where soils have been compacted owing to traffic, the surface shall be scarified or ripped.
- Areas containing French drains shall be compacted and covered with a final layer of topsoil to a height of 10cm above the surrounding ground surface in order to allow for the settling of the soil.
- The site shall be seeded with an indigenous grass seed mix.

- If a reasonable assessment indicates that the re-establishment of vegetation is unacceptably slow, the ECO may require that the soil be analyzed and any deleterious effects on the soil arising from the mining operation be corrected and the area be seeded with a seed mix to the ECO specification.
- Photographs of the camp and office sites, before, during and after the mining operations shall be taken by the ECO and/or ELO at selected fixed points and kept on record.

14.3.4 Maintenance Yard & Storage Areas

14.3.4.1 Establishing the vehicle maintenance yard and secured storage areas

- Should a vehicle maintenance yard be required, this vehicle maintenance yard and secured storage areas shall not be located closer than 100 meters from any stream, river, spring, dam or pan, and shall be within the boundaries of the mining area.
 - The areas chosen for these purposes shall be the minimum reasonably required and involve the least disturbance to vegetation.
 - Topsoil shall be removed from these areas and handled as described in this EMP.
 - The vehicle maintenance yard and secured storage areas shall be constructed of impermeable material and bunded.
 - Runoff from vehicle maintenance yards and secured storage areas shall be contained on site in a suitable receptacle and removed for appropriate disposal at a licensed waste disposal facility. The receptacle shall be emptied when 75% full. Records of safe disposal shall be kept on site and presented to the ECO.
 - Store all materials defined as hazardous within a bunded and secure area (>50L).
 - The floor and bund walls should be impervious to the material stored and should be capable of containing 110% of the total volume of hazardous substance stored.
 - Fuel or lubricant tanks shall be secured and provided with collision protection.
 - Valves shall be locked when not in use, and shall be protected from vandalism and unauthorized use.
 - Valves shall be within the confines of the bunded/impervious areas.
 - Small quantities of hazardous substances (50L or less) shall be stored in appropriate containers within a secure storage area.
 - Base of the storage area shall be impervious and so designed as to ensure that the hazardous substances do not infiltrate into the soil.
 - Used fuels, oils, hydraulic fluids, paints and solvents and grease shall be stored in drums or other suitable containers. Care shall be taken to avoid ingress of rain water into containers.
 - Once the containers are full then they shall be labeled, sealed and removed from the site to a licensed waste disposal site.
-

- The relevant Material Safety Data Sheets (MSDS) shall be available on Site. Procedures detailed in the MSDSs shall be followed in the event of an emergency situation.
- Provide collection systems (i.e. trays or impervious linings) under machinery or equipment that may dispense hazardous substances (i.e. generators and pumps).

14.3.4.2 Maintenance of vehicles and equipment

- The maintenance of vehicles and equipment used for any purpose shall take place only in the maintenance yard areas provided.
- The maintenance yard areas shall be fully contained and impervious.
- Runoff from the maintenance yard areas shall be collected and contained on site in a suitable receptacle and removed for appropriate disposal at a licensed waste disposal facility. The receptacle shall be emptied when 75% full. Records of safe disposal shall be kept on site and presented to the ECO.
- Equipment used in the mining/ process must be adequately maintained so that during operations it does not spill oil, diesel, fuel, or hydraulic fluid.
- Machinery or equipment used on the mining area must not constitute a pollution hazard. The ECO shall order such equipment to be repaired or withdrawn from use if he or she considers the equipment or machinery to be polluting and irreparable.
- The washing of equipment and vehicles shall be restricted to urgent or preventative maintenance requirements only. All washing shall be undertaken in a wash bay area which must be equipped with a suitable impermeable floor and sump / oil trap.

14.3.4.3 Waste disposal

- Suitable waste disposal containers shall be made available at all times and conveniently placed for the disposal of waste.
- Collected waste shall be separated into the different categories of hazardous, general waste and construction rubble.
- Separate waste containers for the different waste categories shall be provided and located in the maintenance areas.
- Containers shall be easily distinguishable (i.e. different colors etc)
- Waste containers shall be provided with lids or netting to prevent waste from being disturbed by scavengers or being blown away by wind.
- Waste shall be removed from site on a regular basis.

- All used oils, grease or hydraulic fluids shall be placed therein and these receptacles will be removed from the site on a regular basis for disposal at a registered or licensed waste disposal facility. Records of safe disposal shall be kept on site and presented to the ECO.
- All spills should be cleaned up immediately to the satisfaction of the ECO by removing the spillage together with the polluted soil and by disposing of them at a licensed waste disposal facility

14.3.4.4 Rehabilitation of vehicle maintenance yard and secured storages areas.

- On completion of mining operations, the above areas shall be cleared of any contaminated soil, which must be disposed of at a licensed waste disposal facility. Records of safe disposal shall be kept on site and presented to the ECO.
- All buildings, structures or objects on the vehicle maintenance yard and secured storage areas shall be dealt with in accordance with section 44 of the Mineral and Petroleum Resources Development Act, 2002.
- The surface shall be ripped or ploughed to a depth of at least 300mm and topsoil previously removed from these areas shall be spread evenly to its original depth over the whole area.
- The area shall then be fertilized if necessary in order to assist re-establishment of the vegetation and then be seeded with an indigenous grass seed mix.

14.4 Operational Procedures

14.4.1 Limitations on mining

- Mining shall be limited to the areas indicated on the mining plans for each individual borrow pit.
- The contractor shall ensure that operations take place only in the demarcated areas.
- New mining excavations will not be conducted within 32 m of a drainage line.
- Security must be put in place to prevent unauthorised access to the site.
- The entire mining area is to be fenced.
- Appropriate warning signage is to be erected around the mining area.

14.4.2 Water Use License

- If any surface or groundwater abstraction is needed then applications for a water use license must be made in terms of the National Water Act, (Act 36 of 1998)
- Approval(s) must be granted by the Department of Water Affairs prior to any abstraction taking place.
- Conditions contained in the approval(s) must be strictly adhered to.
- The appropriate license forms for each kind of expected water use should be completed together with supporting documentation.

14.4.3 Excavations

Whenever any excavation is undertaken the following operating procedures shall be adhered to:

- Topsoil shall, in all cases be handled as described in this EMP.
- Excavations shall take place only within the approved demarcated mining area as indicated in the mining plans.
- Overburden rocks and coarse material shall be placed concurrently in the excavations or stored adjacent to the excavation, if practicable, to be used as backfill material once mining operations have ceased.
- Trenches shall be backfilled as soon as possible.
- Areas of expected increased surface runoff along the down-slope borders of the excavation areas (i.e. areas natural runoff may be concentrated) shall be suitable stabilized using gabions and/or rock material. These areas shall be maintained until the borrow pits have been fully rehabilitated.
- Where blasting may be required, the appropriate measures and blasting permits in terms of Explosives Act and Occupation Health and Safety Act (Regulations) must be undertaken.

14.4.4 Rehabilitation of excavation areas

The following operating procedures shall be adhered to during the rehabilitation of excavation areas:

- The excavated area must serve as a final depositing rocks and coarse material not used in the road construction.
 - Waste material (general waste, litter, etc) shall not be deposited in the excavations.
 - Once excavations have been refilled and profiled with acceptable contours and erosion control measures, the topsoil previously removed shall be returned to form a layer no less than 50mm. If insufficient topsoil is available, then it must be imported from elsewhere if such material is available.
 - The area shall be fertilized if necessary to allow vegetation to establish rapidly. The site shall be seeded with an indigenous grass seed mix in order to propagate the locally or regionally occurring vegetation.
 - Near vertical slopes (1:1 to 1:2) must be stabilized using natural rock wall structures constructed using conventional building methods or in forms with slurry forced between the structures. All structures must have a 'natural' look and facilities for plants to grow in.
 - All areas where the slopes are 1:3 to 1:6 must be logged or otherwise stepped (using stabilization cylinders or similar) in order to prevent soil erosion. Logs/ cylinders must be laid in continuous lines following the contours and spaced vertically 0.8-1.2 m apart, depending on the steepness of the slope. These logs/ cylinders must be secured by means of steel pegs and wire in rocky areas, and treated wooden pegs in other areas.
-

- The post-mining area must be fenced off in order to prevent access by livestock until such time that the vegetation has been allowed to establish sufficiently.
- The site must remain fenced with warning signs erected to caution the general public of the altered state of the environment in the area. Drainage structures must also be left intact.
- No dangerous faces which present a safety threat to communities should be left.

14.5 Vegetation Removal and Habitat Disturbance

- Natural features, indigenous flora and fauna within the vicinity of the project works, should be protected and damage or disturbance prevented or minimised, specifically:
 - No plant species outside of the designated mine site and associated areas may be removed.
 - No mining staff may have access to indigenous vegetation outside of the Site.
 - The use of indigenous plants as firewood is prohibited.
 - All fauna (including domestic livestock) within, and surrounding the site, shall be protected. They shall not be caught, poisoned, trapped, snared or killed.
 - The minimum amount of vegetation must be removed. Excessive clearing of a site must be avoided. Disturbance outside of the immediate construction area must be avoided.
 - Species of special concern (*Disa woodii*) must either be left alone or they must be rescued and relocated to outside the mining footprint prior to mining activities commencing.
 - Replanting of indigenous species in disturbed areas will be required, under the guidance of the Environmental Controller.
 - No more than 0.98 ha of indigenous vegetation may be removed at each of the borrow pits.
- Planning and construction must ensure that alien plants are not introduced to the disturbed areas. This can be accomplished by:
 - Utilising the saved topsoil from the construction area and regular monitoring during the revegetation phase and immediately after the revegetation phase.
 - Preventing continuous disturbances of the rehabilitated areas.
 - Alien invader species must be removed from the site and destroyed as per the DWAF Working for Water specifications for that species.
 - Any regrowth must be controlled in the same manner.
 - Soil should not be moved from one part of the site to another unnecessarily.

14.6 Surface Waters/Drainage Lines

- Site staff shall not be permitted to use the stream/drainage lines/water bodies for the purpose of bathing, washing of clothing or as a water resource.
- The stream/drainage/inland water bodies lines shall not be used for mining activities such as washing of equipment or the disposal of any type of waste.
- Water may not be abstracted from the stream for any reason or use, unless authorised by the Department of Water Affairs.
- All fuel, chemical, oil storage areas shall be confined to areas at least 100 meters away from any watercourse and/or drainage line and is to be secured and appropriately stored on bund areas and in storage areas.
- Appropriate structures and methods to confine spillages such as the construction of berms and pans shall be used in order to prevent contamination of the rivers and streams.
- Release of chemicals directly into the environment is strictly prohibited.
- Waste should be managed and removed from site on a regular basis and the use of degreasing agents should be strictly prohibited.
- Illegal dumping of construction material within the Drainage Environment is strictly prohibited.
- No new mining excavations are to be allowed within 32 m of the drainage lines.

14.7 Stormwater Management

The general principle behind stormwater management is to divert runoff away from the mining area in such a manner as to prevent any erosion from resulting and to contain the “dirty” runoff within the mining area before releasing it into the environment.

“Dirty” water runoff refers to stormwater runoff which has collected within the disturbed areas and accumulated a high sediment load as a result of the exposed soils and underlying weathered rock. Other than a high sediment load, there is unlikely to be any other form of contamination of the runoff.

- No rock, silt, petroleum product, timber, vegetation, domestic waste, or any deleterious substance shall be placed or allowed to disperse directly into the drainage lines.
- Halt construction activity on exposed soil during events of high rainfall intensity and runoff.
- Minimise vegetation cover removal on all the cleared areas - i.e. only clear those areas where mining and stockpiling is currently taking place.

- A cutoff-berm must be located above the borrow pit face, protecting the active mining area and topsoil and overburden stockpiles from erosion. This storm water will then be channelled towards the natural drainage in the area.
- Soil erosion shall not be tolerated on the Site. Uncontrolled erosion will cause siltation and pollution of the downstream areas and result in loss of valuable topsoil. The Contractor should take all reasonable measures to prevent soil erosion and protect areas susceptible to erosion. Erosion prevention measures must be implemented to the satisfaction of the ECO and DMR.
- Areas particularly susceptible to erosion include:
 - areas stripped of topsoil,
 - soil stockpiles, and
 - steep slopes (gradients>8%).
- Where erosion does occur, the Contractor shall reinstate such areas to the satisfaction of the DMR through the construction of contour berms, cut-off drains, or planting of grass sods / ground cover, as may be necessary. Topsoil that has been washed away shall be replaced.
- The berms will remain in place after closure in order to allow for the protection of the downstream environment from sedimentation and erosion which may arise during the rehabilitation period prior to the establishment of adequate grass cover.

14.8 Air Emissions

- Minimise areas of exposed soil by only clearing those areas where mining or stockpiling is activity taking place and by revegetating mining and stockpiling areas progressively where possible.
- Fine material must be kept to a minimum by practicing good housekeeping. All fines should be removed to the spoils area and covered with overburden and vegetated accordingly.
- Employ dust suppression measures on dry dusty surfaces. This may involve the spraying of water from water carts.
- Ensure fine materials being stored or transported are covered with tarps or equivalent material.
- Ensure that the district road accessing the site is maintained in a good condition with a suitable gravel surface. Heavy trucks may lead to the pulverizing of the gravel and increase the amount of dust produced.
- Operators exposed to high levels of dust (including cement dust) must be equipped with dust masks. This is a health and safety requirement and must be managed via the mine's Health and Safety Plan.
- Ensure all equipment is in good operating order, and fitted with standard air emission control devices.
- Wet methods must be enforced when rock breaking, drilling and loading take place.

- Minimise idling of engines at all times.

14.9 Noise Management

- No nighttime activities are to take place.
- All activities with high noise levels should be restricted to daylight hours on weekdays. Working hours are Monday to Friday 6 am - 6.00 pm and Saturdays 7am - 2pm. No mining activities may occur on Sundays or Public Holidays.
- All operators exposed to noise in excess of 85dB will be equipped with hearing protection devices.
- The Contractor shall take the necessary measures to limit noise levels on site to within legally acceptable limits. The regulations framed under the Machinery and Occupational Safety Act, 1983 (Act No. 6 of 1983) apply.
- All vehicles to be kept in a serviceable condition and fitted with silencers.
- Any warning hooters be so designed that they are only effective in the area of concern.
- Where possible physical barriers are to be placed between noise sources and the community.

14.10 Visual Quality

- Protect and maintain the vegetation not required to be removed as a natural screen.
- Ensure that any signage (i.e. at entrance gate of construction camp site) is visible but not visually intrusive.
- Ensure good housekeeping and control litter and general site cleanliness. The construction camp should be so sited so as to limit its visual impact.
- Ensure that adequate ablution facilities are in place, that the workforce utilises these facilities and that they are placed where they are not visible to the public.
- Workforce shall be dressed in appropriate neat and safe construction uniforms.
- Bright colours shall only be used for the safety issues for which they are intended.
- Safety lighting should only be used for the safety issues for which they are intended.
- Only emergency after-hours work should be done.
- Rehabilitation of Borrow pits after utilisation must be undertaken to decrease visual impact

14.11 Health and Safety (safety of all contractors, employees and the general public)

- The Contractor shall have a first aid box and a trained First Aider (as required by the OHS Act) available on site at all time.
- Potable (human drinking quality) drinking water shall be provided to all construction crews at all times.

- The Contractors (and all sub-contractors) shall provide all their employees (permanent, contracted or casual) with:
 - Overall that have a reflective strip across the back, and around both legs
 - Steel capped safety boots
 - Hard hats
 - These are to be worn on the site at all times
- The Project Manager shall ensure that there are White Hard hats and reflective vests (yellow with reflective strip) available for use by any visitors, other project consultants and authorities.
- The contractor shall ensure that all construction vehicles using public roads are in a roadworthy condition, they adhere to speed limits, their loads are secured and that all other regulations are adhered to.
- The mining area must be placed out of bounds to members of the public and other unauthorised persons.
- Security must be put in place to prevent unauthorised access to the site.
- The entire mining area is to be fenced.
- Appropriate warning signage is to be erected around the mining and processing area.
- The contractor will be required to develop a Health and Safety Plan identifying all potential health and safety hazardous and providing a plan and programme for the management and monitoring of these risks.

14.12 Emergency Procedures & Remediation

- Emergency procedures must be developed for the following incidents:
 - Fire
 - Spillage of Hazardous Materials (fuel, chemicals, sewage etc)
- It is the Contractor's responsibility to develop the emergency action plans. These must be checked and approved by the ECO and by DMR.

14.13 Fire Risk & Burning

- The Contractor shall take all the necessary precautions to ensure that fires are not started on site.
- The Contractor shall develop a Fire Management Procedure and present it to the ECO for review.
- The Contractor shall ensure that the risk of fire at any location on site is kept to a minimum.
- The Contractor shall ensure that all construction staff are aware of these procedures.
- The Contractor shall supply fire fighting equipment in proportion to the fire risk presented by the type of activity and materials used on site.
- This equipment shall be kept in good working order.

- No open fires shall be allowed on site or on the route. Gas cylinder shall be provided for daily cooking. A designated facility must be established to serve as a kitchen/food preparation area.
- Any welding or other sources of heating shall be done in a controlled environment and under appropriate supervision, in such a manner as to minimise the risk of veld fires and/or injury to staff.
- Occupational Health & Safety Act requirement relating to fire precautions and fire control shall be implemented.
- All waste bins shall be kept away from fuel tank installations.
- Smoking near refuelling depots or near any flammable substances shall be prohibited.

14.14 Accidental leaks & spillages

- An Emergency Action Plan and Procedure for the prevention and remediation of spillages of hazardous substances shall be developed by the Contractor. This must include clear roles & responsibilities.
- The Contractor shall ensure that his employees are aware of the procedure to be followed for dealing with spills and leaks, which shall include the immediate notification of the Project Manager, ECO and the relevant authorities.
- The Contractor shall ensure that the necessary materials and equipment for dealing with spills and leaks is available on site at all times.
- Potentially hazardous materials shall be handled and stored on site in containers with tight lids that shall be sealed and disposed of at an appropriately permitted hazardous waste disposal site.
- The Contractor shall maintain a hazardous materials register which must document the use, storage, final destination and method of disposal of all hazardous substances.
- The contractor shall submit copies of Material Safety Data Sheets (in accordance with the requirements of the OHS Act - i.e. sixteen point MSDS format) to the ECO. Copies shall also be kept on site.
- Treatment and remediation of the spill areas shall be undertaken to the reasonable satisfaction of the DMR.
- In the event of a hydrocarbon spill, the source of the spillage shall be isolated and contained (i.e. be protected from rainfall and surface runoff). The Contractor shall ensure that there is always a supply of absorbent material readily available to absorb / breakdown spilt hydrocarbon material and where possible, materials designed to encapsulate minor hydrocarbon spillage. This is particularly relevant in the fuel storage and dispensing area.
- The quantity of such materials shall be able to handle a minimum of 200liters of hydrocarbon liquid spill.

- The telephone numbers for the closest Hazardous Materials Emergency Response offices should be prominently displayed as bitumen and diesel spillage frequently occur on mining sites. A swift cleanup procedure is critical in order to prevent contamination.

14.15 Archaeology, Palaeontology & Heritage Sites

- All recommendations as stated in the Specialist Studies (section 11.2 & section 21.2) and in the SAHRA A&PRC under Appendix D must be adhered to.
- All finds of human remains shall be reported to the nearest police station.
- Human remains from the graves of victims of conflict, or any burial ground or part thereof which contains such graves and any other graves that are deemed to be of cultural significance may not be destroyed, damaged, altered, exhumed or removed from their original positions without a permit from the South African Heritage and Resource Agency (SAHRA)
- Work in areas where artifacts are found shall cease immediately and SAHRA notified.
- Under no circumstances shall the Contractor, employees, subcontractors or subcontractors' employees remove, destroy or interfere with archaeological artifacts.
- Any person who causes intentional damage to archaeological or historical sites and/or artifacts could be penalized or legally prosecuted in terms of the national Heritage Resources Act 25 of 1999.
- A fence of at least 3m outside the extremities of the site shall be erected to protect archaeological sites.
- All known and identified archaeological sites shall be left untouched.
- In terms of the National Heritage Resources Act (Act 25 of 1999), in the event that any object or material of archaeological or palaeontological importance is noted during the construction & operational process, work in the immediate area should be immediately stopped and SAHRA notified without delay. Should any such sites be identified (e.g. remnants of stone-made structures, indigenous ceramics, bones, stone artefacts, ostrich eggshell fragments, marine shell and charcoal/ash concentrations), unmarked human burials or other categories of heritage resources are found during the proposed activities, SAHRA APM Unit (Mariagrazia Galimberti, Tel: 021 462 4502) must be alerted immediately, and an accredited professional archaeologist must be contacted as soon as possible to inspect the findings.

14.16 Socio-economic

- A targeted procurement policy to be implemented at the mine whereby goods and services should be sourced locally if possible.
- Labour where feasible should be drawn from the affected community.

14.17 Community Relations

- The Contractor shall keep a “Complaints Register” on Site. The Register shall contain all contact details of the person who made the complaint, information regarding the complaint itself, and measures taken to address the complaint.

14.18 Work Stoppage

The DMR shall have the right to order work to be stopped in the event of significant infringements of the Environmental Specifications. Work will only be allowed to restart once the situation is rectified in compliance with the specifications.

14.19 Site Closure/Decommissioning

The Applicant, the Department of Roads and Public Works, shall be responsible for the complete rehabilitation of the sites, access roads, site camp / office, stockpile area, ablution facilities and storage areas.

- All site infrastructure, equipment, plant, and other items used during the mining period will be removed from the site in accordance with section 44 of the Mineral and Petroleum Resources Development Act, 2002 and those areas will be ripped and then covered with a 50mm thick layer of topsoil. Those areas will then be hydroseeded with a mix of grasses indigenous to the area.
- All waste shall be removed from site. It will not be permitted to be buried or burned on the site.
- All access roads or portions thereof, constructed by the holder and which will no longer be required by the landowner/tenant, shall be removed/ripped and/or rehabilitated in order to represent the former habitat.
- Foreign materials, which may hamper the re-growth of the vegetation, must be removed prior to rehabilitation and disposed of at a licensed waste disposal site.
- All cleared sites are rehabilitated with indigenous grass species.
- The mine must conform to the designed closure specifications, including drainage, slope stability, topsoiling and tree / grass planting.
- Drainage structures must be left intact.

- Areas showing signs of erosion due to mining activities shall be suitably stabilized or rehabilitated.
- All ablution facilities shall be removed from site.
- The mine area will be fenced with a stockproof fence to prevent access by livestock until such time that the vegetation has been allowed to recover. No dangerous faces which present a safety threat to communities will be left.
- All signs relating to the mining activities shall be removed.
- All areas, devoid of vegetation or where solids have been compacted due to traffic, shall be scarified or ripped before rehabilitation to allow penetration of roots and water.
- Remaining boulders and spoil will be pushed up against the slopes of the mine face. That rock material will be covered with overburden (decomposed rock) and a 50cm thick layer of topsoil and then seeded.
- Slopes must be made safe; slopes must at least be sloped to a ratio of 1:3.
- Final rehabilitation shall be completed within a period specified by DMR and should take cognizance of the season.

15 Quantum of Financial Provision for Rehabilitation

The Quantum of Financial Provision shall be calculated using DME's Guideline Document for the Evaluation of the Quantum of Closure-Related Financial Provision Provided by a Mine (2005).

In terms of this guideline the borrow pits classify as Class C Mines (low risk) of low to moderate sensitivity.

Table B.11: Rates (per hectare) to determine the quantum for financial provision (Class C mines)

	Environmental sensitivity of mine area		
	Low	Medium	High
Rate per hectare to determine the quantum (rands)	20 000.00	50 000.00	80 000.00
Minimum amount	R 10 000.00		

16 Environmental Awareness

The ECO shall be responsible for compiling and implementing an Environmental Awareness Training Programme for all staff members that aims at explaining the mitigation measures described in this report. Before commencing with any work, all staff members shall attend the Environmental Awareness Training Programme. After attending the Environmental Awareness Training Programme, all contractors and sub-contractors shall sign an Environmental Training register as proof of their training.

17 Monitoring & Performance of the EMP

In order to ensure that this Environmental Management Plan is effectively implemented, it is important that regular external audits of the Environmental Management Plan are conducted.

The Department of Roads and Public Works must appoint an independent Environmental Control Officer (ECO) in order to oversee compliance with the EMP by undertaking monthly site inspections, quarterly audits and post construction/operation site visits. The audits shall aim at addressing environmental issues identified on site and to provide recommendations through the audit reports.

Audit Reports shall be provided to Department of Roads and Public Works, the Project Managers/Engineers, and the Department of Mineral Resources (DMR).

18 Environmental Objectives and Goals

18.1 Mine Closure

The overall Environmental Objective for mine closure is as follows:

To render the mining area in a safe and environmentally acceptable condition on completion of the mining, rehabilitation and closure activities.

Specific Environmental Goals include:

- To return the mining area, as closely as possible, to its original condition and land use through the shaping and landscaping of the surface and through the establishment of an indigenous grass cover emulating the surrounding environment.

- To minimize the residual impacts through ensuring that erosion is controlled, the slopes are stable, the vegetation cover is established satisfactory and that the area is left in a condition which does not pose a safety hazard to humans, livestock and indigenous fauna.
- To minimize the visual impacts of the mine on closure by way of landscaping and the establishment of an indigenous grass cover emulating the surrounding environment
- To obtain the necessary Mine Closure Certificates from the Department of Mineral Resources.

18.2 Socio-Economic Aspects

The specific objective related to the Socio-Economic aspects is as follows:

To contribute significantly and meaningfully towards the economic and social development of the surrounding communities within the OR Tambo District Municipality.

Specific goals include:

- To maximize the benefits to the local economy through the provision of employment opportunities and support of local service providers and suppliers wherever possible.
- To institute a training programme for all staff members in order to improve skills development in the area.
- To improve the safety aspects of the road for road users and pedestrians.
- To encourage further economic development through exploring partnerships with local individuals and groups in the establishment of further beneficiation businesses.

18.3 Archaeological, Palaeontological & Heritage Aspects

The specific objective related to the Archaeological, Palaeontological & Heritage Aspects is as follows:

“To identify, protect and preserve any sites of cultural, religious, palaeontological or archaeological significance”

Specific goals include:

- To ensure that any identified sites are properly protected in accordance to the National Heritage Resources Act.
- To ensure that any further sites that may be discovered are identified timeously and protected in accordance to the National Heritage Resources Act.

19 Public Participation

The public participation process for the utilisation of the borrow pits identified on DR08147 was held in conjunction with the public participation process for all the other identified road sections in the area and their relevant identified borrow pits.

19.1 Advertisement

- Public participation was initiated by the placement of a Legal Notice (English and Xhosa) in the local/regional daily newspaper, The Daily Dispatch on 04 November, 2011 (Appendix B). The general public were given 30 days (from 04 November, 2011) to register as Interested & Affected Parties and to submit any issues / concerns they might have regarding this proposed project.
- 2 x Signboards, in English and Xhosa, were erected at strategic intersections for the identified borrow pits along the DR08147 & DR08024, in order to notify the general public/community and passers-by of the proposed activity (Appendix C). The date of advertisement on the Signboard was 04 November, 2011.

19.2 Key Interested and Affected Parties

- A Letter of Notification and the Background information documents were posted via parcel mail to the legal custodian of the land, Department of Rural Development and Land Reform - OR Tambo District Manager Mr Matabese, in which the proposed borrow pits are located informing him of the proposed activity on 04 November, 2011.
- Notice of the activity and a background information document was posted via parcel mail to Mr Mluleki Fihlani, the Municipal Manager for Ingquza Hill Local Municipality on 04 November, 2011.
- Notice of the activity and a background information document was posted via parcel mail to Mr Ncube, the Municipal Manager for the OR Tambo District Municipality on 04 November, 2011.
- Background Information Documents were posted via registered mail to the Ingquza Hill Local Municipality for Cllr Daliwe, the Ingquza Hill Local Municipality Ward Councillor for ward number 23 (the ward in which the proposed borrow pits are located), on 04 November, 2011.
- Identified Key Interested and Affected Parties (Table 9) were either posted via parcel mail or registered mail, notification of the proposed activity and the Background Information Document for this project on 04 November, 2011.
- All email and/or hard copy correspondence received from and issued to key I & AP's is retained in Appendix D.

Table 9: Identified Key Interested & Affected Parties.

OR Tambo – DR08147: Borrow Pits - Key I & AP's							
Name		Tel/Fax		Mobile/Email	Postal	Comments	
1	Ms Deidre Watkins	Tel:	041 396 3900	Mbl:		Department of Minerals Resources Private Bag X6076 Port Elizabeth 6000	Deputy Director : Mine Environment Management
		Fax:	041 396 3945	Eml:	Deidre.Watkins@dmr.gov.za		
2	Jimmy Calder, Phillip Wilkinson	Tel:	043 748 6246	Mbl:	082 900 0840	P O Box 2909, Beacon Bay 5205	WESSA
		Fax:		Eml:	Jimmy [jimjan@iafrica.com], phillip@wessabk.co.za		
3	Dr. Mariagrazia Galimberti	Tel:	(0)21 462 4502	Mbl:		South African Heritage Resources Agency, PO Box 4637, Cape Town 8000	APM Impact Assessor
		Fax:	(0)21 462 4509	Eml:	mgalimberti@sahra.org.za		
4	Ms Lizna Fourie	Tel:	437 010 291	Mbl:		Department of Water Affairs and Forestry PO BOX 7019, EL, 5200	Department of Water Affairs - Eastern Cape
		Fax:	043 722 6152	Eml:	FourieL4@dwa.gov.za		
5	SFISO KHOZA	Tel:	(047) 5016400	Mbl:		OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	Director:Engineering
		Fax:		Eml:			
6	Ms P.A.X Dunywa	Tel:	047 501 6409	Mbl:		OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	Director: Planning & Development
		Fax:		Eml:	andiswad@ortambodm.org.za		
7	Ms Mandisa Matiso	Tel:	047 501 6420	Mbl:		OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	Director: Technical Services
		Fax:	047 532 2834	Eml:	mandisam@ortambodm.org.za		
8	Mr Ncube	Tel:	047 501 7000	Mbl:		OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	OR Tambo: Municipal Manager
		Fax:		Eml:			
9	Mr Nick Matebese	Tel:	(047) 532-5959	Mbl:		40 Blake way street,MTHATHA, 5100; Private Bag X 5213, MTHATHA, 5100	Department of Rural Development & Land Reform: OR Tambo District Manager
		Fax:	(047) 532-5968	Eml:	NMatebese@ruraldevelopment.gov.za		
10	Mr Q. Paliso	Tel:	[047] 531 1191	Mbl:		Old Radio Transkei Building, Cnr Victoria & York Roads, Mthatha Private Bag X5029 Mthatha, 5100	DEDEA - OR Tambo Region
		Fax:	[047] 531 2887	Eml:			
11	Mr Mluleki Fihlani	Tel:	(039) 252 0131	Mbl:		Ingquza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	Municipal Manager - Ingquza Hill Local Municipality
		Fax:	(039) 252 0699	Eml:			
12	Cllr Daliwe	Tel:		Mbl:	0836236921	Ingquza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	Ingquza Hill Local Municipality- Ward 23 Councillor
		Fax:		Eml:			

19.3 Registered Interested and Affected Parties

All Registered Interested and Affected Parties which registered in response to the letters of notification or the advertisements/signage are presented in Table 10. All email and/or hard copy correspondence received from and issued to the Registered Interested & Affected Parties is retained in Appendix D.

Table 10: Registered Interested and Affected Parties.

Registered I & AP's – DR08147						
Name		Tel/Fax		Mobile/Email	Postal	Comments
1	George Mtshontana	Tel	Mbl	0833623660/ 0724276442	PO Box 270, Lombasi A/a, Lusikisiki, 4820	1. Register as an I & AP. 2. Lives in Lombasi Location In telephonic discussion: 3. Roads need to be repaired in the area.
		Fax	Eml			

19.4 Public Draft Environmental Management Plan Report

The public draft Environmental Management Plan Report was made available to key and registered (if any) I&AP's for a 30-day commenting period, this period commenced from date of mailing/ hand delivery, 16 January 2012, and ended on 16 February 2012. All hard copy correspondence issued to I & AP's during the public draft review period is retained in Appendix D.



Table 11: Summary of comments made during the public participation.

I & AP Name	Concerns/Issues/Comments	EAP Response
George Mtshontana	<ul style="list-style-type: none"> Register as an I & AP. In telephonic discussion: <ul style="list-style-type: none"> Is interested as roads in the area are in need of repair. 	<ul style="list-style-type: none"> Registered as an I&AP Comment noted.
SAHRA: Dr Galimberti – Part 2 – All identified borrow pits	<ul style="list-style-type: none"> If the recommendations made in this review comment are adhered to then the SAHRA Archaeological, Palaeontological & Meteorite Unit has no objections to the development. If any new evidence of archaeological sites or artefacts, palaeontological fossils, graves or other heritage resources are found during development then SAHRA and a professional archaeologist or palaeontologist must be alerted immediately. 	<ul style="list-style-type: none"> Recommendations are incorporated as part of this EMP and thus must be adhered to. All Comments have been noted.

20 Mining Plans

Electronic Adobe PDF Version Only

DOUBLE CLICK the PAPER CLIPS here to access the Mining Plans.

147_BP01: Mining plan	
147_BP02: Mining plan	

Hardcopy/Paper Version - See overleaf


This Page Intentionally Left Blank

21 Specialist Report

21.1 Materials Investigation

Electronic Adobe PDF Version Only

DOUBLE CLICK the PAPER CLIPS here to access the reports.

DR08147 - BP01 & BP02	
-----------------------	---





Hardcopy/Paper Version - See overleaf

This Page Intentionally Left Blank

21.2 Archaeological & Palaeontological Assessments

Electronic Adobe PDF Version Only

DOUBLE CLICK the PAPER CLIPS here to access the reports.

AIA-OR Tambo BP2, EC - Archaeomaps	
PIA - OR Tambo Borrow pits - Metsi Metseng Geological & Environmental Services	




Hardcopy/Paper Version - See overleaf

This Page Intentionally Left Blank

22 Appendix A: Letters of Confirmation, Retention Monies & Undertaking

Electronic Adobe PDF Version Only

DOUBLE CLICK the PAPER CLIPS here to access

Letter of Confirmation - EC Department of Roads and Public Works	
Letter for Retention Monies - EC Department of Roads and Public Works	
Letter of Undertaking - EC Department of Roads and Public Works	

Hardcopy/Paper Version - See overleaf

This Page Intentionally Left Blank

23 Appendix B: Advertisement placed in Daily Dispatch

Daily Dispatch, Friday, November 4, 2011

Legal Notices

Legal Notices

Legal Notices

NOTICE/ ISAZISO

Notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of intent to carry out the following activity/Esi sizo sikhutshwa phantsi kwe-saziso somgqoko ka ne Minerals okunge ne Petroleum Resources Development Act (No. 28 of 2002) nezihlonelo zazo zokwenza oku kuandeleneyo:

Activity/Umsebenzi ozakwenziwa: The Department of Roads & Public Works proposes to utilize borrow pits for road upgrade/graveling projects located throughout the Citi Tambo & Alfred Nzo District Municipalities / bebe lizandela ne zamasebenzi kasebenzi- eorine loala uburiko nentsebenziswani yokufakwa umfudo. Iqanda ukwenziwa lingo lizamisebenzi yezandela zomke ne Citi Tambo & ne Alfred Nzo District Municipalities.

List of Roads/Umfutlo ka indlela:

Road #	Area	Number of borrow pits
DR12033	ELLECTDALE	6
DR06024	LUSHKISIKI	4
DR06029	PORT ST JOHNS	6
DR08120	CROSS MISSION/BIZANA	4
DR08123	BIZANA	2
DR08131	GUMBU	2
DR08147	LUSHKISIKI	2
DR08153	LUSHKISIKI	2
DR08156	LUSHKISIKI	1
DR08157	LUSHKISIKI	1
DR08173	LIBODE	2
DR08273	CLARKEBURY	5
DR08275	CLARKEBURY	2
DR08281	VEDDESVILLE	2
Mvelomane Access Road-CRTDM-IR01	LUSHKISIKI	1
Xhaxha Access Road-ORTDM-IR02	LUSHKISIKI	2
Jongisizwe Access Road-ORTDM-IR03	LIBODE	1
ORTDM-IR04	MOUNT AYLIFF	4
Njanyama Access Road - ANDM-IR01	CEDARVILLE	5

Proponent/Abantkazi zomke:
 Department of Roads & Public Works (Eastern Cape)
 Private Bag X0023
 Bhebe
 5000

Consultant/Umrhki macebiso:
 BESC
 PO Box 8241, Nahoon, 5210, East London.
 Mr. Conroy van der Plaats/Ms. Lee-Anne Proudfoot
 Tel: (043) 726 4242
 Fax: (043) 726 3199
 E-mail: conroy@besc.co.za/lee-anna@besc.co.za

In order to ensure that you are identified as an interested and affected party, please submit your name, contact information, and interest in the project, to the Consultant within 30 days of this advertisement/ Ukuba unqwenela ukubandakanywa njengomnye umandla napha-phezulekayo, nceda faka igama lakho, nankukhul'isa apho unokuthagamshelaka khona, nento ekutsolayo bekuchaphazelayo kokuphila, uyiqhise kumrhki- Macebiso zingadlulanga IR05000 ng mshumi mathathu (30 days) ekhangelwano esi saziso.

Date of advertisement: November 04, 2011

Figure 13: Daily Dispatch Notice.

24 Appendix C: Signboard

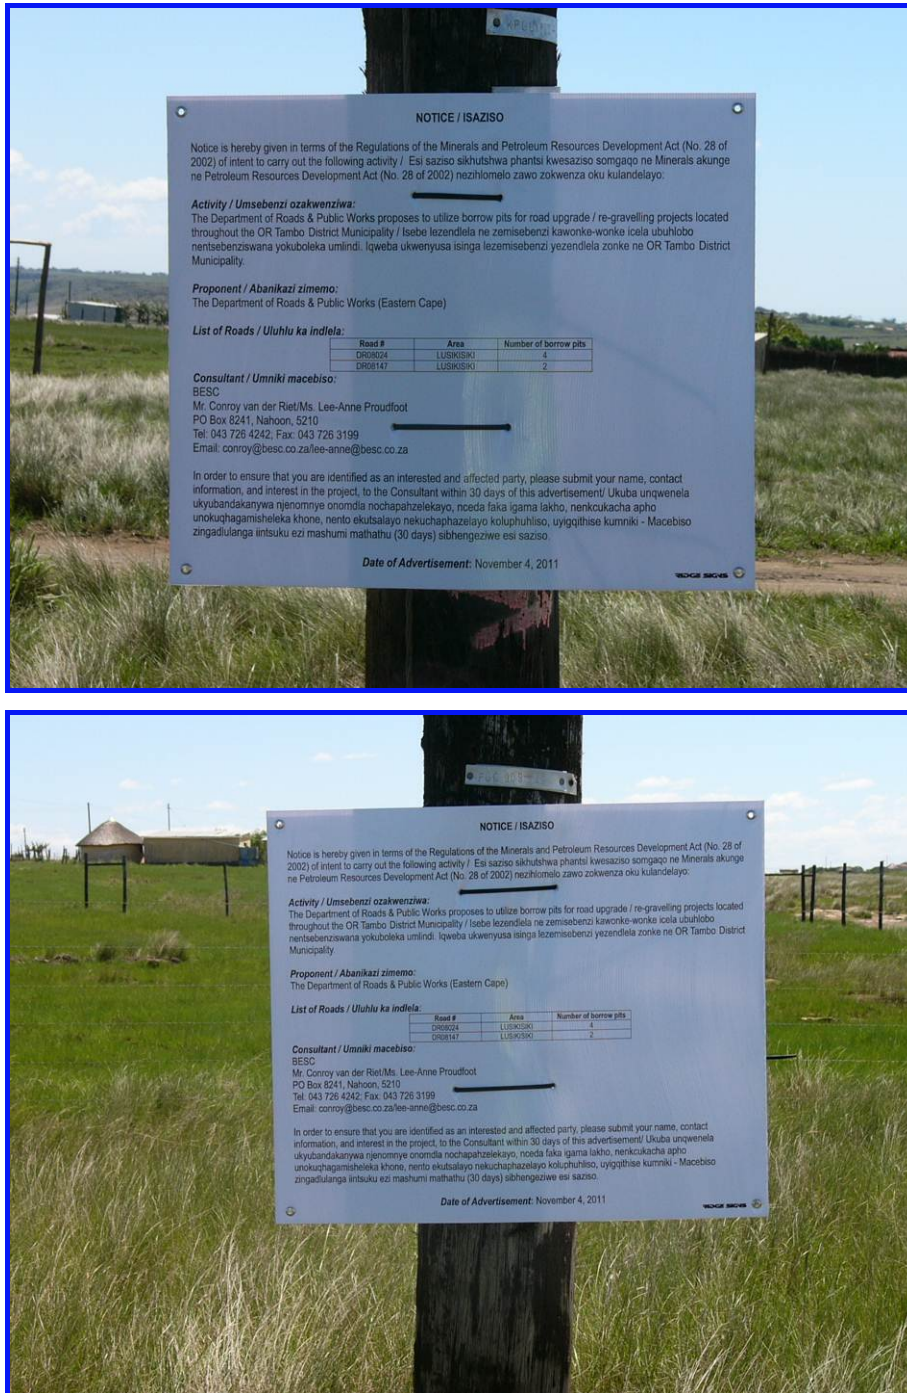



Figure 14: Image of the Signboards erected for DR08147

25 Appendix D: Public Participation - Correspondence

25.1 Correspondence issued to and received from Key I & AP's during the Public Participation



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

October 3, 2011

Ms. Deirdre Watkins
Department of Mineral Resources
Corner of Mount & Diaz Roads
Mount Croix
Port Elizabeth
6001

Dear Ms Watkins,

RE: The proposed utilisation of borrow pits for the resurfacing/regravelling/maintenance of district roads located in the OR Tambo District Municipality, Eastern Cape.

As per our correspondence dated June 28, 2011, the outstanding borrow pits that were still to be identified along fourteen of the road sections which forms part of the twenty-nine road sections identified for resurfacing/maintenance projects, have now been identified. Please see the attached table for the position of the identified borrow pits on these outstanding road sections where the borrow pits have now been identified.

As in our previous correspondence it is our intended approach to prepare an environmental management plan per district road identified in the attached table which will cover the identified borrow pits along these sections of roads. As confirmed telephonically, the Department of Roads and Public Works has received exemption from the provisions of sections 16, 20, 22 and 27 of the M&PRDA, 2002, in respect of any activity to remove any mineral for the construction and maintenance of dams, harbours, roads and railway lines and as such the utilisation of the material sources is subject to the preparation, submission and approval of an Environmental Management Plan compiled in accordance with requirements of the M&PRDA. It is the Department of Roads and Public Works preference to proceed in this manner, i.e. separate application/environmental management plan for the borrow pits identified per district road, as there is a considerable distance between the identified district roads and to circumvent any possible delays which may arise during the process and which would then result in the delay of the entire project.

Malcolm Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23

Page 1 of 4



OR TAMBO DISTRICT MUNICIPALITY					START co-ordinates		END co-ordinates	
No.	Road Number	Kilometers	LMA	Comments / Priority	E	S	E	S
1	DR08120	53.09	Bosona	1	29° 50' 27"	30° 52' 0"	29° 49' 53"	31° 0' 30"
2	DR08053	51.02	KSD	2	28° 55' 40"	31° 30' 4"	28° 52' 24"	31° 28' 30"
3	DR08042	18.88	KSD	2	28° 0' 0"	31° 30' 23"	28° 0' 0"	31° 28' 23"
4	DR08075	20.1	KSD	4	28° 17' 53"	31° 48' 5"	28° 16' 5"	31° 47' 0"
5	DR08076	58.28	KSD	4	28° 10' 35"	31° 53' 0"	28° 14' 52"	31° 47' 32"
6	DR08081	17.5	KSD	1	28° 40' 17"	31° 44' 24"	28° 38' 58"	31° 45' 12"
7	DR08090	11.54	KSD	2	28° 41' 36"	31° 52' 31"	28° 40' 52"	31° 49' 0"
8	DR08095	45.72	KSD	2	28° 54' 40"	31° 30' 4"	28° 54' 40"	31° 14' 40"
9	DR08029	01.06	Libode	2	29° 4' 13"	31° 55' 23"	29° 2' 43"	31° 57' 39"
10	DR08157	29.42	Libode	4	29° 22' 20"	31° 48' 4"	29° 22' 27"	31° 26' 36"
11	DR08111	11.33	Wolfsburg	1	28° 42' 44"	31° 5' 28"	28° 42' 2"	30° 59' 48"
12	DR08018	61.03	Nyandeni	2	29° 19' 56"	31° 0' 5"	29° 18' 5"	30° 58' 6"
13	DR08043	45.20	Nyandeni	1	28° 52' 54"	31° 26' 45"	28° 52' 54"	31° 52' 54"
14	DR08175	15.3	Nyandeni / PSJ	3	28° 54' 17"	31° 25' 4"	28° 53' 27"	31° 22' 14"
15	DR08176	24.26	Nyandeni / PSJ	3	28° 54' 40"	31° 26' 6"	28° 54' 40"	31° 26' 36"
16	DR08181	44.64	Nyandeni / PSJ	2	29° 10' 53"	31° 36' 24"	29° 13' 54"	31° 33' 24"
17	DR08008	33.52	Nyandeni / PSJ	1	29° 10' 57"	31° 40' 39"	29° 12' 41"	31° 33' 5"
18	DR08009	4.8	Nyandeni / PSJ	1	29° 15' 25"	31° 40' 0"	29° 15' 0"	31° 40' 32"
19	DR11000	11.13	Nyandeni / PSJ	8	28° 2' 12"	31° 40' 11"	28° 11' 11"	31° 40' 11"
20	DR08151	23.74	PSJ	1	29° 52' 12"	31° 27' 18"	29° 41' 0"	31° 51' 26"
21	DR08152	47.76	PSJ	1	29° 2' 0"	31° 26' 11"	29° 14' 32"	31° 22' 0"
22	DR08156	14.74	PSJ	1	29° 2' 25"	31° 18' 48"	29° 18' 30"	31° 20' 14"
23	DR08153	22.22	PSJ	1	29° 15' 14"	31° 24' 51"	29° 29' 55"	31° 25' 12"
24	DR08026	44.62	Quthobeni	1	29° 52' 35"	31° 22' 31"	29° 57' 55"	31° 18' 37"
25	DR08025	34.06	Quthobeni	1	29° 34' 0"	31° 21' 31"	29° 30' 30"	31° 2' 20"
26	DR11023	43.02	Quthobeni	2	29° 40' 27"	31° 18' 4"	29° 57' 40"	31° 18' 36"
27	DR08113	21.48	Quthobeni	1	29° 48' 40"	30° 54' 44"	29° 41' 38"	31° 0' 32"
28	DR08124	12.16	Quthobeni	1	29° 22' 52"	30° 57' 48"	29° 36' 20"	31° 0' 30"
29	DR08147	14.84	Quthobeni	2	29° 22' 52"	30° 57' 48"	29° 36' 20"	31° 0' 30"

As the SAMRAD Online System is currently experiencing problems, and we are unable to access this information, please could you assist me in determining if any of these identified borrow pits have already been previously permitted. We have highlighted on the attached excel spreadsheet borrow pits that were identified previously as being permitted.

In addition, as per our previous approach for the other thirteen road sections and borrow pits already identified in the OR Tambo Region, we would like to continue with the following approach we have already initiated for public participation in respect of the previous 13 road sections:

- Legal Notice in the respective newspaper.
- As the number of borrow pits are high, to place signboards at each particular borrow pit seems impractical, therefore we propose to group road sections and place signboards at main intersections/entrances of roads to be regravelled.
- Notifying the Relevant Municipal and Government Departments
- Notifying the Department of Rural Development as the custodian of the rural land
- Notifying the Municipal Ward Councilors
- Where applicable notify Relevant Landowners of Private Land

Please would you confirm if this would suffice, as has previously been indicated by yourselves.

Your assistance in the above regard will be much appreciated. Please feel free to contact me directly for any further queries.

Yours Sincerely
 Lee-Anne Proudfoot
 (Pr.Sci.Nat – Environmental Scientist)
 Senior Environmental Consultant
 Mobile: +27 83 421 3991
 Email: lee-anne@besc.co.za

Rd_Nr_	No_	Longitude (l)	Latitude (l)	Area	Municipality	Ward
DR18033	18033_BP01	28°36'15.6" E	31°51'50.3" S	Elliottdale	KSD LM	19
DR18033	18033_BP02	28°39'48.2" E	31°58'39.2" S	Elliottdale	Mbashe LM	13
DR18033	18033_BP08	28°52'24.2" E	32°11'56.1" S	Elliottdale	Mbashe LM	20
DR18033	18033_BP01N	28°47'50.1" E	32°03'14.7" S	Elliottdale	Mbashe LM	15
DR18033	18033_BP02N	28°39'53.8" E	31°58'46.6" S	Elliottdale	KSD LM	21
DR18033	18033_BP03N	28°52'23.9" E	32°11'43.0" S	Elliottdale	Mbashe LM	20
DR08024	024_BP01	29°44'45.2" E	31°20'30.7" S	Lusikisiki	Inguza Hill LM	24
DR08024	024_BP01N	29°45'27.9" E	31°20'21.9" S	Lusikisiki	Inguza Hill LM	23
DR08024	024_BP02N	29°47'12.3" E	31°19'29.9" S	Lusikisiki	Inguza Hill LM	23
DR08024	024_BP02N	29°45'16.4" E	31°20'01.5" S	Lusikisiki	Inguza Hill LM	24
DR08029	029_BP01	29°22'55.2" E	31°41'06.7" S	Port St Johns	Port St Johns LM	3
DR08029	029_BP01N	29°16'19.9" E	31°43'22.0" S	Port St Johns	Port St Johns LM	1
DR08029	029_BP02N	29°18'11.2" E	31°45'10.1" S	Port St Johns	Port St Johns LM	1
DR08029	029_BP03N	29°18'13.8" E	31°45'18.3" S	Port St Johns	Port St Johns LM	1
DR08029	029_BP04N	29°21'39.1" E	31°44'02.8" S	Port St Johns	Port St Johns LM	2
DR08029	029_BP05N	29°21'54.1" E	31°42'59.6" S	Port St Johns	Port St Johns LM	2
DR08120	120_BP01	29°45'24.6" E	31°03'16.7" S	Bizana	Moizana LM	15
DR08120	120_BP02	29°43'43.1" E	31°10'12.9" S	Bizana	Inguza Hill LM	28
DR08120	120_BP01N	29°49'33.9" E	30°54'28.1" S	Bizana	Moizana LM	13
DR08120	120_BP02N	29°49'34.7" E	30°54'10.5" S	Bizana	Moizana LM	13
DR08123	123_BP01	29°40'23.4" E	30°58'38.3" S	Bizana	Moizana LM	11
DR08123	123_BP01N	29°40'12.2" E	30°58'32.8" S	Bizana	Moizana LM	10
DR08131	131_BP01	28°44'06.3" E	30°59'41.9" S	Qumbu	Mhlontlo LM	21
DR08131	131_BP01N	28°45'25.6" E	30°58'24.3" S	Qumbu	Mhlontlo LM	19
DR08153	153_BP02	29°20'13.6" E	31°17'16.9" S	Lusikisiki	Inguza Hill LM	2
DR08153	153_BP01N	29°30'7.5" E	31°20'21.8" S	Lusikisiki	Inguza Hill LM	17
DR08156	156_BP02	29°23'06.4" E	31°19'24.1" S	Lusikisiki	Inguza Hill LM	2
DR08156	156_BP01N	29°23'8.8" E	31°19'22.5" S	Lusikisiki	Inguza Hill LM	2
DR08157	157_BP01	29°22'53.9" E	31°25'08.7" S	Holy Cross Mission	Port St Johns LM	17
DR08173	173_BP01	28°58'51.4" E	31°24'27.2" S	Libode	Nyandeni LM	3
DR08173	173_BP02	28°59'04.9" E	31°22'51.7" S	Libode	Nyandeni LM	3
DR08273	273_BP02	28°17'58.6" E	31°48'20.6" S	Clarkebury	Engoobo LM	16
DR08273	273_BP01N	28°26'23.4" E	31°46'39.1" S	Clarkebury	KSD LM	18
DR08273	273_BP02N	28°24'20.8" E	31°48'07.6" S	Clarkebury	KSD LM	18
DR08273	273_BP03N	28°17'38.6" E	31°48'20.0" S	Clarkebury	Engoobo LM	16
DR08273	273_BP04N	28°16'16.2" E	31°47'06.7" S	Clarkebury	Engoobo LM	16
DR08275	275_BP02	28°25'50.2" E	31°47'55.6" S	Clarkebury	KSD LM	18
DR08275	275_BP01N	28°27'14.1" E	31°53'2.2" S	Clarkebury	KSD LM	20
DR08281	281_BP01	28°39'08.6" E	31°44'05.3" S	Payne	KSD LM	32
DR08281	281_BP02	28°31'08.4" E	31°44'18.9" S	Payne	KSD LM	31

Page 3 of 4

						
DR08147	147_BP01	29°46'01.9" E	31°20'23.6" S	Lusikisiki	Inguza Hill LM	23
DR08147	147_BP02	29°47'40.5" E	31°20'56.7" S	Lusikisiki	Inguza Hill LM	23

Lee-Anne Proudfoot

From: Lee-Anne Proudfoot <lee-anne@besc.co.za>
Sent: 03 October 2011 09:36 AM
To: Deidre Watkins (Deidre.Watkins@dmr.gov.za)
Cc: 'Siyanda Lurwenga'
Subject: FW: Proposed utilisation of borrow pits - OR Tambo Region
Attachments: DMR-10_2011.pdf; Second Phase - OR Tambo - DMR.xls

Dear Deidre,

Please find attached correspondence regarding the preparation of Environmental Management Plans for the utilisation of the outstanding road sections and borrow pits located in the OR Tambo District which have now been identified – the applicant is the Department of Roads and Public Works. Previous correspondence regarding the above has been forwarded to the Department.

Dear Siyanda

As the SAMRAD Online System is experiencing problems and we are unable to access this information, please could you assist me again in determining if any of these identified borrow pits have already been previously permitted, please see the attached excel spread sheet. I have also included on the excel spread sheet the borrow pits that you identified previously as being permitted – borrow pits you previously looked at on the system have been highlighted in green in order to prevent you from looking at the same borrow pit again, please could you look at the non-highlighted borrow pits as these are the newly identified borrow pits.

Should you have any queries, please do not hesitate to contact me.

Kind Regards

Lee-Anne
Ms Lee-Anne Proudfoot
Environmental Consultant
Biotechnology & Environmental Specialist Consultancy cc
PO Box 8241, Nahoon, 5210, East London, South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Mobile: +27 83 421 3991
Direct Email: lee-anne@besc.co.za
Office Tel: +27 43 726 4242
Office Fax: +27 43 726 3199
Office Email: info@besc.co.za
Web: <http://www.besc.co.za>

Lee-Anne Proudfoot

From: Deidre Watkins <Deidre.Watkins@dmr.gov.za>
Sent: 11 October 2011 10:20 AM
To: Lee-Anne Proudfoot
Subject: RE: Proposed utilisation of borrow pits - OR Tambo Region

Hi Lee-Anne,
Yes thanks, I received your email. I presume Siyanda is checking the coordinates.
Best regards,
Deidre



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

November 3, 2011

Ms. Deidre Watkins
Deputy Director: Mine Environment Management
Department of Minerals and Energy
C/o of Mount & Diaz Roads
Mount Croix
Port Elizabeth
6001
Tel: (041) 3963934
Fax: 086 576 8004

RE: Background Information Documents for the utilisation of borrow pits in the OR Tambo District Municipality & Alfred Nzo District Municipality, Eastern Cape.

As per previous correspondence, the Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo District Municipality & Alfred Nzo District Municipality. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

The permitting of the materials sources required for the project will be undertaken in accordance with the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002). As previously confirmed, since the proponent, Department of Roads and Public Works, has been exempted in terms of the provisions of the M & PRDA Environmental Management Plans will be compiled for submission and approval from the DMR for the utilisation of the identified borrow pits, per the 29 roads sections.

Accompanying this letter for your records is a CD containing the Background Information Document(s) (BID'(s)) for the road sections where all the borrow pits to be utilised have been identified, which are to be distributed during the public participation process. Please refer to the attached table for the borrow pits and road sections. As the other borrow pits on the remaining road sections become identified, these will be forwarded to the department.

Please feel free to contact BESC if you have any further queries.

Yours Sincerely
Lee-Anne Proudfoot
(Pr.Sci.Nat – Environmental Scientist)
Senior Environmental Consultant
Mobile: +27 83 421 3991

Page 1 of 3

Malcolm Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23



Email: lee-anne@besc.co.za

Mr. Conroy van der Riet

(Pr.Sci.Nat. - Environmental Scientist)

Senior Environmental Consultant

Mobile: 083 993 1243

Email: conroy@besc.co.za

Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm #/ Allotment Name
Mvimvana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'7.10"	INGQUZA HILL	13	FARM 115
Jongsizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29° 6'8.50"	NYANDENI	5	FARM RE/36
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Elliotdale
DR18033	18033_BP06	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/54
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/51
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/51
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49

Page 2 of 3

DR	BP	Lat	Long	Area	Count	Notes
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tina LOC 20
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INOGUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INOGUZA HILL	17	Farm 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INOGUZA HILL	2	RE/128
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INOGUZA HILL	2	
DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqokezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'56.6" S	28°25'50.2" E	KSD	18	Mqokezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'05.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqokezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INOGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INOGUZA HILL	23	RE/89
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP01	30°25'54.90"	29° 3'30.80"	MATATIELE	26	RE/196
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP02	30°32'0.86"	29° 4'3.37"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP03	30°34'28.50"	29° 3'20.80"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP04	30°33'39.60"	29° 2'14.20"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP05	30°33'16.06"	29° 1'26.59"	MATATIELE	21	RE/21



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

**Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems**

November 3, 2011

Attention: Mr. N. Matebese
Regional Manager – OR Tambo District
Department of Rural Development & Land Reform
Private Bag X 5213,
MTHATHA,
5100

Tel: (047) 532-5959
Fax: (047) 532-5968

RE: Notification of the compilation of Environmental Management Plans for the utilisation of borrow pits in the OR Tambo & Alfred Nzo District Municipalities, Eastern Cape.

As per previous correspondence, notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of the intent to carry out the following activity:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo District Municipality and in the Alfred Nzo District Municipality. The permitting of the materials sources required for the project will be undertaken in accordance with the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002). The Department of Roads & Public Works have been exempted from provisions in terms of Section 106(1) of the M&PRDA, and thus exploration of any materials sources would be subject to the preparation, submission and approval of an Environmental Management Plan compiled in accordance with Section 39(1) of the M&PRDA and Regulation 52 of the M&PRDA regulations. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

A number of these borrow pits are located on rural/communal land or state owned land. The purpose of this letter is to notify and inform you, the custodian/landowner of all rural / communal land and the identified state owned land of the proposed utilisation of these borrow pits.

You have been identified as a Key Interested & Affected Parties (I&AP's). Accompanying this letter is a CD containing the Background Information Document(s) (BID's) pertaining to the remaining thirteen of the road sections identified along which borrow pits are located. Please refer to attached table for the borrow pits and the road sections which pertain to the BID's on the accompanying CD.

Please feel free to contact BESC if you have any further queries.

Page 1 of 4

Malcolm Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23



Yours Sincerely
Lee-Anne Proudfoot
(Pr.Sci.Nat – Environmental Scientist)
Senior Environmental Consultant
Mobile: +27 83 421 3991
Email: lee-anne@besc.co.za

Mr. Conroy van der Riet
(Cand. Sci. Nat. - Environmental Scientist)
Senior Environmental Consultant
Mobile: 083 993 1243
Email: conroy@besc.co.za

Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm #/ Allotment Name
Mvimvana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'7.10"	INGQUZA HILL	13	FARM 115
Jongisizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29° 6'8.50"	NYANDENI	5	FARM RE/06
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Elliotdale
DR18033	18033_BP08	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/54
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/51
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/51
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tina LOC 20
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INGQUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INGQUZA HILL	17	Farm 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INGQUZA HILL	2	RE/128

DR	Borrow Pit	Bearing	Distance	Location	Area	Remarks
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INQGUZA HILL	2	
DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqekwezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'55.6" S	28°26'50.2" E	KSD	18	Mqekwezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'05.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqekwezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INQGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INQGUZA HILL	23	RE/89
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP01	30°25'54.90"	29° 3'30.80"	MATATIELE	26	RE/196
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP02	30°32'0.86"	29° 4'3.37"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP03	30°34'28.50"	29° 3'20.80"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP04	30°33'39.60"	29° 2'14.20"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP05	30°33'16.06"	29° 1'26.59"	MATATIELE	21	RE/21



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

**Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems**

November 3, 2011

Attention: Mr Q. Paliso
Regional Manager: DEDEA – OR Tambo Region
Old Radio Transkei Building,
Cnr Victoria & York Roads,
Private Bag X5029
Mthatha,
5100

RE: Notification of the compilation of Environmental Management Plans for the utilisation of borrow pits in the OR Tambo District Municipality, Eastern Cape.

As per previous correspondence, notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of the intent to carry out the following activity:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo District Municipality. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

Please note that in terms of the National Environmental Management Act, 1998 (Act No. 107 of 1998): Listing Notices 1, 2 & 3 (GN 544, GN 545 & GN546, 2010), no listed activities will be triggered by the above mentioned utilisation of the identified borrow pits.

You have been identified as a Key Interested & Affected Parties (I&AP's). Accompanying this letter is a CD containing the Background Information Document(s) (BID's) pertaining to remaining of the road sections identified along which borrow pits are located. Please refer to attached table for the borrow pits and the road sections which pertain to the BID's on the accompanying CD.

Please feel free to contact BESC if you have any further queries.

Yours Sincerely
Lee-Anne Proudfoot
(Pr.Sci.Nat – Environmental Scientist)
Senior Environmental Consultant
Mobile: +27 83 421 3991
Email: lee-anne@besc.co.za

Page 1 of 3

Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23



Mr. Conroy van der Riet
 (Pr.Sci.Nat - Environmental Scientist)
 Senior Environmental Consultant
 Mobile: 083 993 1243
 Email: conroy@besc.co.za

Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm #/ Allotment Name
Mvimvana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'10"	INGQUZA HILL	13	FARM 115
Jongisizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29°6'8.50"	NYANDENI	5	FARM RE/36
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Elliottdale
DR18033	18033_BP06	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/54
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/51
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/51
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tna LOC 20

Page 2 of 3

DR	BP	Lat	Long	Area	Dist	Loc
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INQGUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INQGUZA HILL	17	Fam 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INQGUZA HILL	2	RE/128
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INQGUZA HILL	2	
DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqekwezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'55.6" S	28°25'50.2" E	KSD	18	Mqekwezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'05.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqekwezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INQGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INQGUZA HILL	23	RE/89

From: lee-Anne Proudfoot [<mailto:lee-anne@besc.co.za>]
 Sent: 30 June 2011 12:30 PM
 To: 'MARIAGRAZIA GALIMBERTI'
 Subject: Proposed Utilisation of Borrow pits - OR Tambo District Municipality
 Importance: High

Dear Mariagrazia,

BESC have been appointed by the Department of Roads and Public Works to prepare the Environmental Management Plans (EMP) required for the utilisation of identified borrow pits in the OR Tambo District in the Eastern Cape, for the maintenance/regravelling/resurfacing/patch gravelling of identified district roads.

Twenty - nine District Roads requiring routine maintenance/resurfacing/regravelling/patch gravelling have been identified within the OR Tambo District. In total some 93 borrow pits are proposed to be utilised as material sources for the routine maintenance/resurfacing/regravelling/patch gravelling of the 29 identified district roads. These borrow pits are located adjacent to the identified road sections and are located throughout the OR Tambo District Municipality.

The OR Tambo District Municipality (the area in which the borrow pits are located) falls within the Umtata Geological Series Map – 3128 – and the geology is described as either being the Tarkastad Subgroup, Adelaide Subgroup or Eccla Group. We have commissioned Ms Karen van Ryneveld of ArchaeoMaps to undertake the Phase 1 AIA for these borrow pits. Please could you confirm whether or not SAHRA will require that a phase 1 Palaeontological Assessment also be undertaken?

When the background information documents are available for each road section identified these will be forwarded to you; however at this stage we would just like to gain confirmation on this matter prior. I attach for you reference a google image of the borrow pits that Ms Lee-Anne Proudfoot Senior Environmental Consultant (Pr. Sci. Nat. – Environmental Scientist) Biotechnology & Environmental Specialist Consultancy cc PO Box 8241, Nahoon, 5210, East London, South Africa 9 Douglas Road, Vincent, 5247, East London, South Africa Mobile: +27 83 421 3991

From: [MARIAGRAZIA GALIMBERTI](mailto:MARIAGRAZIA.GALIMBERTI@besc.co.za)
 To: lee-anne@besc.co.za
 Subject: Re: FW: Proposed Utilisation of Borrow pits - OR Tambo District Municipality
 Date: 04 July 2011 06:14:19 PM

Dear Lee- Anne,

apologies for the late reply, but I was at a conference in Swaziland and I didn't get access to my emails, unlike what I was expecting.

Considering the extent of the project and of the area impacted and the formations affected by the borrow pits, I would recommend that a Palaeontological Study is undertaken. I will send an official request once I received the BID.

Please let me know if you have any questions
 Kind regards

Mariagrazia

Mariagrazia Galimberti (PhD)
 APM Impact Assessor
 South African Heritage Resources Agency



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

November 3, 2011

Attention: SAHRA

RE: Notification of the compilation of Environmental Management Plans for the utilisation of borrow pits in the OR Tambo District Municipality, Eastern Cape.

Notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of the intent to carry out the following activity:

The Department of Roads & Public works proposes to utilize borrow pits for road upgrade/re-gravelling projects located throughout the OR Tambo District Municipality & Alfred Nzo District Municipality. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

You have been identified as a Key Interested & Affected Parties (I&AP's). Accompanying this letter is a CD containing the Background Information Document(s) (BID'(s)) pertaining to the road sections identified, along which the borrow pits are located.

Please note that a Phase 1 Archaeological and Heritage Assessment is currently being undertaken by Ms Karen van Ryneveld (Archaeomaps) and a Palaeontological Assessment is currently being undertaken by Metsi Metseng Geological & Environmental Services for the identified borrow pits.

Please feel free to contact BESC if you have any further queries.


Yours Sincerely
Lee-Anne Proudfoot
(*Pr.Sci.Nat – Environmental Scientist*)
Senior Environmental Consultant
Mobile: +27 83 421 3991
Email: lee-anne@besc.co.za

Mr. Conroy van der Riet
(*Pr.Sci.Nat - Environmental Scientist*)
Senior Environmental Consultant
Mobile: 083 993 1243
Email: conroy@besc.co.za

Page 1 of 3

Malcoime Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; *Pr.Sci.Nat.(Environ.Sci.)*
CK 95.10210/23



Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm #/ Allotment Name
Mvimvana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'7.10"	INGQUZA HILL	13	FARM 115
Jongisizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29° 6'8.50"	NYANDENI	5	FARM RE/36
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Eliotdale
DR18033	18033_BP08	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/54
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/51
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/51
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tina LOC 20
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INGQUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INGQUZA HILL	17	Farm 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INGQUZA HILL	2	RE/128

DR	Borrow Pit ID	Latitude	Longitude	Location	Area (ha)	Remarks
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INQGUZA HILL	2	
DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqokezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'55.6" S	28°25'50.2" E	KSD	18	Mqokezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'05.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqokezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INQGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INQGUZA HILL	23	RE/89
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP01	30°25'54.90"	29° 3'30.80"	MATATIELE	26	RE/196
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP02	30°32'0.86"	29° 4'3.37"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP03	30°34'28.50"	29° 3'20.80"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP04	30°33'39.60"	29° 2'14.20"	MATATIELE	21	RE/21
Niyenyame Access Road - ANDM-IR01	ANDM-IR01_BP05	30°33'16.06"	29° 1'26.59"	MATATIELE	21	RE/21

Lee-Anne Proudfoot

From: Karen van Ryneveld <kvanryneveld@gmail.com>
Sent: 27 November 2011 03:27 PM
To: Mariagrazia Galimberti; mlzote@ecphra.org.za; Lee-Anne Proudfoot
Subject: AIA - Part 2: Utilization of Borrow Pits - O.R. Tambo District Municipality, EC
Attachments: AIA-Part 2, O.R. Tambo BP1.pdf; Part 2 OR Tambo BP1.kmz

Hi Mariagrazia, Mzikayise and Lee-Anne,

Attached please find the Phase 1 AIA report for the proposed Part 2: Utilization of Borrow Pits, O.R. Tambo District Municipality, EC project (and the associated map). Hard copies of the report will be posted to the SAHRA APM Unit and BESC.

Regards,
 Karen

--
 Karen van Ryneveld
 ArchaeoMaps

Tel: 043 732 1270
 Fax to e-mail: 086 515 6848
 Cell: 084 871 1064

Lee-Anne Proudfoot

From: Lee-Anne Proudfoot <lee-anne@besc.co.za>
Sent: 28 November 2011 08:29 AM
To: 'MARIAGRAZIA GALIMBERTI'
Cc: 'mlzote@ecphra.org.za'
Subject: PIA - Part 2: Utilization of Borrow Pits - O.R. Tambo District Municipality, EC
Attachments: 1110 OR Tambo Phase 2 B_Pits PIA.pdf; APRC Borrow Pits OR Tambo Municip Van Ryneveld Rossouw EC nov2011.pdf

Dear Mariagrazia,

Please find attached for SAHRA's review and comment the Phase 1 PIA report for the proposed Part 2: Utilization of Borrow Pits, O.R. Tambo District Municipality. Karen van Ryneveld of ArchaeoMaps submitted the Archaeological report directly to you yesterday the 27th November 2011 – please see correspondence below. Please could you confirm that you have received both the Archaeological and Palaeontological Reports.

Please note that the following borrow pits in the Archaeological Assessment formed part of the Palaeontological Assessment under the Part 1 OR Tambo Assessment and thus were commented on for Palaeontology under the SAHRA review comment file ref. no: 9/2/050/0001 (Attached for your reference) and are not included under this Palaeontological Assessment:


- 18033_BP01
- 18033_BP02
- 18033_BP08
- 024_BP01
- 029_BP01
- 120_BP01
- 120_BP02
- 123_BP01
- 131_BP01
- 153_BP02
- 156_BP02
- 157_BP01
- 273_BP02
- 275_BP02

If you have any queries regarding the above please do not hesitate to contact me.

Kind Regards

Lee-Anne

Ms Lee-Anne Proudfoot
 Senior Environmental Consultant
 (Pr. Sci. Nat. – Environmental Scientist)

SAHRA AIA Review Comment FORM A	
 <p>SOUTH AFRICAN HERITAGE RESOURCES AGENCY 111 HARRINGTON STREET, CAPE TOWN, 8001 PO BOX 4637, CAPE TOWN, 8090 TEL: 021 462 4592 FAX: 021 462 4599</p>	<p>FOR ATTENTION: PHRA:</p>
	<p>FOR OFFICIAL USE ONLY: SAHRA File No: 9/2/502/0001 Date Received: 28 November 2011 (AIA) 10 January 2012 (PIA) Date of Comment: 11 January 2012..... Sent to Peer Review: Date to Peer Review: SAHRA Contact Person: Dr Mariagrazia Galimberti DMR Ref. no:</p>
<p>REVIEW COMMENT ON ARCHAEOLOGICAL AND PALAEOLOGICAL IMPACT ASSESSMENTS</p> <p>BY ARCHAEOLOGY, PALAEOLOGY AND METEORITES UNIT OF THE SOUTH AFRICAN HERITAGE RESOURCES AGENCY</p>	
<p><i>South Africa has a unique and non-renewable archaeological and palaeontological heritage. Archaeological and palaeontological sites are protected in terms of the National Heritage Resources Act (Act No 25 of 1999) and may not be disturbed without a permit. Archaeological Impact Assessments (AIAs) and Palaeontological Impact Assessments (PIAs) identify and assess the significance of the sites, assess the potential impact of developments upon such sites, and make recommendations concerning mitigation and management of these sites. On the basis of satisfactory specialist reports SAHRA or the relevant heritage resources agency can assess whether or not it has objection to a development and indicate the conditions upon which such development might proceed and assess whether or not to issue permission to destroy such sites. AIAs and PIAs often form part of the heritage component of an Environmental Impact Assessment or Environmental Management Plan. They may also form part of a Heritage Impact Assessment called for in terms of section 38 of the National Heritage Resources Act, Act No. 25, 1999. They may have other origins. In any event they should comply with basic minimum standards of reporting as indicated in SAHRA Regulations and Guidelines.</i></p> <p><i>This form provides review comment from the Archaeologist of the relevant heritage resources authority for use by Heritage Managers, for example, when informing authorities that have applied to SAHRA for comment and for inclusion in documentation sent to environmental authorities. It may be used in conjunction with Form B, which provides relevant peer review comment.</i></p>	
<p>A. PROVINCIAL HERITAGE RESOURCES AUTHORITY: Eastern Cape</p>	
<p>B. AUTHOR(S) OF REPORT: Karen van Ryneveld</p>	
<p>C. ARCHAEOLOGY CONTRACT GROUP: Archaeomaps Archaeological Consultancy</p>	
<p>D. CONTACT DETAILS: Postnet Suite 239, Private Bag X3, Beacon Bay, 5205, kvanryneveld@gmail.com</p>	
<p>E. DATE OF REPORT: 28 November 2011</p>	
<p>F. TITLE OF REPORT: Part 2: Utilization of borrow pits - O.R. Tambo District Municipality, Eastern Cape, South Africa</p>	
<p>B. AUTHOR(S) OF REPORT: Dr Gideon Groenewald</p>	
<p>C. ARCHAEOLOGY CONTRACT GROUP: Metsi Metseng Geological and Environmental Services</p>	
<p>D. CONTACT DETAILS: Suite 91, Private Bag X62, Betlehem, 9700.</p>	
<p>E. DATE OF REPORT: 26 October 2011</p>	
<p>F. TITLE OF REPORT: The Proposed Utilisation Of Borrow Pits On Roads: DR08024, DR08147, DR08153 & DR08156 - Qaukeni/Inqguza Hill Local Municipality, DR08029 - Port St Johns Local Municipality, DR08120 &</p>	
1	

SAHRA AIA Review Comment FORM A

DR08123 – Mibizana Local Municipality, Dr08131 – Mhlontlo Local Municipality, DR08173 – Nyandeni Local Municipality, DR08273, DR08275, DR08281 & DR18033 – King Sabata Dalindyeo Local Municipality, Oliver Tambo District Municipality, Eastern Cape Province South Africa

- G. Please circle as relevant: Archaeological and Palaeontological components of EIA / **EMP** / HIA / CMP/ Other (Specify).....
- H. REPORT COMMISSIONED BY (CONSULTANT OR DEVELOPER): **Biotechnology and Environmental specialist Consultancy**
- I. CONTACT DETAILS: **P.O. Box 8241, Nahoon, 5210, lee-anne@besc.co.za**
- J. COMMENTS:
Please see comment on next page

REVIEW COMMENT ON ARCHAEOLOGICAL AND PALAEOLOGICAL IMPACT ASSESSMENT**Ms K. van Ryneveld****Dated: November 2010, Received: November 2010****Part 2: Utilization of borrow pits - O.R. Tambo District Municipality, Eastern Cape, South Africa****Dr G. Groenewald****Dated: October 2011, received: January 2012**

The Proposed Utilisation Of Borrow Pits On Roads: DR08024, DR08147, DR08153 & DR08156 - Qaukeni/Inqguza Hill Local Municipality, DR08029 - Port St Johns Local Municipality, DR08120 & DR08123 - Mibizana Local Municipality, DR08131 - Mhlontlo Local Municipality, DR08173 - Nyandeni Local Municipality, DR08273, DR08275, DR08281 & DR18033 - King Sabata Dalindiyedo Local Municipality, Oliver Tambo District Municipality, Eastern Cape Province South Africa

INTRODUCTION

The Department of Roads and Public Works is proposing the use of 82 borrow pits to upgrade 29 roads in the Oliver Tambo District Municipality.

Biotechnology and Environmental Specialist Consultants undertook the Environmental Management Plan for this project and commissioned both an archaeological and a palaeontological assessment of the proposed borrow pits.

The archaeologist divided the assessment into two phases, the first one was included in a report submitted to SAHRA in September 2011 and commented upon in November 2011. The September 2011 assessment included the survey of 40 borrow pits along 13 roads, whereas the second part, submitted in November 2011, included the survey of the remaining 42 borrow pits along another 14 roads.

The first palaeontological assessment was undertaken by Dr Rossouw in September 2011 and considered 54 of the 82 borrow pits, whereas another 28 were assessed by Dr Groenewald in October 2011 and are commented upon in this review.

DISCUSSION

From an archaeological perspective the specialist recorded only a low density scatter of stone tools of low significance close to a borrow pit (BP04N) along the DR 08273.

Six stone pile features were identified along DR08120, at borrow pit 01N, in proximity of a modern homestead. These may represent grave sites, however, inhabitants of the surrounding area are quite confident that these are actually natural stone clusters.

Two formal cemeteries were also recorded along the DR18033, close to borrow pit 01. Both these grave sites, of 25 and 30 graves respectively, are still in use, and some of the graves are expected to be older than 60 years. Mostly these are traditional graves with simple earth mounds.

The 28 borrow pits investigated by Dr Groenewald are established through formations of the Natal Group from the Ordovician, The Ecca Group, the Adelaide Subgroup of the Beaufort Group, with its Koonap, Middleton and Balfour Formation, the Katberg Formation of the Tarkastad Subgroup Group, and some intrusions of dolerite from the Jurassic.

In five of the surveyed borrow pits the palaeontologist recorded fossils, amongst which *Glassopteris* leaves in the Adelaide Formation, fossilised rhizomes in the Burgersdorp Formation, fossilised burrow casts in the Katberg Formation and some trace fossils in the Ecca Group. In the light of the fossil material recovered and of the previous studies in the area the palaeontologist suggested that monitoring by a professional palaeontologist

for the most sensitive formations is undertaken.

SAHRA RECOMMENDATIONS

SAHRA APM and Burial Grounds and Graves Units support the recommendations of the authors and require that:

- The Stone Age scatter of low density may be destroyed without applying for a permit from SAHRA;
- The two cemeteries should not be impacted upon during the mining activities. The cemeteries must be fenced off at least temporarily, the fence must be placed 5m from the graves and no activities are allowed within 20 m of the fence line (see Appendix 1);
- Similar recommendations are valid for the possible grave sites. If any activity is to occur within 20m from the site, test excavations are requested. This must be undertaken by a professional archaeologist and a permit from SAHRA will be requested. The archaeologist will require a mitigation permit from SAHRA in terms of s. 35 and 36 of the National Heritage Resources Act (Act 25 of 1999). On receipt of a satisfactory mitigation (Phase 2) permit report from the archaeologist, SAHRA will make further recommendations.
- For the five borrow pits where fossilised material was identified, mitigation must be undertaken before any earth-moving activities resulting from this proposed project begins. A photographic record must be established immediately before, during and after mitigation. The palaeontologist will require a mitigation permit from SAHRA in terms of s. 35 of the National Heritage Resources Act (Act 25 of 1999). On receipt of a satisfactory mitigation (Phase 2) permit report from the archaeologist, SAHRA will make further recommendations in terms of the site such as its final destruction or additional sampling.
- Excavations in sensitive formations, such as the Adelaide, Burgerdsorp and Katberg Formations and the Ecca Group must be monitored by an ECO trained by a palaeontologist to recognise fossils. Moreover, a professional palaeontologist must inspect the site regularly for possible fossil exposures. A report from the monitoring activities must be submitted to SAHRA for further comments. If new palaeontological resources are identified, mitigation may be necessary and the palaeontologist will need to apply from a permit from SAHRA in terms of s. 35 of the National Heritage Resources Act (Act 25 of 1999).

CONCLUSION

If the recommendations made in this comment are adhered to, the SAHRA Archaeology, Palaeontology and Meteorites Unit has no objection to the development in terms of the archaeological and palaeontological components of the heritage resources. If any new evidence of archaeological sites or artefacts, palaeontological fossils, graves or other heritage resources are found during mining, SAHRA and a professional archaeologist or palaeontologist must be alerted immediately.

SIGNATURE OF ARCHAEOLOGIST PROCESSING REPORT: *Mgalimberti*
 EMAIL: mgalimberti@sahra.org.za
 SIGNATURE OF SAHRA HEAD ARCHAEOLOGIST: *P. Scheermeyer*
 EMAIL: cscheermeyer@sahra.org.za
 NAME OF HERITAGE RESOURCES AGENCY: SAHRA.....

PLEASE NOTE THAT THE COMMENT (ABOVE OR APPENDED) CONSTITUTES THE COMMENT OF THE HERITAGE RESOURCES AGENCY ARCHAEOLOGIST AND THAT ANY DEVELOPMENT THAT INVOLVES DESTRUCTION OF ANY ARCHAEOLOGICAL/PALAEONTOLOGICAL SITE IS STILL SUBJECT TO A PERMIT/PERMISSION FOR DESTRUCTION OF SUCH SITE GIVEN TO THE DEVELOPER BY THE RELEVANT HERITAGE RESOURCES AGENCY ARCHAEOLOGICAL AND PALAEONTOLOGICAL PERMIT COMMITTEE (THIS WILL BE SUBJECT TO APPROVAL OF THE PHASE 2 OR ARCHAEOLOGICAL/ PALAEONTOLOGICAL MITIGATION AS NECESSARY). THIS REPORT MAY BE TAKEN ONLY AS APPROVAL IN TERMS OF SECTION 35 OF THE NATIONAL HERITAGE RESOURCES ACT. THE PROVINCIAL MANAGER OF THE HERITAGE RESOURCES AUTHORITY MUST ADVISE AS TO APPROVAL IN TERMS OF HERITAGE ISSUES ENCOMPASSED BY OTHER ASPECTS OF THE LEGISLATION, SUCH AS ISSUES OF THE BUILT ENVIRONMENT (STRUCTURES (E.G. FARM HOUSES), OVER 60 YEARS), INDIGENOUS KNOWLEDGE SYSTEMS OR OF CULTURAL LANDSCAPES AS THIS IS NOT WITHIN THE SCOPE OF THE ARCHAEOLOGIST.

PLEASE NOTE THAT SAHRA IS NOW RESPONSIBLE FOR GRADE I HERITAGE RESOURCES (AND EXPORT) AND THE PROVINCIAL HERITAGE RESOURCES ARE RESPONSIBLE FOR GRADE II AND GRADE III HERITAGE RESOURCES, EXCEPT WHERE THERE IS AN AGENCY ARRANGEMENT WITH THE PROVINCIAL HERITAGE RESOURCES AUTHORITY.

APPENDIX 1


Protection of Graves

In terms of the National Heritage Resources Act (No. 25 of 1999) graves older than 60 years (not in a municipal graveyard) are protected. Human remains younger than 60 years should be handled only by a registered undertaker or an institution declared under the Human Tissues Act.

Anyone who wishes to develop an area where there are graves older than 60 years is required to follow the process described in the legislation (section 36 and associated regulations). The specialist will require a permit from the heritage resources authority:

1. Determine/ confirm the presence of the graves on the property. Normally the quickest way to proceed is to obtain the service of a professional archaeologist accredited to undertake burial relocations. The archaeologist will provide an estimate of the age of the graves. There may be a need for archival research and possibly test excavations (permit required).
2. The preferred decision is to move the development so that the graves may remain undisturbed. If this is done, the developer must satisfy SAHRA that adequate arrangements have been made to protect the graves on site from the impact of the development. This usually involves fencing the grave(yard) and setting up a small site management plan indicating who will be responsible for maintaining the graves and how this is legally tied into the development. It is recommended that a distance of at least 2 m is left undisturbed between the grave and the fence around the graves and another 15 m between the fence of the grave and the development.
3. If the developer wishes to relocate or disturb the graves:
 - a. A 60-day public participation (social consultation) process as required by section 36 (and regulations), must be undertaken to identify any direct descendants of those buried on the property. This allows for a period of consultation with any family members or community to ascertain what their wishes are for the burials. It involves notices to the public on site and through representative media. This may be done by the archaeologist, who can explain the process, but for large or sensitive sites a social consultant should be employed. Archaeologists often work with undertakers, who rebury the human remains.
 - b. If as a result of the public participation, the family (where descendants are identified) or the community agree to the relocation process then the graves may be relocated.
 - c. The archaeologist must submit a permit application to SAHRA for the disinterment of the burials. This must include written approval of the descendants or, if there has not been success in identifying direct descendants, written documentation of the social consultation process, which must indicate to SAHRA's satisfaction, the efforts that have been made to locate them. It must also include details of the exhumation process and the place to which the burials are to be relocated. (There are regulations regarding creating new cemeteries and so this usually means that relocation must be to an established communal rural or formal municipal cemetery.)
 - d. Permission must be obtained before exhumation takes place from the landowner where the graves are located, and from the owners/managers of the graveyard to which the remains will be relocated.

Other relevant legislation must be complied with, including the Human Tissues Act (National Department of Health) and any ordinances of the Provincial Department of Health). The archaeologist can usually advise about this.



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

November 3, 2011

Attention: Key Interested and Affected Parties

RE: Notification of the compilation of Environmental Management Plans for the utilisation of borrow pits in the OR Tambo District Municipality, Eastern Cape.

Notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of the intent to carry out the following activity:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo District Municipality and Alfred Nzo District Municipality. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

You have been identified as a Key Interested & Affected Parties (I&AP's). Accompanying this letter is a CD containing the Background Information Document(s) (BID'(s)) pertaining to the the road sections identified along which the borrow pits are located. Please refer to attached table for the borrow pits and the thirteen road sections which pertain to the BID's on the accompanying CD.

Please feel free to contact BESC if you have any further queries.

Yours Sincerely
 Lee-Anne Proudfoot
(Pr.Sci.Nat – Environmental Scientist)
 Senior Environmental Consultant
 Mobile: +27 83 421 3991
 Email: lee-anne@besc.co.za

Mr. Conroy van der Riet
(Pr.Sci.Nat - Environmental Scientist)
 Senior Environmental Consultant
 Mobile: 083 993 1243
 Email: conroy@besc.co.za

Malcolm Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
 CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
 CK 95.10210/23

Page 1 of 3

Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm # Allotment Name
Mvimwana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'7.10"	INGQUZA HILL	13	FARM 115
Jongisizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29° 6'8.50"	NYANDENI	5	FARM RE/36
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Elliotdale
DR18033	18033_BP08	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/64
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/61
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/61
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tina LOC 20
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INGQUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INGQUZA HILL	17	Farm 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INGQUZA HILL	2	RE/128
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INGQUZA HILL	2	

DR	BP	Lat	Long	Area	Volume	Remarks
DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqokezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'55.6" S	28°25'50.2" E	KSD	18	Mqokezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'05.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqokezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INQGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INQGUZA HILL	23	RE/89
Niyenya Access Road - ANDM-IR01	ANDM-IR01_BP01	30°25'54.90"	29° 3'30.80"	MATATIELE	26	RE/196
Niyenya Access Road - ANDM-IR01	ANDM-IR01_BP02	30°32'0.86"	29° 4'3.37"	MATATIELE	21	RE/21
Niyenya Access Road - ANDM-IR01	ANDM-IR01_BP03	30°34'28.50"	29° 3'20.80"	MATATIELE	21	RE/21
Niyenya Access Road - ANDM-IR01	ANDM-IR01_BP04	30°33'39.60"	29° 2'14.20"	MATATIELE	21	RE/21
Niyenya Access Road - ANDM-IR01	ANDM-IR01_BP05	30°33'16.06"	29° 1'26.59"	MATATIELE	21	RE/21



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

November 3, 2011

Attention: Key Interested and Affected Parties

RE: Notification of the compilation of Environmental Management Plans for the utilisation of borrow pits in the OR Tambo District Municipality, Eastern Cape.

Notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of the intent to carry out the following activity:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo District Municipality District Municipality. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

You have been identified as a Key Interested & Affected Parties (I&AP's). Accompanying this letter is a CD containing the Background Information Document(s) (BID'(s)) pertaining to the the road sections identified along which the borrow pits are located. Please refer to attached table for the borrow pits and the road sections which pertain to the BID's on the accompanying CD.

Please feel free to contact BESC if you have any further queries.


Yours Sincerely
Lee-Anne Proudfoot
(Pr.Sci.Nat – Environmental Scientist)
Senior Environmental Consultant
Mobile: +27 83 421 3991
Email: lee-anne@besc.co.za

Mr. Conroy van der Riet
(Pr.Sci.Nat - Environmental Scientist)
Senior Environmental Consultant
Mobile: 083 993 1243
Email: conroy@besc.co.za

Page 1 of 3


Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23



Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm #/ Allotment Name
Mvimvana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM-IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM-IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'7.10"	INGQUZA HILL	13	FARM 115
Jongisizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29° 6'8.50"	NYANDENI	5	FARM RE/36
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Eliotdale
DR18033	18033_BP08	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/54
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/51
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/51
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tina LOC 20
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INGQUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INGQUZA HILL	17	Farm 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INGQUZA HILL	2	RE/128
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INGQUZA HILL	2	

Page 2 of 3



DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqekwezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'56.6" S	28°25'50.2" E	KSD	18	Mqekwezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'06.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqekwezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INQGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INQGUZA HILL	23	RE/89

Page 3 of 3



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

**Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems**

November 3, 2011

Attention: Key Interested and Affected Parties

RE: Notification of the compilation of Environmental Management Plans for the utilisation of borrow pits in the OR Tambo District Municipality, Eastern Cape.

Notice is hereby given in terms of the Regulations of the Minerals and Petroleum Resources Development Act (No. 28 of 2002) of the intent to carry out the following activity:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo District Municipality. BESC have been appointed to compile the Environmental Management Plans for these borrow pits.

You have been identified as a Key Interested & Affected Parties (I&AP's). Accompanying this letter is/are the Background Information Document(s) (BID'(s)) pertaining to the proposed borrow pits and roads sections relevant to your area of jurisdiction. Please refer to the attached table for relevant borrow pits and road sections.

Please feel free to contact BESC if you have any further queries.

Yours Sincerely
Lee-Anne Proudfoot
(Pr.Sci.Nat - Environmental Scientist)
Senior Environmental Consultant
Mobile: +27 83 421 3991
Email: lee-anne@besc.co.za

Mr. Conroy van der Riet
(Pr.Sci.Nat - Environmental Scientist)
Senior Environmental Consultant
Mobile: 083 993 1243
Email: conroy@besc.co.za

Page 1 of 3


Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci)
CK 95.10210/23


Road #	Borrow pit #	Latitude	Longitude	Local Municipality	Ward	Farm #/ Allotment Name
Mvimvana Access Road- ORTDM-IR01	ORTDM-IR01_BP01	31°15'48.65"	29°33'20.67"	INGQUZA HILL	18_12	FARM 19
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP01	31°16'25.30"	29°29'13.40"	INGQUZA HILL	13	FARM 115
Xhurana Access Road-ORTDM- IR02	ORTDM-IR02_BP02	31°15'37.20"	29°29'7.10"	INGQUZA HILL	13	FARM 115
Jongisizwe Access Road- ORTDM-IR03	ORTDM-IR03_BP01	31°21'24.30"	29° 6'8.50"	NYANDENI	5	FARM RE/36
ORTDM-IR04	ORTDM-IR04_BP01	30°46'12.74"	29°31'38.73"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP02	30°46'23.30"	29°30'38.70"	NTABANKULU	18	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP03	30°46'32.19"	29°29'41.31"	NTABANKULU	17	MBONGWENI LOC 7
ORTDM-IR04	ORTDM-IR04_BP04	30°46'48.00"	29°29'34.40"	NTABANKULU	17	MBONGWENI LOC 7
DR18033	18033_BP01	31°51'50.3" S	28°36'15.6" E	KSD	19	Sitebe
DR18033	18033_BP02	31°58'39.2" S	28°39'48.2" E	MBASHE	13	Eliotdale
DR18033	18033_BP08	32°11'56.1" S	28°52'24.2" E	MBASHE	20	RE/29
DR18033	18033_BP01N	32°03'14.7" S	28°47'50.1" E	MBASHE	15	RE/63
DR18033	18033_BP02N	31°58'46.6" S	28°39'53.8" E	KSD	21	Farm 76
DR18033	18033_BP03N	32°11'43.0" S	28°52'23.9" E	MBASHE	20	RE/29
DR08024	024_BP01	31°20'30.7" S	29°44'45.2" E	INGQUZA HILL	24	3/89
DR08024	024_BP01N	31°20'21.9" S	29°45'27.9" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°19'29.9" S	29°47'12.3" E	INGQUZA HILL	23	3/89
DR08024	024_BP02N	31°20'01.5" S	29°45'16.4" E	INGQUZA HILL	24	3/89
DR08029	029_BP01	31°41'06.7" S	29°22'55.2" E	PORT ST JOHNS	3	Farm 43
DR08029	029_BP01N	31°43'22.0" S	29°16'19.9" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP02N	31°45'10.1" S	29°18'11.2" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP03N	31°45'18.3" S	29°18'13.8" E	PORT ST JOHNS	1	RE/45
DR08029	029_BP04N	31°44'02.8" S	29°21'39.1" E	PORT ST JOHNS	2	Farm 43
DR08029	029_BP05N	31°42'59.6" S	29°21'54.1" E	PORT ST JOHNS	2	Farm 43
DR08120	120_BP01	31°03'16.7" S	29°45'24.6" E	MBIZANA	15	RE/54
DR08120	120_BP02	31°10'12.9" S	29°43'43.1" E	INGQUZA HILL	28	RE/85
DR08120	120_BP01N	30°54'28.1" S	29°49'33.9" E	MBIZANA	13	RE/51
DR08120	120_BP02N	30°54'10.5" S	29°49'34.7" E	MBIZANA	13	RE/51
DR08123	123_BP01	30°58'38.3" S	29°40'23.4" E	MBIZANA	11	RE/49
DR08123	123_BP01N	30°58'32.8" S	29°40'12.2" E	MBIZANA	10	RE/49
DR08131	131_BP01	30°59'41.9" S	28°44'06.3" E	MHLONTLO	21	Tina LOC 20
DR08131	131_BP01N	30°58'24.3" S	28°45'25.6" E	MHLONTLO	19	Tina LOC 20
DR08153	153_BP02	31°17'16.9" S	29°20'13.6" E	INGQUZA HILL	2	RE/108
DR08153	153_BP01N	31°20'21.8" S	29°30'7.5" E	INGQUZA HILL	17	Farm 116
DR08156	156_BP02	31°19'24.1" S	29°23'06.4" E	INGQUZA HILL	2	RE/128
DR08156	156_BP01N	31°19'22.5" S	29°23'8.8" E	INGQUZA HILL	2	

DR	BP	Lat	Long	Area	Volume	Remarks
DR08157	157_BP01	31°25'08.7" S	29°22'53.9" E	PORT ST JOHNS	17	RE/112
DR08173	173_BP01	31°24'27.2" S	28°58'51.4" E	NYANDENI	3	RE/35
DR08173	173_BP02	31°22'51.7" S	28°59'04.9" E	NYANDENI	3	RE/56
DR08273	273_BP02	31°48'20.6" S	28°17'58.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP01N	31°46'39.1" S	28°26'23.4" E	KSD	18	Mqezweni
DR08273	273_BP02N	31°48'07.6" S	28°24'20.8" E	KSD	18	Rune
DR08273	273_BP03N	31°48'20.0" S	28°17'38.6" E	ENGCOBO	16	Clarkebury
DR08273	273_BP04N	31°47'06.7" S	28°16'16.2" E	ENGCOBO	16	Clarkebury
DR08275	275_BP02	31°47'56.6" S	28°25'50.2" E	KSD	18	Mqezweni
DR08275	275_BP01N	31°53'2.2" S	28°27'14.1" E	KSD	20	Mntentu
DR08281	281_BP01	31°44'06.3" S	28°39'08.6" E	KSD	32	Xwili
DR08281	281_BP02	31°44'18.9" S	28°31'08.4" E	KSD	31	Mqezweni
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	INQGUZA HILL	23	RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	INQGUZA HILL	23	RE/89

25.2 Correspondence issued to and received from Registered Interested and Affected Parties

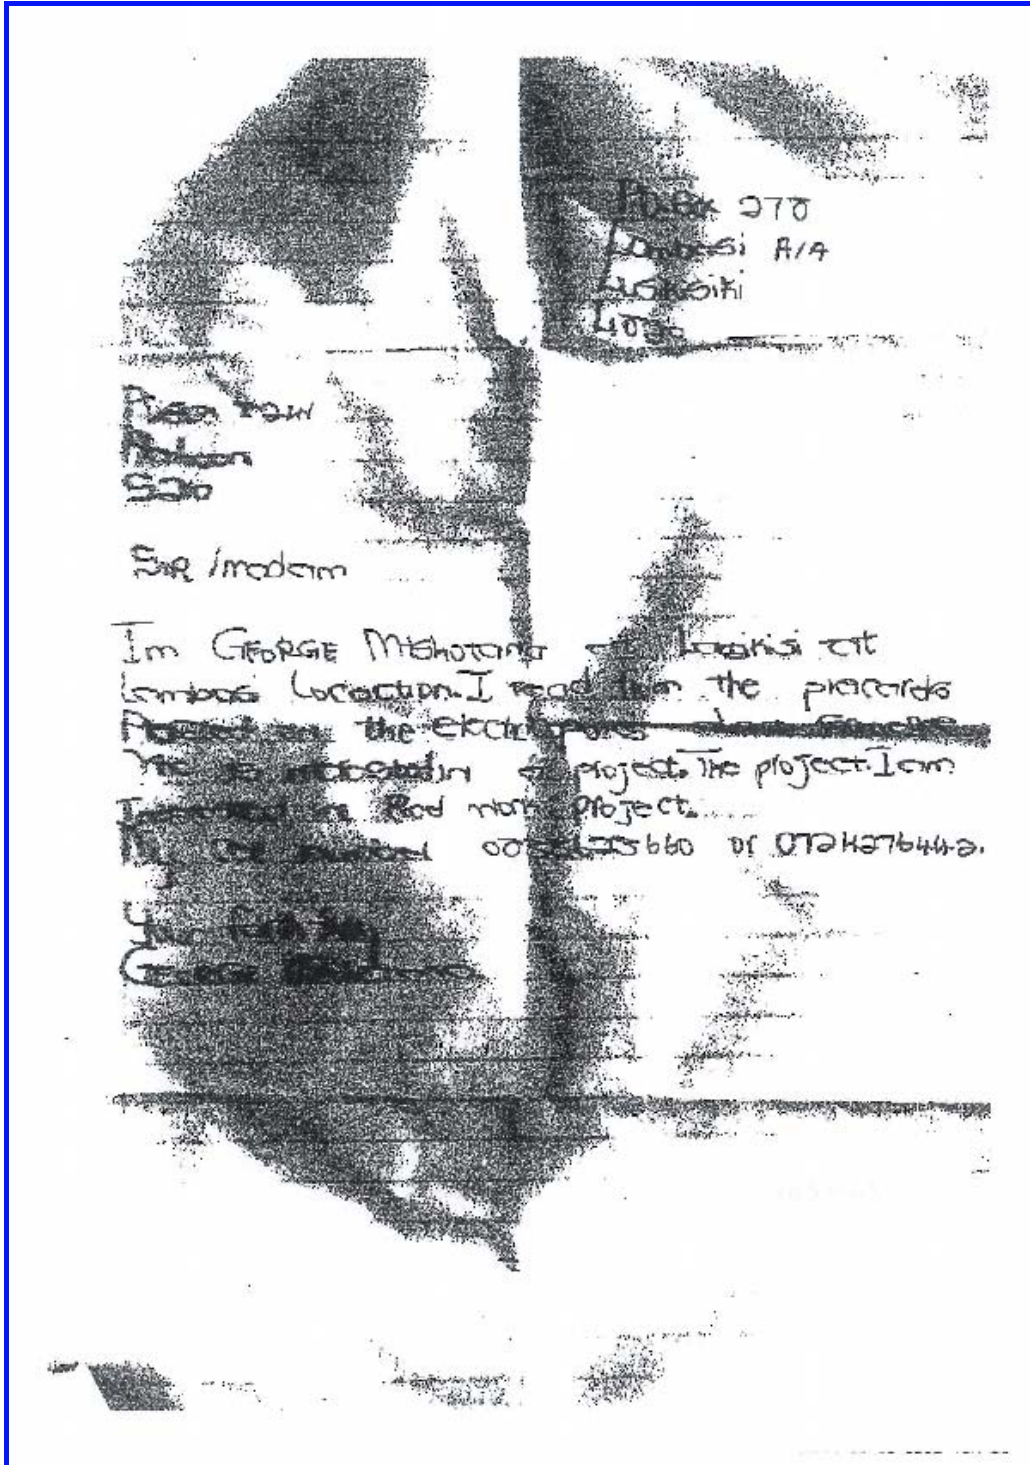

25.3 Correspondence issued to and received from Key & Registered Interested Affected Parties during the Public Draft Review Commenting Period.



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za [http:// www.besc.co.za](http://www.besc.co.za)

January 16, 2012

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

Attention: Key Interested & Affected Parties

Public Draft Environmental Management Plan Reports – Utilization of Borrow Pits, OR Tambo and Alfred Nzo District Municipalities.

In terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) and the Promotion of Administrative Justice Act (Act 3 of 2000 and as amended) the following is presented to you:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo and Alfred Nzo District Municipalities. BESC have been commissioned to prepare Environmental Management Plan Reports in terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) for the proposed utilization of Borrow Pits throughout the OR Tambo & Alfred Nzo District Municipalities.

Accompanying this letter is a Compact Disc containing the Public Draft Environmental Management Plan Report(s) pertaining to the proposed borrow pits and roads sections identified in the OR Tambo and Alfred Nzo District Municipalities.

These public draft Environmental Management Plan Reports are released for review and comment for a 30-day period from date of mailing. Whereas you may want to provide comments and/or suggestions for inclusion into this assessment/ the final EMP reports, please ensure that such is received in writing by the offices of BESC before 17H00, February 16, 2011; either via email (conroy@besc.co.za/ lee-anne@besc.co.za), facsimile (043 726 3199), or post (BESC, P.O. Box 8241, Nahoon, 5210).

Yours sincerely,
Mr. Conroy van der Riet/Ms. Lee-Anne Proudfoot
Tel: (043) 726 4242
Fax: (043) 726 3199
E-mail: lee-anne@besc.co.za

Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; Pr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

January 16, 2012

Attention: Key Interested & Affected Parties

Public Draft Environmental Management Plan Reports – Utilization of Borrow Pits, OR Tambo District Municipality

In terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) and the Promotion of Administrative Justice Act (Act 3 of 2000 and as amended) the following is presented to you:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo Municipality. BESC have been commissioned to prepare Environmental Management Plan Reports in terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) for the proposed utilization of Borrow Pits throughout the OR Tambo District Municipality.

Accompanying this letter is a Compact Disc containing the Public Draft Environmental Management Plan Report(s) pertaining to the proposed borrow pits and roads sections identified in the OR Tambo District Municipality.

These public draft Environmental Management Plan Reports are released for review and comment for a 30-day period from date of mailing. Whereas you may want to provide comments and/or suggestions for inclusion into this assessment/ the final EMP reports, please ensure that such is received in writing by the offices of BESC before 17H00, February 16, 2012; either via email (lee-anne@besc.co.za), facsimile (043 726 3199), or post (BESC, P.O. Box 8241, Nahoon, 5210).

Yours sincerely,
Mr. Conroy van der Riet/Ms. Lee-Anne Proudfoot
Tel: (043) 726 4242
Fax: (043) 726 3199
E-mail: conroy@besc.co.za/lee-anne@besc.co.za

Page 1 of 1

Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA, Fr.Sci.Nat.(Environ.Sci.)
CK 95.10210/23



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za http://www.besc.co.za

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

January 16, 2012

Attention: Key Interested & Affected Parties

Public Draft Environmental Management Plan Reports – Utilization of Borrow Pits, OR Tambo & Alfred Nzo District Municipalities.

In terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) and the Promotion of Administrative Justice Act (Act 3 of 2000 and as amended) the following is presented to you:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo & Alfred Nzo District Municipalities. BESC have been commissioned to prepare Environmental Management Plan Reports in terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) for the proposed utilization of Borrow Pits throughout the OR Tambo & Alfred Nzo District Municipalities.

Accompanying this letter is a Compact Disc containing the Public Draft Environmental Management Plan Report(s) pertaining to the proposed borrow pits and roads sections identified which are relevant in your area.

These public draft Environmental Management Plan Reports are released for review and comment for a 30-day period from date of mailing. Whereas you may want to provide comments and/or suggestions for inclusion into this assessment/ the final EMP reports, please ensure that such is received in writing by the offices of BESC before 17H00, February 16, 2012; either via email (lee-anne@besc.co.za), facsimile (043 726 3199), or post (BESC, P.O. Box 8241, Nahoon, 5210).

Yours sincerely,
Mr. Conroy van der Riet/Ms. Lee-Anne Proudfoot
Tel: (043) 726 4242
Fax: (043) 726 3199
E-mail: lee-anne@besc.co.za

Page 1 of 1

Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; *Pr. Sci.Nat.(Environ.Sci)*
CK 95.10210/23



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

January 16, 2012

Attention: Key Interested & Affected Parties

Public Draft Environmental Management Plan Reports – Utilization of Borrow Pits, OR Tambo District Municipality

In terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) and the Promotion of Administrative Justice Act (Act 3 of 2000 and as amended) the following is presented to you:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo Municipality. BESC have been commissioned to prepare Environmental Management Plan Reports in terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) for the proposed utilization of Borrow Pits throughout the OR Tambo District Municipality.

Accompanying this letter is a Compact Disc containing the Public Draft Environmental Management Plan Report(s) pertaining to the proposed borrow pits and roads sections identified which are relevant in your area.

These public draft Environmental Management Plan Reports are released for review and comment for a 30-day period from date of mailing. Whereas you may want to provide comments and/or suggestions for inclusion into this assessment/ the final EMP reports, please ensure that such is received in writing by the offices of BESC before 17H00, February 16, 2012; either via email (lee-anne@besc.co.za), facsimile (043 726 3199), or post (BESC, P.O. Box 8241, Nahoon, 5210).

Yours sincerely,
Mr. Conroy van der Riet/Ms. Lee-Anne Proudfoot
Tel: (043) 726 4242
Fax: (043) 726 3199
E-mail: lee-anne@besc.co.za

Page 1 of 1

Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; *Pr. Sci.Nat.(Environ.Sci)*
CK 95.10210/23



BIOTECHNOLOGY & ENVIRONMENTAL SPECIALIST CONSULTANCY CC

PO Box 8241, Nahoon, 5210, East London South Africa
9 Douglas Road, Vincent, 5247, East London, South Africa
Telephone: +27 43 726 4242 Facsimile: +27 43 726 3199
E-mail: info@besc.co.za <http://www.besc.co.za>

Leaders in Industrial Ecology, Environmental Impact & Site Assessments
& Safety, Health & Environmental Management Systems

January 16, 2012

Attention: Interested & Affected Parties

Public Draft Environmental Management Plan Reports – Utilization of Borrow Pits, OR Tambo District Municipality

In terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) and the Promotion of Administrative Justice Act (Act 3 of 2000 and as amended) the following is presented to you:

The Department of Roads & Public works proposes to utilize borrow pits for road maintenance/re-gravelling projects located throughout the OR Tambo Municipality. BESC have been commissioned to prepare Environmental Management Plan Reports in terms of the Minerals and Petroleum Resources Development Regulations (Government Notice No. 527) under the Minerals and Petroleum Resources Development Act (M&PRDA) (No. 28 of 2002) for the proposed utilization of Borrow Pits throughout the OR Tambo District Municipality.

Accompanying this letter is a Compact Disc containing the Public Draft Environmental Management Plan Report(s) pertaining to the proposed borrow pits and roads sections identified which are relevant in your area.

These public draft Environmental Management Plan Reports are released for review and comment for a 30-day period from date of mailing. Whereas you may want to provide comments and/or suggestions for inclusion into this assessment/ the final EMP reports, please ensure that such is received in writing by the offices of BESC before 17H00, February 16, 2012; either via email (lee-anne@besc.co.za), facsimile (043 726 3199), or post (BESC, P.O. Box 8241, Nahoon, 5210).

Yours sincerely,
Mr. Conroy van der Riet/Ms. Lee-Anne Proudfoot
Tel: (043) 726 4242
Fax: (043) 726 3199
E-mail: lee-anne@besc.co.za

Page 1 of 1

Malcolme Logie

B.Sc. Hons. (Botany), M.Sc. (Botany), Ph.D. (Biotechnology), (Rhodes)
CEAP-SA; MSAIE & ES; MIAIA; *Pr. Sci.Nat.(Environ.Sci)*
CK 95.10210/23

NAME	POSTAL ADDRESS	TRACE & TRACK
Jimmy Calder, Phillip Wilkinson - WESSA	WESSA, P O Box 2309, Beesoon Bay 5205	ORDINARY PARCEL PK: 526 443 966 Z/A CUSTOMER COPY 301918
SFISO KHOZA – OR Tambo D.M. - Director:Engineering	OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	ORDINARY PARCEL PK: 526 443 870 Z/A CUSTOMER COPY 301918
Ms P.A.X Dunywa - OR Tambo D.M- Director: Planning & Development	OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	ORDINARY PARCEL PK: 526 443 849 Z/A CUSTOMER COPY 301918
Ms Mandisa Maliso- OR Tambo D.M-Director: Technical Services	OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	ORDINARY PARCEL PK: 526 443 821 Z/A CUSTOMER COPY 301918
Mr Ncube- OR Tambo D.M- Municipal Manager	OR Tambo District Municipality; Private Bag X6043 Mthatha 5099	ORDINARY PARCEL PK: 526 443 852 Z/A CUSTOMER COPY 301918
Mr Nick Matebese - Department of Rural Development & Land Reform: OR Tambo District Manager	Department of Rural Development & Land Reform - Private Bag X 5213, MTHATHA, 5100	ORDINARY PARCEL PK: 526 443 835 Z/A CUSTOMER COPY 301918
Mr Q. Paliso - DEDEA - OR Tambo Region – Regional Manager	DEDEA - OR Tambo Region Private Bag X5029 Mthatha, 5100	ORDINARY PARCEL PK: 526 443 508 Z/A CUSTOMER COPY 301918
Gwen Sgwabe- Department of Forestry – Regional Officer	Department of Forestry- Private Bag X7485, King Williams Town, 5800	ORDINARY PARCEL PK: 526 443 747 Z/A CUSTOMER COPY 301918
Mr Thobela- Mbizana Local Municipality Municipal Manager	Mbizana Local Municipality, PO Box 12, BIZANA, 4800	ORDINARY PARCEL PK: 526 443 733 Z/A CUSTOMER COPY 301918
Mr Tyela – KSD Municipality Acting Municipal Manager	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL PK: 526 443 729 Z/A CUSTOMER COPY 301918
Mr Tantsi- Municipal Manager - Ntabankulu Local Municipality	Ntabankulu Local Municipality, PO Box 234, NTABANKULU, 5130	ORDINARY PARCEL PK: 526 443 716 Z/A CUSTOMER COPY 301918
Mr T. Mase- Mhloni LM Acting Municipal Manager	Mhloni Local Municipality, PO Box 31, QUMBU, 5180	ORDINARY PARCEL PK: 526 443 702 Z/A CUSTOMER COPY 301918
Mr Maso- Municipal Manager - Nyendeni Local Municipality	Nyendeni Local Municipality, Private Bag X504, LIBODE, 5160	ORDINARY PARCEL PK: 526 443 689 Z/A CUSTOMER COPY 301918
Mr Zola Hewu- Municipal Manager - Port St Johns Local Municipality	Port St Johns Local Municipality, PO Box 2, PORT ST JOHNS, 5120	ORDINARY PARCEL PK: 526 443 693 Z/A CUSTOMER COPY 301918
Mr Muleki Fihanti- Municipal Manager - Qaukeni/Inguza Hill Local Municipality	Qaukeni/Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 662 Z/A CUSTOMER COPY 301918



Mr Mahlasela- Engcobo Local Municipality Acting Municipal Manager	Engcobo Local Municipality, PO Box 24, ENGCOBO, 5050	ORDINARY PARCEL PK: 526 443 676 Z/A CUSTOMER COPY 301918
Advocate Siphwo Schena- Mbashe Local Municipality- Municipal Manager	Mbashe Local Municipality, PO Box 25, INDUTYWA, 5000	ORDINARY PARCEL PK: 526 443 645 Z/A CUSTOMER COPY 301918
Cllr Mamfengu - Ntabankulu Local Municipality – Ward 17 Councillor	Ntabankulu Local Municipality, PO Box 234, NTABANKULU, 5130	ORDINARY PARCEL PK: 526 443 659 Z/A CUSTOMER COPY 301918
Cllr Mazaza - Ntabankulu Local Municipality - Ward 18 Councillor	Ntabankulu Local Municipality, PO Box 234, NTABANKULU, 5130	ORDINARY PARCEL PK: 526 443 628 Z/A CUSTOMER COPY 301918
Cllr F. Dilo - Port St Johns Local Municipality- Ward 1 Councillor	Port St Johns Local Municipality, PO Box 2, PORT ST JOHNS, 5120	ORDINARY PARCEL PK: 526 443 634 Z/A CUSTOMER COPY 301918
Cllr L. Rolobele- Port St Johns Local Municipality- Ward 2 Councillor	Port St Johns Local Municipality, PO Box 2, PORT ST JOHNS, 5120	ORDINARY PARCEL PK: 526 443 614 Z/A CUSTOMER COPY 301918
Cllr Zolile Maqina- Port St Johns Local Municipality- Ward 3 Councillor	Port St Johns Local Municipality, PO Box 2, PORT ST JOHNS, 5120	ORDINARY PARCEL PK: 526 443 605 Z/A CUSTOMER COPY 301918
Cllr Mncwoti- Port St Johns Local Municipality- Ward 17 Councillor	Port St Johns Local Municipality, PO Box 2, PORT ST JOHNS, 5120	ORDINARY PARCEL PK: 526 443 591 Z/A CUSTOMER COPY 301918
Cllr N. Nkayitshona - Inguza Hill Local Municipality- Ward 12 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 559 Z/A CUSTOMER COPY 301918
Cllr P. Ntshobo - Inguza Hill Local Municipality- Ward 13 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 565 Z/A CUSTOMER COPY 301918
Cllr N. Zathi- Inguza Hill Local Municipality- Ward 18 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 574 Z/A CUSTOMER COPY 301918
Cllr V. Somani- Inguza Hill Local Municipality- Ward 2 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 587 Z/A CUSTOMER COPY 301918
Cllr M. Tanyane- Inguza Hill Local Municipality- Ward 17 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 543 Z/A CUSTOMER COPY 301918
Cllr Dalwe- Inguza Hill Local Municipality- Ward 23 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 150 Z/A CUSTOMER COPY 301918
Cllr M. Nkungu- Inguza Hill Local Municipality- Ward 24 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 163 Z/A CUSTOMER COPY 301918
Cllr S. Magaya- Inguza Hill Local Municipality- Ward 28 Councillor	Inguza Hill Local Municipality, PO Box 14, FLAGSTAFF, 4810	ORDINARY PARCEL PK: 526 443 923 Z/A CUSTOMER COPY 301918




Clr Willie - Mphashe Local Municipality - Ward 13 Councillor	Mphashe Local Municipality, PO Box 25, INDUTYWA, 5000	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 937 ZA CUSTOMER COPY 301016
Clr Mbaalela- Mphashe Local Municipality - Ward 15 Councillor	Mphashe Local Municipality, PO Box 25, INDUTYWA, 5000	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 906 ZA CUSTOMER COPY 301016
Clr Sevu- Mphashe Local Municipality - Ward 20 Councillor	Mphashe Local Municipality, PO Box 25, INDUTYWA, 5000	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 918 ZA CUSTOMER COPY 301016
Clr N.C. Gqetywa- Nyandeni Local Municipality- Ward 3 Councillor	Nyandeni Local Municipality, Private Bag X504, LIBODE, 5180	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 883 ZA CUSTOMER COPY 301016
Clr T. Nompetseni - Nyandeni Local Municipality- Ward 5 Councillor	Nyandeni Local Municipality, Private Bag X504, LIBODE, 5180	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 897 ZA CUSTOMER COPY 301016
Clr. M. Makhholosa- Mbizana Local Municipality- Ward 10 Councillor	Mbizana Local Municipality, PO Box 12, BIZANA, 4800	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 818 ZA CUSTOMER COPY 301016
Clr S. Faku - Mbizana Local Municipality- Ward 11 Councillor	Mbizana Local Municipality, PO Box 12, BIZANA, 4800	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 781 ZA CUSTOMER COPY 301016
Clr. N. Madikizela- Mbizana Local Municipality- Ward 13 Councillor	Mbizana Local Municipality, PO Box 12, BIZANA, 4800	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 795 ZA CUSTOMER COPY 301016
Clr Moambelala- Mbizana Local Municipality- Ward 15 Councillor	Mbizana Local Municipality, PO Box 12, BIZANA, 4800	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 778 ZA CUSTOMER COPY 301016
Clr J.M. Jikigela - Mhlonto Local Municipality - Ward 19 Councillor	Mhlonto Local Municipality, PO Box 31, QUMBU, 5180	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 764 ZA CUSTOMER COPY 301016
Clr Mthusal Meteha- Mhlonto Local Municipality - Ward 21 Councillor	Mhlonto Local Municipality, PO Box 31, QUMBU, 5180	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 785 ZA CUSTOMER COPY 301016
Clr N. Lumkwana - Engcobo Local Municipality - Ward 16 Councillor	Engcobo Local Municipality, PO Box 24, ENGCOBO, 5050	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 444 019 ZA CUSTOMER COPY 301016
Clr M. Jasta- King Sabata Dalinyebo Local Municipality- Ward 18 Councillor	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 444 005 ZA CUSTOMER COPY 301016
Clr B. Mezini- King Sabata Dalinyebo Local Municipality- Ward 19 Councillor	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 999 ZA CUSTOMER COPY 301016
Clr Zela- King Sabata Dalinyebo Local Municipality- Ward 20 Councillor	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 985 ZA CUSTOMER COPY 301016
Clr M. Mazukwane- King Sabata Dalinyebo Local Municipality- Ward 21 Councillor	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 971 ZA CUSTOMER COPY 301016



Clr Zimela- King Sabata Dalinyebo Local Municipality- Ward 31 Councillor	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 968 ZA CUSTOMER COPY 301016
Clr M.T. Mirara- King Sabata Dalinyebo Local Municipality- Ward 32 Councillor	King Sabata Dalinyebo Local Municipality, PO Box 45, MTHATHA, 5099	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 443 964 ZA CUSTOMER COPY 301016

George Mshonlana	PO Box 270, Lombasi A/a, Lusikolde, 4820	ORDINARY PARCEL 2010/000 517 000 0000 000 00 00 PE 526 442 548 ZA CUSTOMER COPY 301016
------------------	--	---







B E S C

Biotechnology & Environmental Specialist Consultancy cc
 PO Box 8241, Nahoon, 5210, East London South Africa
 9 Douglas Road, Vincent, 5247, East London, South Africa
 Telephone: 043 726 4242 Facsimile: 043 726 3199
 E-mail: info@besc.co.za Http://www.besc.co.za

DOCUMENT/REPORT RECEIPT FORM

TITLE OR DESCRIPTION OF DOCUMENT/REPORT	
Public draft EMPS:Utilisation of Borrow pits: OR TAMBO D.M & Alfred Nzo D.M.	
REPORT NUMBER	2011-R609 to 2011-R627
DATE OF REPORT	January 12, 2011

PARTICULARS OF RECEIVING PERSON/AUTHORITY	
Name	Lizna Fourie
Organisation	DWA

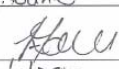SIGNATURES		
	Received by	Delivered by
Name	L. Fourie	L. PROUDFOOT
Signature		
Date	17/1/2012	17/01/2012
Time	8:15	8:16
Place	East London	E.L.

26 Appendix E: Site Photographs

26.1 Borrow pit 147_BP01



Figure 15: Borrow Pit # 147-BP01.

26.2 Borrow pit 147_BP02



Figure 16: Borrow Pit # 147-BP02.

27 Appendix F: Mammal species of the Eastern Cape region

Species	Common name
<i>Aethoys namaquensis</i>	Namaqua rock mouse
<i>Alelerix frontalis</i>	Southern African hedgehog
<i>Amblysomus hottentotus</i>	Hottentot golden mole
<i>Aonyx capensis</i>	Clawless otter
<i>Atilax paludinosus</i>	Water mongoose
<i>Canis mesomelas</i>	Black-backed jackal
<i>Cephalophus monticola</i>	Blue duiker
<i>Cercopithecus aethiops</i>	Vervet monkey
<i>Cercopithecus mitis</i>	Samango monkey
<i>Chrysospalax trevelyani</i>	Giant golden mole
<i>Cicidura falvescens</i>	Greater mush shrew
<i>Crocidura cyanea</i>	Reddish-grey mush shrew
<i>Cryptomys hottentotus</i>	Common mole rat
<i>Cynictis penicillata</i>	Yellow mongoose
<i>Damaliscus dorcas phillipsi</i>	Blesbuck
<i>Dasumys incomtus</i>	Water rat
<i>Dendromus mesomelas</i>	Brant's climbing mouse
<i>Dendrohyrax arboreus</i>	Tree dassie
<i>Dendromus melanotis</i>	Grey climbing mouse
<i>Dendromus mystacalis</i>	Chestnut climbing mouse
<i>Elephantus edwardii</i>	Cape rock elephant shrew
<i>Epomophorus wahlbergi</i>	Walberg's epauletted fruit bat
<i>Eptesicus capensis</i>	Cape serotine bat
<i>Eptesicus hottentotus</i>	Long-tailed serotine bat
<i>Felis caracal</i>	Caracal
<i>Felis lybica</i>	African wild cat
<i>Felis serval</i>	Serval
<i>Galerella pulverulenta</i>	Small grey mongoose
<i>Genetta genetta</i>	Small-spotted genet
<i>Genetta tigrina</i>	Large-spotted genet
<i>Georychus capensis</i>	Cape mole rat
<i>Grammomys dolichurus</i>	Woodland mouse
<i>Graphiurus murinus</i>	Woodland dormouse
<i>Graphiurus ocellatus</i>	Spectacled dormouse
<i>Herpestes ichneumon</i>	Large grey mongoose
<i>Hipposideros caffer</i>	Sundevall's leaf-nosed bat
<i>Hystrix africaeaustralis</i>	Porcupine
<i>Ichneumia albicauda</i>	White-tailed mongoose
<i>Ictonyx striatus</i>	Striped polecat
<i>Kerivoula lanosa</i>	Lesser woolly bat
<i>Lepus saxatilis</i>	Scrub hare
<i>Malacothrix typical</i>	Long-eared mouse
<i>Mastomys coucha</i>	Multi-mammate mouse
<i>Mastomys natalensis</i>	Natal multi-mammate mouse
<i>Mellivora capensis</i>	Honey badger
<i>Miniopterus schreibersii</i>	Schreiber's long-fingered bat
<i>Miniopterus fraterculus</i>	Lesser long-fingered bat
<i>Mus minutoides</i>	Pygmy mouse
<i>Mus musculus</i>	House mouse

Species	Common name
<i>Myotis tricolor</i>	Temminck's hair bat
<i>Mysorex cafer</i>	Dark-footed forest shrew
<i>Mysorex varius</i>	Forest shrew
<i>Mystromys albicaudatus</i>	White-tailed rat
<i>Nycteris thebaica</i>	Egyptian slit-faced bat
<i>Orycteropus afer</i>	Antbear (aardvark)
<i>Otmys irroratus</i>	Vlei rat
<i>Otomys saundersiae</i>	Saunders's vlei rat
<i>Papio ursinus</i>	Chacma baboon
<i>Pedetes capensis</i>	Springhare
<i>Philantomba monticola</i>	Blue duiker
<i>Pipistrellus kuhlii</i>	Kuhl's pipistelle
<i>Poecilogate albinuchu</i>	Stripped weasel
<i>Potamochoerus larvatus</i>	Bushpig
<i>Procavia capensis</i>	Rock dassie
<i>Pronolagus crassicaudatus</i>	Natal red hare
<i>Pronolagus rupestris</i>	Smith's red hare
<i>Proteles cristatus</i>	Aardwolf
<i>Raphicerus campestris</i>	Steenbok
<i>Raphicerus melanotis</i>	Cape grysbok
<i>Rattus norvegicus</i>	Brown rat
<i>Rattus rattus</i>	House rat
<i>Redunca arundinum</i>	Reedbuck
<i>Rhabdomys pumilio</i>	Stripped mouse
<i>Rhinolophus clivosus</i>	Geoffrey's horseshoe bat
<i>Rhinolophus swinnyi</i>	Swinny's horseshoe bat
<i>Rousettus aegyptiacus</i>	Egyptian fruit bat
<i>Sccostomus campestris</i>	Pouched mouse
<i>Scotophilus borbonicus</i>	Lesser yellow house bat
<i>Suncus infitesimus</i>	Least dwarf shrew
<i>Suncus varilla</i>	Lesser dwarf shrew
<i>Sylvicapra grimmia</i>	Common duiker
<i>Tadarida aegyptiaca</i>	Egyptian free-tailed bat
<i>Tadarida condylura</i>	Angolan free-tailed bat
<i>Taphozous mauritanus</i>	Mauritian tomb bat
<i>Thryonomys swinderianus</i>	Greater cane rat
<i>Tragelaphus scriptus</i>	Bushbuck
<i>Vulpes chama</i>	Cape fox

28 Appendix G: Bird species of the Eastern Cape region

Species	Common name	Robarts N#
<i>Accipiter melanelous</i>	Black sparrow hawk	158
<i>Accipiter minullus</i>	Little sparrow hawk	157
<i>Accipiter tachio</i>	African goshawk	160
<i>Acridotheres tristis</i>	Indian myna	758
<i>Acrocephalus palustris</i>	European marsh warbler	633
<i>Actophilomus africanus</i>	African jacana	240
<i>Alcedo cristata</i>	Malachite kingfisher	431
<i>Alcedo semitorquata</i>	Half-collared kingfisher	430
<i>Alopochen aegyptiacus</i>	Egyptian goose	102
<i>Amblyospiza abifrons</i>	Thick-billed weaver	807
<i>Anas sparsa</i>	African black duck	105
<i>Anas undulate</i>	Yellow bulled duck	104
<i>Andropadus imprtunus</i>	Somber bulbul	572
<i>Anhinga melanogaster</i>	Darter	60
<i>Anthreptes collaris</i>	Collard sunbird	793
<i>Anthus lineiventris</i>	Stripped pipit	720
<i>Anthus novaeseelandiae</i>	Richard's pipit	716
<i>Apalis flavida</i>	Yellow-breasted apalis	648
<i>Apalis thoracica</i>	Bar-throated apalis	645
<i>Apalodema narina</i>	Narina trogon	427
<i>Aplopelia larvata</i>	Cinnamon dove	360
<i>Apus affinis</i>	Little swift	417
<i>Apus barbatus</i>	Black swift	412
<i>Apus caffer</i>	White-rumped swift	415
<i>Ardeola railodides</i>	Squacco heron	72
<i>Ardrea cinera</i>	Grey heron	62
<i>Ardrea melancephala</i>	Black-beared heron	63
<i>Aviceda cuculoides</i>	Cuccio hawk	128
<i>Balearica regulorum</i>	Crowned quail	209
<i>Batis capensis</i>	Cape batis	700
<i>Bostrychia hagedash</i>	Hadeda	94
<i>Bradyoterus baboecala</i>	African sedge warbler	638
<i>Bradypterus barratti</i>	Barret's warbler	639
<i>Bradypterus sylvaticus</i>	Knysna warbler	640
<i>Bubo africanus</i>	Spotted eagle owl	401
<i>Burhinus capensis</i>	Spotted dikkop	297
<i>Burhinus vermiculatus</i>	Water dikkop	298
<i>Buteo buteo</i>	Steppe buzzard	149
<i>Buteo rufofucus</i>	Jackal buzzard	152
<i>Bycanister bucinator</i>	Trumpeter hornbill	455
<i>Calandrella cinerea</i>	Red-capped lark	507
<i>Calidrus capensis</i>	Sanderling	281
<i>Camaroptera brachyuran</i>	Bleating warble	657
<i>Campephraga flava</i>	Black cuckoo shrike	538
<i>Campethera notata</i>	Knysna woodpecker	484
<i>Centro superciliosus</i>	Burchell's cuckoo	391
<i>Ceryle maxima</i>	Giant kingfisher	429

Species	Common name	Robarts N#
<i>Ceryle rudis</i>	Pied kingfisher	428
<i>Charadrius marginatus</i>	White-fronted plover	246
<i>Charadrius pecuarius</i>	Kittilz's plover	248
<i>Charadrius tricollaris</i>	Three-banded plover	249
<i>Chrysococcyx capruis</i>	Diederik's cuckoo	386
<i>Chrysococcyx cupreus</i>	Emerald cuckoo	384
<i>Chrysococcyx klaas</i>	Klaas's cuckoo	385
<i>Circaetus cinereus</i>	Brown snake eagle	142
<i>Circus macrourus</i>	Pallid harrier	167
<i>Circus maurus</i>	Black harrier	168
<i>Circus ranivorus</i>	African marsh hawk	165
<i>Cisticola aberrans</i>	Laz cisticola	679
<i>Cisticola ayersii</i>	Ayre's cisticola	667
<i>Cisticola fulvicapilla</i>	Neddick cisticola	681
<i>Cisticola tinniens</i>	Le Vallant's cisticola	677
<i>Colius striatus</i>	Speckled mousebird	424
<i>Columba arquatrix</i>	Rameron pigeon	350
<i>Columba guinea</i>	Rock pigeon	349
<i>Coracias garrulous</i>	European roller	446
<i>Coracina caesia</i>	Grey cuckoo shrike	540
<i>Cossypha caffra</i>	Cape robin	601
<i>Cossypha dichroa</i>	Chorister robin	598
<i>Coturnix coturnix</i>	Common quail	200
<i>Croesus albicollis</i>	Whiter-necked raven	550
<i>Croesus albus</i>	Pied crow	548
<i>Croesus capensis</i>	Black crow	547
<i>Cypsiurus parvus</i>	Palm swift	421
<i>Dendrocygna viduata</i>	White-faced duck	99
<i>Dicrurus adsimilis</i>	Fork-tailed drongo	541
<i>Dryscopus cubia</i>	Puff-back	740
<i>Egretta garzetta</i>	Little egret	67
<i>Elanus caeruleus</i>	Black-shouldered kite	127
<i>Erythropgia leucophrys</i>	White-browed robin	613
<i>Erythropgia signata</i>	Brown robin	616
<i>Estilda astrid</i>	Common waxbill	846
<i>Estrilda melanotisquartin</i>	Swee waxbill	850
<i>Euplectes capensis</i>	Yellow-rumped widow	827
<i>Falco biarmicus</i>	Lanner falcon	172
<i>Falco subuteo</i>	Hobby falcon	173
<i>Falco tinnunculus</i>	Rock kestrel	181
<i>Fulica cristata</i>	Red-nobbed coot	228
<i>Haliaeetus vocifer</i>	African fish eagle	148
<i>Halyco albiventris</i>	Brown-hooded kingfisher	435
<i>Hieraaetus pennatus</i>	Booted eagle	136
<i>Hirundo abyssinica</i>	Lesser striped swallow	527
<i>Hirundo albigularis</i>	White-throated swallow	520
<i>Hirundo cucullata</i>	Greater striped swallow	526
<i>Hirundo dimidiata</i>	Pearl-breasted swallow	523
<i>Hirundo fuligula</i>	Rock martin	529
<i>Hirundo rustica</i>	European swallow	518
<i>Indicator indicator</i>	Greater honey guide	474
<i>Indicator variegatus</i>	Scarlet-throated honey guide	475

Species	Common name	Robarts N#
<i>Ispidima picta</i>	Pygmy kingfisher	432
<i>Lagonosticta rubricate</i>	Blue-billed fire finch	840
<i>Lamprotomis corrusus</i>	Black-billed starling	768
<i>Laniarius ferrugineus</i>	Southern boubou	736
<i>Lanius colaris</i>	Fiscal shrike	732
<i>Lopeatus occipitalis</i>	Long-crested eagle	139
<i>Lybius leucomelas</i>	Pied barbet	465
<i>Lybius torquatus</i>	Black-collared barbet	464
<i>Macronyx capensis</i>	Orange-throated longclaw	727
<i>Malaconotus blanchoti</i>	Grey-headed bush shrike	751
<i>Malaenomis pammelaina</i>	Black flycatcher	694
<i>Merops apiaster</i>	European bee-eater	438
<i>Mesopicus griseocephalus</i>	Olive woodpecker	488
<i>Milvus migrans</i>	Yellow-billed black kite	126
<i>Motacilla aguimp</i>	African pied wagtail	711
<i>Motacilla capensis</i>	Cape wagtail	713
<i>Motacilla ciara</i>	Long-tailed wagtail	712
<i>Muscicupa adjusta</i>	Dusk flycatcher	690
<i>Muscicupa caerulea</i>	Blue-grey flycatcher	691
<i>Nectarinia veroxii</i>	Gery sunbird	789
<i>Nectarine amethystina</i>	Black sunbird	792
<i>Nectarinia afra</i>	Greater double-collared sunbird	785
<i>Nectarinia chalybea</i>	Lesser double-collared sunbird	783
<i>Nycticorax nycticorax</i>	Black crowned night heron	76
<i>Oena capensis</i>	Namaqua dove	356
<i>Oriolus larvatus</i>	Black-headed oriole	545
<i>Oriolus oriolus</i>	European golden oriole	543
<i>Parus niger</i>	Southern black tit	554
<i>Permis apivorus</i>	Hone buzzard	130
<i>Phalacrocorax africanus</i>	Reed cormorant	58
<i>Phalacrocorax capensis</i>	Cape cormorant	56
<i>Phalacrocorax carbo</i>	White-breasted cormorant	55
<i>Phoeniculus purpureus</i>	Red-billed wood hoopoe	452
<i>Phyllasterphus terrestris</i>	Terrestrial bulbul	569
<i>Phylloscopus trochilus</i>	Willow warbler	643
<i>Plectropterus gambensis</i>	Spurwinged goose	116
<i>Ploceus bicolor</i>	Forest weaver	808
<i>Ploceus capensis</i>	Spectacled weaver	810
<i>Ploceus capensis</i>	Cape weaver	813
<i>Ploceus subaureus</i>	Yellow weaver	817
<i>Podica senegalensis</i>	African finfoot	229
<i>Pogoniulus pusillus</i>	Red-fronted tinker barbet	469
<i>Pogonocichia stellata</i>	Starred robin	606
<i>Poicephalus robustus</i>	Cape parrot	362
<i>Polyboroides typus</i>	Gymnogene	169
<i>Prinia maculosa</i>	Spotted prinia	686
<i>Prinia sublava</i>	Tawn-flanked prinia	683
<i>Psalioprocne holomelas</i>	Black saw-winged swallow	536
<i>Pyncnonotus barbatus</i>	Black-eyed bulbul	568
<i>Sagittarius serpentarius</i>	Secretary bird	118
<i>Sarothrura affinis</i>	Stripped flufftail	221
<i>Sarothrura rufa</i>	Red-chested flufftail	217

Species	Common name	Robarts N#
<i>Saxicola toquata</i>	Stone chat	596
<i>Scopus unbretta</i>	Hammerkop	81
<i>Seicercus ruficapillus</i>	Yellow-throated warbler	644
<i>Serinus gularis</i>	Streak-headed canary	881
<i>Serinus mazambicus</i>	Yellow-eyed canary	869
<i>Serinus scotops</i>	Forest canary	873
<i>Sigelus silens</i>	Fiscal flycatcher	698
<i>Sorathrura elegans</i>	Buff-spotted flufftail	218
<i>Spermestes cucullatus</i>	Bronze manikin	857
<i>Stephanoaetus coroatus</i>	Crowned eagle	141
<i>Streptopelia capicola</i>	Cape turtle dove	354
<i>Streptopelia semitorquata</i>	Red-eyed dove	352
<i>Streptopelia senegalensis</i>	Laughing dove	355
<i>Sturnus vulgaris</i>	European starling	757
<i>Tachybaptus ruficolis</i>	Little grebe, dabchick	8
<i>Tadoma cana</i>	South African shell duck	103
<i>Tauraco corythaix</i>	Knysna lourie	370
<i>Tchagra tchagra</i>	Grey-breasted tchagra	742
<i>Telephorus zeylonus</i>	Bokmakierie	746
<i>Telphorus olivaceus</i>	Olive bush shrike	750
<i>Tersiphone viridis</i>	Paradise flycatcher	710
<i>Thalassomis leuconotus</i>	White-backed duck	101
<i>Thamnolea cinnamomeivent</i>	Mocking chat	577
<i>Threskiomis aethiopus</i>	Sacred ibis	91
<i>Tokus alboterminatus</i>	Crown hornbill	460
<i>Tringa hypoleucos</i>	Common sandpiper	264
<i>Trochocercus cynomelas</i>	Blue-mantled flycatcher	708
<i>Turdus olivaceus</i>	Olive thrush	577
<i>Turtur chalcospilos</i>	Green-spotted dove	358
<i>Turtur tympanistria</i>	Tambourine dove	359
<i>Tyto alba</i>	Barn owl	392
<i>Tyto capensis</i>	Grass owl	393
<i>Upupa epopus</i>	Hoopoe	451
<i>Vanellus armatus</i>	Blacksmith plover	258
<i>Vanellus coronatus</i>	Crowned plover	255
<i>Vanellus melanopterus</i>	Black-winged plover	257
<i>Zosterops pallidus</i>	Cape white-eye	796

29 Appendix H: Threatened Birds of the Eastern Cape

Common name	Species name	Conservation status	Endemicity
Bearded Vulture	<i>Gypaetus barbatus</i>	Endangered	
Bittern	<i>Botaurus stellaris</i>	Critical	
Black Harrier	<i>Circus maurus</i>	Near-threatened	SA Endemic
Black Oystercatcher	<i>Haematopus moquini</i>	Near-threatened	
Black Stork	<i>Ciconia nigra</i>	Near-threatened	
Blackbellied Korhaan	<i>Eupodotis melanogaster</i>	Near-threatened	
Blackbrowed Albatross	<i>Diomedea melanophris</i>	Near-threatened	
Blackwinged Plover	<i>Vanellus melanopterus</i>	Near-threatened	
Blue Crane	<i>Anthropoides paradisea</i>	Vulnerable	SA Endemic
Blue Korhaan	<i>Eupodotis caerulescens</i>	Near-threatened	SA Endemic
Broadtailed Warbler	<i>Schoenicola brevirostris</i>	Near-threatened	
Bush Blackcap	<i>Lioptilus nigricapillus</i>	Near-threatened	SA Endemic
Cape Cormorant	<i>Phalacrocorax capensis</i>	Near-threatened	
Cape Gannet	<i>Morus capensis</i>	Vulnerable	
Cape Parrot	<i>Poicephalus robustus</i>	Endangered	
Cape Vulture	<i>Gyps coprotheres</i>	Vulnerable	SA Endemic
Caspian Tern	<i>Hydroprogne caspia</i>	Near-threatened	
Chestnutbanded	<i>Charadrius pallidus</i>	Near-threatened	
Corncrake	<i>Crex crex</i>	Vulnerable	
Crowned Eagle	<i>Stephanoaetus coronatus</i>	Near-threatened	
Damara Tern	<i>Sterna balaenarum</i>	Endangered	
Delegorgue's Pigeon	<i>Columba delegorguei</i>	Vulnerable	
Finfoot	<i>Podica senegalensis</i>	Vulnerable	
Grass Owl	<i>Tyto capensis</i>	Vulnerable	
Greater Flamingo	<i>Phoenicopterus ruber</i>	Near-threatened	
Grey Petrel	<i>Procellaria cinerea</i>	Near-threatened	
Ground Hornbill	<i>Bucorvus leadbeateri</i>	Vulnerable	
Halfcollared Kingfisher	<i>Alcedo semitorquata</i>	Near-threatened	
African Penguin	<i>Spheniscus demersus</i>	Vulnerable	
Knysna Warbler	<i>Bradypterus sylvaticus</i>	Vulnerable	SA Endemic
Knysna Woodpecker	<i>Campethera notata</i>	Near-threatened	SA Endemic
Kori Bustard	<i>Ardeotis kori</i>	Vulnerable	
Lanner	<i>Falco biarmicus</i>	Near-threatened	
Lesser Flamingo	<i>Phoenicopterus minor</i>	Near-threatened	
Lesser Kestrel	<i>Falco naumanni</i>	Vulnerable	
Ludwig's Bustard	<i>Neotis ludwigii</i>	Vulnerable	
Mangrove Kingfisher	<i>Halcyon senegaloides</i>	Vulnerable	
Marabou	<i>Leptoptilos crumeniferus</i>	Near-threatened	
Marsh Harrier	<i>Circus ranivorus</i>	Vulnerable	
Martial Eagle	<i>Polemaetus bellicosus</i>	Vulnerable	SA Endemic
Melodious Lark	<i>Mirafraga cheniana</i>	Near-threatened	
Orange Thrush	<i>Turdus gurneyi</i>	Near-threatened	
Painted Snipe	<i>Rostratula benghalensis</i>	Near-threatened	
Pallid Harrier	<i>Circus macrourus</i>	Near-threatened	
Peregrine	<i>Falco peregrinus</i>	Near-threatened	
Roseate Tern	<i>Sterna dougallii</i>	Endangered	
Rudd's Lark	<i>Mirafraga ruddi</i>	Critical	
Secretary bird	<i>Sagittarius serpentarius</i>	Near-threatened	

Common name	Species name	Conservation status	Endemicity
Shy Albatross	<i>Diomedea cauta</i>	Vulnerable	
Southern Giant Petrel	<i>Macronectes giganteus</i>	Near-threatened	
Stanley's Bustard	<i>Neotis denhami</i>	Vulnerable	
Striped Flufftail	<i>Sarothrura affinis</i>	Vulnerable	
Tawny Eagle	<i>Aquila rapax</i>	Vulnerable	
Wandering Albatross	<i>Diomedea exulans</i>	Vulnerable	
Wattled-Crane	<i>Burgeranus carunculatus</i>	Endangered	
White Pelican	<i>Pelecanus onocrotalus</i>	Near-threatened	
Whitebacked Night Heron	<i>Gorsachias leuconotus</i>	Vulnerable	
Whitebellied Korhaan	<i>Eupodotis cafra</i>	Vulnerable	
Whitechinned Petrel	<i>Procellaria aequinoctialis</i>	Near-threatened	
Whitecrowned plover	<i>Vanellus albiceps</i>	Near-threatened	
Yellowbilled Stork	<i>Mycteria ibis</i>	Near-threatened	
Yellowbreasted Pipit	<i>Anthus chloris</i>	Vulnerable	SA Endemic

30 Appendix I: Borrow pit Information

Rd_Nr_	No_	South	East	Municipal Area	Ward	Farm #/Allotment Name
DR08147	147_BP01	31°20'23.6" S	29°46'01.9" E	Ingquza LM	23	Farm RE/89
DR08147	147_BP02	31°20'56.7" S	29°47'40.5" E	Ingquza LM	23	Farm RE/89

31 Appendix J: Curriculum Vitae

31.1 Dr Malcolm Logie

Dr. Malcolm Logie
Principal and Managing Director
MSc (Botany); PhD (Biotechnology), Rhodes

Malcolm Logie has over 12 years experience in the field of Environmental Management with extensive experience in the fields of Industrial Environmental Management; Safety, Health & Environmental Management Systems; and Environmental Auditing and Assessments (environmental site assessments, environmental impact assessments, systems certification), in South Africa, Mocambique, Namibia, Angola, Ghana, Zambia, Egypt, The Czech Republic, The Slovak Republic and Romania.

Malcolm has wide-ranging experience primarily in the following sectors:

- Automotive sector
- Beverages
- Chemicals & chemical products
- Civil and mechanical engineering
- Electricity & water supply
- Metals refining & processing
- Mining & quarrying
- Pulp & paper
- Telecommunications

Malcolm's project experience largely falls into the following broad areas:

Safety, Health & Environmental Management Systems

Malcolm's experience includes management system design and implementation and also certification audits across a wide range of industrial and mining sectors in South Africa, Mocambique, Angola, Zambia and Romania.

Environmental Site Assessments

Malcolm has been the project leader on many Phase I and II ESA's that have been undertaken in accordance with the ASTM standards, at several industrial facilities in South Africa.

Environmental Auditing

Malcolm's auditing experience includes ISO 14001, OHSAS 18001 and ISO 9001 certification level audits; legal compliance, and environmental performance audits across a wide range of industrial and mining sectors in South Africa, Mocambique, Namibia, Angola, Ghana, Zambia, Egypt, The Czech Republic and Romania.

Environmental Impact Assessments

Malcolm has managed a broad range of environmental impact assessments ranging from: industrial facilities, telecommunication networks, electrification networks, transportation infrastructure, waste sites and water supply.

Professional Affiliations & Registrations

- Registered as a Professional Natural Scientist (Environmental Scientist) with the South African Council of Natural Scientific Professions (SACNASP).
- Professional Member of the South African Institute of Ecologists and Environmental Scientists (SAIE&ES)
- Certification Board of Environmental Assessment Practitioners of South Africa
- International Association of Impact Assessors (IAIASA)
- Royal Society of South Africa
- South African Association of Botanists (SAAB)
- Phycology Society of South Africa (PSSA)
- South African Auditor & Training Certification Association (SAATCA) – EMS Verification Auditor
- Bureau Veritas Quality International – Lead EMS Auditor

South African Council of Natural Scientific Professions

- Malcolm is a member of the Education Committee of South African Council of Natural Scientific Professions (SACNASP) for the registration of Professional Natural Scientist.

Rhodes University Investec Schools of Business

- Malcolm sits on the Advisory Board for the Rhodes University Investec Schools of Business which provides advice and directs the strategic planning and continual development of the business school.
- Malcolm lectures at the MBA class at the Rhodes University Investec Schools of Business on safety, health environmental management in the industrial and business environments.

Fields of Competence

- Safety, Health & Environmental Management Systems
- Industrial Environmental Management
- Environmental Site Assessments

- Environmental Impact Assessments

Education

- PhD (Biotechnology) 1995
- MSc (Botany), 1992
- BSc Honours (Botany), 1990
- BSc (Plant Science & Biochemistry), 1989

Key Projects

Recent key projects include:

South African Breweries Millers (SAB Miller)

- Ursus Breweries, Romania (SAB Miller), where Malcolme is responsible for the development and implementation of a Safety, Health & Environmental Management System at four breweries and a depot.
- Plzeňský Prazdroj, Czech Republic (SAB Miller), where Malcolme is responsible for the development and implementation of an integrated Safety, Health & Environmental Management System at three breweries.
- Dreher Sörgyárak Zrt, Hungary (SAB Miller), where Malcolme is responsible for the development and implementation of an integrated Safety, Health & Environmental Management System at this brewer.
- Ibhayi Brewery (Port Elizabeth) where an Environmental Management System was designed and implemented at this new state-of-art brewery. During the construction of the brewery Malcolme reviewed all the plans to ensure environmental sustainability

BHP Billiton (MOZAL), Mocambique

- Malcolme designed and co-ordinated the implementation of the Environmental Management System at this BHP Billiton aluminium smelter in Maputo, and continues to service this organization environmental management needs.

Coca-Cola Company

- Malcolme is the appointed SHE Management System Consultant to Coca-Cola Company Southern Africa, responsible for advising of the implementation of a SHE MS compliant with ISO 14001:2004, OHSAS 18001:1999 and the Coca-Cola Worldwide E3 programme.
- Malcolme is guiding to process for the development and implementation of an integrated SHE Management System at Coca-Cola Fortune (Polokwane & Bloemfontein). The management system is based on the requirements of ISO 14001:2004 and OHSAS 18001:1999.

Lonmin Platinum, South Africa

- Malcolme co-ordinated the design and implementation of the Environmental and Quality Management System at Lonmin's Western Platinum Refinery in Johannesburg, and also revised and re-establish the EMS at this platinum producers smelter and base metal refinery near Rustenburg.

Dorbyl Automotive Technologies, South Africa.

- For the past eight years Malcolme has been the exclusive environmental management and environmental management systems consultant to this automotive components producer. The production facilities include: foundries, forges, machine shops and manufacturing units.

Telkom SA Ltd, South Africa.

- Malcolme was instrumental in establishing the internal environmental assessment guidelines for this national telecommunication service provider, for the placement of telecommunication masts and associated infrastructure. He has also undertaken more than 120 environmental impact assessments of individual telecommunication masts throughout South Africa.

Environmental Site Assessments

- Malcolme has been the project leader on many Phase I and II ESA's that have been undertaken in accordance with the ASTM standards, at several industrial facilities in South Africa.

SHEQ Management Systems Auditing

- Malcolme has in excess of 8600 hours of SHEQ Management Systems auditing. He has audited companies in South Africa, Mocambique, Namibia, Angola, Ghana, Zambia, Egypt, The Czech Republic, The Slovak Republic and Romania.

European Scope of Accreditation

Malcolme has competency in the following Industrial Sectors:

1	Agriculture, forestry, fisheries	20	Ship building
2	Mining & quarrying	21	Aerospace
3	Beverages & foodstuff industries	22	Other transport equipment (automotive, rail)
4	Textile industries	23	Manufacturing (not classified elsewhere)
5	Leather & leather products	24	Recycling
6	Wood industries	25	Electricity supply
7	Pulp, paper & paper products	26	Gas supply
10	Mineral-oil processing	27	Water supply
12	Chemicals & chemical products	28	Construction
13	Pharmaceuticals	30	Hotels & restaurants
14	Rubber & plastic goods	31	Transport & communication
15	Glass, ceramics, processing of minerals & ores	34	Research & development
16	Production of cement, lime, gypsum & concrete, lime and gypsum products	35	Business services
17	Metals refining & processing, & production of metals	37	Education
18	Mechanical engineering	39	Other social services

31.2 Ms Lee-Anne Proudfoot

Ms. Lee-Anne Proudfoot Senior Environmental Consultant MSc (Marine Biology)

Lee-Anne Proudfoot has experience in the fields of Marine and Coastal Ecology , Geographical Information Systems (GIS), Environmental Impact Assessments, Environmental Site Assessments, Environmental Management Plans, Environmental Auditing, Visual Impact Assessments, Aquatic Impact Assessments and Project Management.

Lee-Anne's project experience includes:

Environmental Impact Assessments

Lee-Anne assisted in and managed a broad range of scoping & environmental impact assessments ranging from: agri-industrial & industrial facilities, residential & resort developments, golf estates, renewable energy technologies, storm water management, water supply, desalination and sewage.

Environmental Site Assessments

Lee-Anne has experience in site assessments, field sampling & monitoring, permit applications and in the compilation of reports for prospective land buyers.

Environmental Management Plans

Lee-Anne has experience in compiling and monitoring the Environmental Management Plans for a wide range of developments.

Environmental Auditing

Lee-Anne has experience in auditing the environmental compliance of and compiling environmental auditing reports.

Geographical Information Systems (GIS)

Lee-Anne has experience in using ArcView, Idrisi and Manifold software in assessing & producing maps, site plans, aerial photographs, etc.

Visual Impact Assessments (VIA)

Lee-Anne has experience in conducting VIA's and compiling VIA reports.

Aquatic Impact Assessments (AIA)

Lee-Anne has experience in conducting SASS5 Bio-rapid assessments for Aquatic Impact Assessments.

Project Management

Lee-Anne has experience in managing projects for a wide range of developments.

Professional Affiliations & Registrations

- Registered as a Professional Natural Scientist (Environmental Scientist) with the South African Council of Natural Scientific Professions (SACNASP).
- International Association of Impact Assessors, South Africa

Fields of Competence

- Environmental Impact Assessments
- Environmental Site Assessments
- Environmental Management Plans
- Environmental Auditing
- Geographical Information Systems (GIS)
- Visual Impact Assessments (VIA)
- Aquatic Impact Assessments (AIA)
- Project Management

Education

- M.Sc. (Marine Biology), Rhodes, 2006
- B.Sc. Honours (Marine Biology), Rhodes, 2003
- B.Sc. (Zoology and Ichthyology), Rhodes, 2002

Key Projects

African Dune Investments (Pty) Ltd

Lee-Anne is currently undertaking the environmental impact assessment and managing the environmental authorization process for the proposed Woodlands Golf Estate.

ABSA Development Company/Bigen Africa

Lee-Anne is the project manager for the environmental management component of the Albany Regional Water Services Project

African Dune Investments (Pty) Ltd

Lee-Anne is currently managing the scoping and environmental impact assessment for the environmental authorization of a proposed Wind Turbine Farm.

Amatola Green Power (Pty) Ltd

Lee-Anne is currently managing the environmental impact assessment for the proposed extraction of landfill gas from three BCM Landfill Sites for the purposes of electricity generation.

The Environmental Law Consultancy

Lee-Anne assisted in the compilation of a Legal Register for a Chrome Tanning Salts Plant in Merebank, with her focus pertaining to the relevant Occupational Health and Safety legislation.

International Finance Corporation

Lee-Anne co-ordinated and reviewed the specialist environmental studies required for the environmental impact assessment for the proposed Kalakundi Copper & Cobalt Mine in the Democratic republic of Congo.

Carpano Investments (Pty) Ltd

Lee-Anne was responsible for the environmental management component of the Spatial Development Framework for the proposed Rock Cliff development area south-east of East London

Kempston Leisure (Pty) Ltd

Lee-Anne managed the environmental authorization process for a proposed motor city

Edcot Trust (Pty) Ltd

Lee-Anne managed the environmental authorization process for a proposed motor city

Kempston Leisure (Pty) Ltd

Lee-Anne is the Environmental Control Officer for the proposed motor city development.

Wild Coast Ski Boat Club

Lee-Anne undertook the renewal application for a boat launching permit and prepared the requested environmental management plan for the Hole in the Wall Launch Site

Wild Coast Fishing Co-operative

Lee-Anne conducted and managed the environmental authorization process for a proposed aquaculture facility

Wild Coast Fishing Co-operative

Lee-Anne conducted and managed the scoping assessment for a proposed fish processing factory

Alvitex 103 (Pty) Ltd

Lee-Anne assisted on the environmental impact assessment for the proposed resort development.

Rakel (Pty) Ltd

Lee-Anne managed the environmental impact assessment for desalination plants servicing the proposed resort developments

Alvitex 103 (Pty) Ltd

Lee-Anne managed the environmental impact assessment for desalination plants servicing the proposed resort developments

Leisure Homes for Senior Citizens

Lee-Anne managed the environmental authorization process for the proposed extension of a retirement village

Fire Ring

Lee-Anne was involved in the compilation of a site assessment report for the prospective purchasing of land

Blue Beacon Investments (Pty) Ltd

Lee-Anne conducted and managed the environmental authorization process for the Connemara Housing Complex

Buffalo City Municipality – Waste Management

Lee-Anne assisted in the environmental audit process on the Buffalo City Regional Waste Disposal Site, focussing on issues such as operations and water-quality monitoring.

Buffalo City Development Agency

Lee-Anne was responsible for the environmental assessment component of the Nahoon Mouth and Sports Precinct Local Spatial Framework Plan.

Southern Palace Investments 414 (Pty) Ltd

Lee-Anne conducted and managed the scoping and environmental impact assessment for environmental authorization for a proposed mixed use development for the purposes of a hospital, retirement village and church.

Nuffield Trust

Lee-Anne conducted and managed the environmental impact assessment for the environmental authorization of a proposed Yellowwood Heights Residential Development

Riverleigh VII

Lee-Anne conducted and managed the Scoping Assessment for a proposed mixed use development for the purposes of entry level residential, office and retail.

True Group Building (Pty) Ltd

Lee-Anne conducted and managed the environmental impact assessment for the environmental authorization of a proposed light industrial site.

31.3 Mr Conroy van der Riet

Mr. Conroy van der Riet Senior Environmental Consultant BSc Honours (Environmental Geography)

Conroy van der Riet has more than 4 years experience in the fields of Marine and Terrestrial Ecology, Geography, Geographical Information Systems (GIS), Mining, Environmental Impact Assessments, Environmental Site Assessments, Environmental Management Plans, Environmental Management Systems, Environmental Auditing, Visual Impact Assessments, Site Rehabilitation, Water Use Licensing, Waste Licensing and project management throughout South Africa.

Conroy's project experience includes:

Environmental Impact Assessments

Conroy assisted in and managed a broad range of environmental impact assessments ranging from: agri-industrial & industrial facilities, residential & resort developments, golfing estates, informal settlement planning & formalisations, storm water management, water supply, desalinisation and sewage.

Environmental Site Assessments

Conroy has experience in many Phase I and II site assessments in accordance with ASTM Standards, SASS 5 freshwater aquatic systems assessments, field sampling & monitoring, permit applications and in the compilation of reports for prospective land buyers.

Environmental Management Plans

Conroy has experience in compiling and monitoring the Environmental Management Plans for a wide range of developments.

Environmental Management Systems

Conroy's experience includes Environmental Management System design and implementation, legal compliance audits, and risk assessments in compliance with relevant ISO Standards.

Environmental Auditing

Conroy's auditing experience includes ISO 14001, OHSAS 18001 and ISO 9001 certification level audits; legal compliance, and environmental performance audits across a wide range of industrial sectors in South Africa.

Geographical Information Systems (GIS)

Conroy has experience in using ArcView, Idrisi and Manifold software in assessing & producing environmental sensitivity maps, site plans, aerial photographs, satellite imagery, etc.

Visual Impact Assessments (VIA)

Conroy has experience in conducting VIA's and compiling VIA reports.

Site Rehabilitation

Conroy has experience in the rehabilitation of a variety of disturbed areas.

Water Use Licensing

Conroy has experience in a range of Water Use License application and related projects.

Waste Licensing

Conroy has experience in Waste License Applications for a range of projects

Project Management

Conroy has experience in managing projects for a wide range of developments.

Professional Affiliations & Registrations

- Registered as a Professional Natural Scientist (Environmental Scientist) with the South African Council of Natural Scientific Professions (SACNASP).
- International Association of Impact Assessors, South Africa

Fields of Competence

- Environmental Impact Assessments
- Environmental Management Plans
- Environmental Site Assessments
- Environmental Management Systems
- Environmental Auditing
- Geographical Information Systems (GIS)
- Visual Impact Assessments (VIA)
- Site Rehabilitation
- Water Use Licensing
- Waste Licensing
- Project Management

Education

- BSc Hons (Environmental Geography) NMMU, 2006
- BSc (Zoology and Geography) NMMU, 2005

Employment Record

- Biotechnology & Environmental Specialist Consultancy cc: 2006 - Present:

Key Projects**PG Bison**

Conroy assisted in the preparation of an Environmental Aspects Register, inclusive on significance assessment and proposed mitigation/management strategies for all the PG Bison activities at the board plant in Ugie, Eastern Cape for purposes of implementation of an Environmental Management System.

Kraft Foods SA

Conroy conducted the Phase I Environmental Site Assessment in accordance with the ASTM standards, and assisted in the preparation of an Environmental Aspects Register, inclusive on significance assessment and proposed mitigation/management strategies for all the Kraft Foods SA - Tunney Plant's activities for purposes of implementation of an Environmental Management System.

Goodyear SA

Conroy managed the Scoping process for the proposed installation of Underground Storage Vessels at the Goodyear SA factory.

Pragma Africa (Pty) Ltd

Conroy managed the environmental authorization process for the removal of underground fuel storage vessels.

Buffalo City Municipality - Waste Management

Conroy assisted in the environmental audit process on the Buffalo City Regional Waste Disposal Site, focussing on issues such as construction, operations and air-quality monitoring.

SANRAL

Conroy is managed the environmental authorization process for the proposed improvement of National Route 02, Section 18 for the South African National Roads Agency Limited. Conroy is also managing the mining permit applications of the borrow pits for the proposed road improvement, and has been appointed to act as Environmental Control Officer for the implementation of the project.

Bigen Africa (Pty) Ltd & Ndlambe Local Municipality

Conroy managed the environmental authorization process for the proposed Port Alfred Waste Water Treatment Works upgrade project. Conroy has also been appointed to act as the Environmental Control Officer for the implementation of the project.

Uhambiso

Conroy managed the environmental authorization and Waste License Application process for the proposed Tsolo Waste Water Treatment Works upgrade project.

Chris Hani District Municipality - Bulk Services

Conroy is currently managing the environmental authorization and Waste License Application process for the proposed upgrading of the Bulk Services for the proposed Rathwick Development, Queenstown, inclusive of the Waste Water Treatment Works, Water Treatment Works, Stormwater and associated infrastructure.

Chris Hani District Municipality - Water Supply

Conroy is currently managing the environmental authorization process for the Water Supply Backlog projects in the Cluster 2 area of the Chris Hani District Municipality.

Alvitex 103 (Pty) Ltd

Conroy managed the environmental authorization process for a proposed golfing estate development and assisted in the environmental authorization for the sewage works servicing the proposed resort developments, and.

African Dune Investments

Conroy assisted in the environmental authorization for the proposed golf estate development.

Thynk Property Partners (Pty) Ltd

Conroy managed the environmental authorization process for the proposed retail & residential development.

Eskom

Conroy is currently managing the environmental authorization process for the proposed upgrading of the Qumbu Substation and associated infrastructure.

Buffalo City Municipality - Planning and Economic Development

Conroy managed the environmental authorization for various settlement planning & formalization projects in the Amathole district.

The Diocese of Grahamstown

Conroy managed the environmental authorization for the proposed rezoning and residential development of the St Lukes Mission Land.

Bunker Hills Investments (Pty) Ltd

Conroy managed the environmental management plan for the proposed residential development.

Rakel (Pty) Ltd

Conroy assisted in managing the environmental authorization for the proposed residential development and assisted in the environmental impact assessment for the proposed desalination plant servicing the proposed residential development.

Rapitrade (Pty) Ltd

Conroy assisted in managing the environmental management plan for the proposed residential development and managed the applications to the South African Heritage Resources Agency (SAHRA) and the Department of Water Affairs & Forestry.

Golden Falls (Pty) Ltd

Conroy assisted in the environmental authorization and the environmental management plan for the proposed residential development.

Beautiful Connections (Pty) Ltd

Conroy managed the environmental authorization for a proposed wildlife resort in the Queenstown area and the proposed development of Eco-Type chalets in the East London area.

Riverleigh VII cc

Conroy managed the environmental authorization process for the proposed warehousing and light industrial manufacturing processes developments.

Purple Moss 29 (Pty) Ltd

Conroy managed the rehabilitation of the Quenera River bank on the site and the environmental authorization process for the proposed township establishment consisting of business, mixed use and residential areas.

Silicon Smelters (Pty) Ltd (FerroAtlantica)

Conroy managed the environmental impact assessment process and CAPCO permit applications for various charcoal burners in the East Cape, West Cape, Free State, North-West, Limpopo and Gauteng Provinces.

Wild Coast Fishing Co-operative

Conroy assisted in the environmental authorization for the proposed fish works factory.

ELGC

Conroy managed the EIA Process and prepared the rehabilitation management plan for the proposed realignment of the 6th fairway & minor upgrades in order to upgrade the East London Golf Club (ELGC).

This Page Intentionally Left Blank

END