

MYEZO ENVIRONMENTAL MANAGEMENT SERVICES Environmental Stewardship

WEST COAST RESOURCES - NAMAQUALAND MINES ENVIRONMENTAL IMPACT ASSESSMENT

ESTUARINE SPECIALIST STUDY REPORT

Draft for Comment



July 2016



Anchor Environmental Consulting Report No, 1725/1





MYEZO ENVIRONMENTAL MANAGEMENT SERVICES Environmental Stewardship

WEST COAST RESOURCES-NAMAQUALAND MINES ENVIRONMENTAL IMPACT ASSESSMENT

ESTUARINE SPECIALIST STUDY REPORT

For the Amendment of an Environmental Management Programme and Environmental Impact Assessment in Support of a Mining Right held by West Coast Resources (Pty) Ltd over the Namaqualand mines, Northern Cape Province

Draft for Comment July 2016

Report Prepared by:



Anchor Environmental Consultants 8 Steenberg House, Silverwood Close, Tokai 7945, South Africa <u>www.anchorenvironmental.co.za</u>

Authors: Vera Massie and Barry Clark

Cover Photo: Bruce Mostert

Citation: Massie & V, BM Clark 2016. Estuarine specialist study report for the Amendment of an Environmental Management Programme and Environmental Impact Assessment in Support of a Mining Right held by West Coast Resources (Pty) Ltd over the Namaqualand mines, Northern Cape Province. Report prepared for West Coast Resources (Pty) Ltd by Anchor Environmental Consultants (Pty) Ltd.

Table of Contents

1 D)etails	of specialist	1
1.1	D	Details of the specialist who prepared the report;	1
1	.1.1	Specialist 1: Dr Barry Clark	1
1	.1.2	Specialist 2: Vera Massie	
1.2		'he expertise of that specialist to compile a specialist report including a curriculum vitae;	. 1
	.2.1	Curriculum vitae: Dr Barry Clark	
	.3.1	Curriculum vitae: Vera Massie	. 5
		ration that the specialist is independent in a form as may be specified by the competent	
2.1		Barry Clark	
2.2		/era Massie	
		cation of the scope of, and the purpose for which, the report was prepared;	11
		te and season of the site investigation and the relevance of the season to the outcome of the	
		;	12
		ription of the methodology adopted in preparing the report or carrying out the specialised	
•			
5.1		Vater quality	
5.2		ediments	
5.3		Senthic macrofauna	
5.4		rish	
5.5		Birds	
5.6		/ammals	
5.7		Vegetation	
	.7.1	Delineation of the Swartlintjies Estuary	16
		ecific identified sensitivity of the site related to the activity and its associated structures and	
		ıre;	
		ntification of any areas to be avoided, including buffers;	23
		superimposing the activity including the associated structures and infrastructure on the	~~
		ntal sensitivities of the site including areas to be avoided, including buffers;	
		ription of any assumptions made and any uncertainties or gaps in knowledge;	23
10		scription of the findings and potential implications of such finding on the impact of the	~ .
		ctivity, including identified alternatives on the environment;	
10.		Abbreviations	
10.		ilossary of terms used in this report	
10.		Description of the Estuary	
	0.3.1	Catchment and hydrology	
	0.3.2	Physical and chemical characteristics of the estuary	
	0.3.3	Fauna and Flora	
	0.3.4	Management history	
	0.3.5	Current ecosystem health	
	0.3.6	Conservation importance	
10.		mpact Assessment	
	0.4.1	Surf zone, beach- and offshore channel mining	
	0.4.2	Slime dams Obstructions to freshwater inflow	
1 10.	0.4.3		
		References	
11		mitigation measures for inclusion in the EMPr;	
12 12		conditions for inclusion in the environmental authorisation;	
13 14		monitoring requirements for inclusion in the EMPr or environmental authorisation;	
		soned opinionas to whether the proposed activity or portions thereof should be authorised;	
		pinion is that the proposed activity or portions thereof should be authorised, any avoidance,	
		nt and mitigation measures that should be included in the EMPr, and where applicable, the	61
15		n; scription of any consultation process that was undertaken during the course of preparing the	
-		eport;	
		τρυι ι,	<u>u</u> 2

West Coast Resources (Pty) Ltd Impact Assessment Methodology

ii

16	A summary and copies of any comments received during any consultation process and where	
applic	cable all responses thereto; and	62
17	Any other information requested by the competent authority	62

List of Figures

Figure 1	The Swartlintjies Estuarine Functional Zone showing biological and physico-chemical sampling sites (Source: Contour lines provided by WCR)
Figure 2	Past, current and proposed mining activities that impact on the Swartlintjies Estuary
Figure 3	Past, current and planned mining activities and impacts on the Swartlintjies Estuarine
U	Functional Zone
Figure 4	The catchment area (in light blue with dotted boundary) of the Swartlintjies River and its
0	tributaries in relation to the Namaqua National Park (Source: Biodiversity GIS Online Map
	viewer 2016)
Figure 5	Photos of the road that connects Koignaas mine entrance with Hondeklip Bay. The road
U	crosses the river approximately 9 km from the Swartlintjies Estuary mouth and acts as a
	minimally permeable flood attenuating barrier (C). Stagnation and signs of eutrophication
	are evident in the upstream water body (B). Photos were taken on 22 June 2016
Figure 6	Photos of the main haul road situated 3 km upstream of the mouth within the restricted
U	mining concession area of the WCR. This road prevents the river from reaching the
	floodplain. Photo A faces upstream and photo B shows how the intake pipe is elevated at
	least 1 m above the riverbed. Photos were taken on 22 June 2016
Figure 7	Photos of the upper reaches of the Swartlintjies Estuary, approximately 1 km upstream from
C	the estuary mouth. Photo A shows the continuous water body extending from the mouth
	480 m inland. Photo B shows signs of eutrophication in the water body that were found
	approximately 1 km from the mouth. Photo C shows the salt crust and salt crystals that
	overlaid the sediment in all water bodies. Photos were taken on 22 June 2016
Figure 8	Photos of the upper reaches of the Swartlintjies Estuary and its floodplain. Photo A shows
	muddy banks of the upper estuary channel, demonstrating that rainfalls could have
	contributed to relatively high water levels in the estuary. Photo B shows muddy sediment on
	the otherwise dry floodplain (Photo C). Photos were taken on 22 June 201632
Figure 9	Vegetation communities present in the Swartlintjies Estuarine Functional Zone
Figure 10	Photos of flowering terrestrial plants in the Swartlintjies Estuarine Functional Zone. The
	Photos were taken on 22 June 201644
Figure 11	Patches of Sarcocornia perennis (A) and filamentous algae on the water's edge (B). The
	Photos were taken on 22 June 201645
Figure 12	The river channel is shown by the red saltmarsh vegetation (Sarcocornia natalense and
	Sarcocornia pillansii). Transitional vegetation with a mix of saltmarsh and shrub can be seen
	on elevated ground
Figure 13	Photos showing (A) Othonna cylindrical (B) Drosanthemum luderitzii and (C) Amphibolia
	rupis-arcuatae47
Figure 14	Photos of dead millipedes in the dry flood plain (bleached) and drowned in shallow
	hypersaline water. Photos were taken on 22 June 2016
Figure 15	Birds feeding on brine shrimp at the Swartlintjies Estuary mouth (A&B). Photo C: Common
	ostrich footprint approximately 1 km from the mouth (Liebenberg 2008). Photos were taken
	on 22 June 2016
Figure 16	Photos of mammal tracks and faeces in the Swartlintjies Estuarine Functional Zone. The top
	pictures show the dung and tracks of a small unidentified antelope, which is likely to be a
	steenbok or a common duiker. Photo B shows the tracks of a water mongoose (track length
	is approximately 5 cm). Photo C shows the possible tracks of an African civet (track length is
	approximately 5.5 cm). Photos were taken on 22 June 201653

List of Figures

Table 1	Metal concentrations in sediment collected at Site 1-3 compared to the National Oceanic and Atmospheric Administration (NOAA) sediment quality guidelines (where applicable).
	Concentrations are parts per million dry weight, ERL = Effects Range Low
Table 2	Water quality data collected at three sites in the Swartlintjies Estuary on 22 June 2016 37
Table 3	Family and growth form of 36 species that have been identified in the Swartlintjies
	Estuarine Functional Zone (EFZ) to date. The applicable vegetation types for each species
	are marked with X. Some species were not listed in the vegetation types and were allocated
	to likely vegetation types (marked with a red X) (Source: Heinecken 1980 and Anchor
	Environmental Consultants (Pty) Ltd., Vegetation types and associated species lists sourced
	from SANBI). The table also shows the approximate size of the intact extent of each
	vegetation type (in ha) (obtained from Google Earth Pro). Note that approximately 17.8 ha
	of the EFZ have been impacted by mining activities41
Table 4	Birds recorded in the Swartlintjies Estuary (Source: Heinecken 1980; Field visit by Anchor
	Environmental Consultants (Pty) Ltd. on 22 June 2016)50
Table 5	Taxonomic composition of waterbirds in the Swartlintjies Estuary (Source: Heinecken 1980;
	Field visit by Anchor Environmental Consultants (Pty) Ltd. on 22 June 2016)50
Table 6	List of mammals identified in the Swartlintjies EFZ and greater Hondeklip area54
Table 7	The potential impact of surf zone, beach- and offshore channel mining on sedimentation processes in the Swartlintjies Estuary
Table 7	The potential impact of saltwater runoff from the proposed alternative slimes dam site on
Table /	the biodiversity of the Swartlintjies Estuarine Functional Zone
Table 9	
I able 9	The impact of the haul road on the hydrological functioning and biodiversity of the
	Swartlintjies Estuary

I

1

1 Details of specialist

1.1 Details of the specialist who prepared the report;

1.1.1 Specialist 1: Dr Barry Clark

Company: Anchor Environmental Consultants (Pty) Ltd.

Position: Environmental Consultant

Address: 8 Steenberg House, Silverwood Close, Tokai 7945

Phone: 021 701 3420

Fax: 021 701 5280

Email: barry@anchorenvironmental.co.za

1.1.2 Specialist 2: Vera Massie

Company: Anchor Environmental Consultants (Pty) Ltd.

Position: Director

Address: 8 Steenberg House, Silverwood Close, Tokai 7945

Phone: 021 701 3420

Fax: 021 701 5280

Email: vera@anchorenvironmental.co.za

1.2 The expertise of that specialist to compile a specialist report including a curriculum vitae;

1.2.1 Curriculum vitae: Dr Barry Clark

Academic qualifications:

- Ph.D. Marine Biology, 1997, University of Cape Town
- BSc (Hons) Marine Biology, 1991, University of Cape Town
- BSc Zoology and Ocean & Atmosphere Science, 1990, University of Cape Town

Language proficiencies: English (Excellent), Afrikaans (Good)

Country experience: South Africa, Namibia, Mozambique, Tanzania, Kenya, Mauritius, Angola, Ghana, Cote d'Ivoire, Nigeria, Egypt, United Arab Emirates, Azerbaijan

Employment history:

- 1991-1993 Scientific Officer, University of Cape Town
- 2000-2002 Marine Coordinator, Cape Peninsula National Park
- 1996-Present Director, Anchor Environmental Consultants CC
- 2002-Present Research Associate, University of Cape Town

Summary profile:

Dr Barry Clark has twenty-one years of experience in marine biological research and consulting on coastal zone and marine issues. He has worked as a scientific researcher, lecturer and consultant and has experience in tropical, subtropical and temperate ecosystems. His main area of scientific study involved fisheries management and the biology and ecology of marine and estuarine fishes. He is presently Director of an Environmental Consultancy firm (Anchor Environmental Consultants) and Research Associate at the University of Cape Town. As a consultant has been concerned primarily with conservation planning, monitoring and assessment of human impacts on estuarine, rocky shore, sandy beach and temperate and tropical marine fauna and flora as well as coastal and littoral zone processes, aquaculture and fisheries. Dr Clark is the author of 27 scientific publications in class A scientific journals as well as numerous scientific reports and popular articles in the free press. Geographically, his main area of expertise is

West Coast Resources (Pty) Ltd Impact Assessment Methodology

southern Africa (South Africa, Lesotho, Namibia, Mozambique, Tanzania, Seychelles, Mauritius and Angola), but he also has working experience from elsewhere in Africa (Cote d'Ivoire, Ghana, Nigeria), the Middle East (UAE) and Europe (Azerbaijan).

Project experience.

Period	Country	Client	Project, Tasks
2016	South	ACC	Risk assessment for introduction of Camelina savitina as
2010	Africa	Agriculture	a commercial crop into South Africa
			Identification and profiling of priority mangrove sites in
2015	Liberia	Conservation	Liberia through remote sensing and field surveys and
2015	Liberia	International	identification and delineation of two coastal and marine
			protected areas
2015	South	AquaTech	Risk assessment for in-water hull cleaning operations in
2015	Africa	Aquarech	the Port of Durban, South AFrica
2015	Tanzania	Aurecon,	Environmental impact assessment for a supply base for
2015	Tanzania	Schlumberger	Schlumberger in Mtwara port, Tanzania
2015	South Africa	Cape Nature	Environmental flows assessment for the Klein River estuary, South Africa
2015	South	Mossel Bay	Preparation an estuary management plan for the
2015	Africa	Municipality	Hartenbos Estuary
	South	Department of	Development of an assessment framework for
2015	Africa	Environmental	management of effluent discharged from land-based
	Amca	Affairs	sources to the marine environment in South Africa
2015	Seychelles	Raffles Hotel,	Assessment of impacts of diesel spill on mangrove forest
2013		Aurecon	community on Praslin Island, Seychelles
2014-	South Africa	Transnet	Design and implementation of a water and sediment
2015		National Ports	quality monitoring programme in the Port of Durban
		Authority	
2014-	South	Oceana/SRK	Application for a coastal water discharge permit for the
2015	Africa		Lucky Star Fish Processing Plant, St Helena Bay
2014-	South	Coega	Assessment of impacts of waste water discharge from
2015	Africa	Development	Coega Industrial Development Zone, Algoa Bay
2010		Corporation	
2014-		DeBeers	Benthic macrofauna and sediment quality monitoring
2015	Namibia	Marine Namibia	programme for the Atlantic 1 Mining Licence Area, Namibia
2014-	South	Capa Natura	Environmental flow assessment for the Heuningnes
2015	Africa	Cape Nature	estuary, South Africa
		South African	Assessment of the socio-economic impacts of a reduction
2014- 2015	South	Pelagic Fishing	in the sardine minimum Total Allowable Catch (TAC)
	Africa	Industry	
		Association	
2014-	South	Nelson	Assessment of impacts of waste water discharge from a
2014-	Africa	Mandela Bay	new WWTW at Cape Recife, Algoa Bay
2010		Metro, GIBB	

Period	Country	Client	Project, Tasks
			Implementation of the "reef gardening" approach for restoration of coral reefs on Praslin Island, Seychelles,
			lost as a result of El Nino and global warming induced
2014	Seychelles	USAID	bleaching events. Project included establishment of rope
			and net nurseries for growing out coral fragments and
			subsequent transplantation to degraded reef sites
	South	Molapong	Risk Assessment for culture of King and Coho salmon in
2014	Africa	Aquaculture	South Africa
0011	South	NWJ	Impact assessment for a proposed sand mining operation
2014	Africa	Environmental	on the Umzumbe Estuary, KwaZulu-Natal
	Maram	Marine	Scoping study to assess potential impacts of upgrading
2014	Mozam-	Stewardship	the cruise liner facilities at Portuguese Island,
	bique	Council	Mozambique
	South	Bayside	Environmental impact assessment for the
2014	Africa	Aluminium,	decommissioning of the Bayside Aluminium Smelter,
		WSP	Richards Bay
	South	Tronnox	Assessment of impacts of a seawater intake for the
2014	Africa	Namaqua	Tronnox Namaqua Sands mineral processing facility,
		Sands, SRK	Northern Cape
2014	South	AquaConcepts	Risk assessment for import of ornamental marine fish
	Africa		species into South Africa
2014	South	Dormac, WSP	Assessment of impact associated with the development of
	Africa		a floating dry dock in the Port of Durban, South Africa
	South	Transnet	Assessment of potential impacts of the proposed Durban
2014	Africa	National Ports	Dig Out Port of the annual sardine migration up the East
		Authority	coast of South Africa
2014	South	WWF-SA	Design and development of a Fisheries Improvement
	Africa	-	Project for Small Scale Fisheries in the Kogelberg
		Tronnox	Environmental impact assessment for an aquaculture
	South Africa	Namaqua	facility at Doringbaai, Northern Cape
2014		Sands, Matzikamma	
		Municipality,	
		SRK	
			Development of a Spatial Development Framework for
2014	Tanzania	Aurecon	the coastal environment in the Mtwara/Mikandani
	i unzunu		Municipal area, Tanzania
	0		Assessment of the impacts of an oil spill on mangrove
2014	South	WSP/ Engen	forest communities in the Port of Richards Bay, South
	Africa		Africa
		Frontier Rare	Assessment of impacts of a seawater intake for the
2014	South Africa	Earths, Coastal	Frontier Rare Earths mineral processing facility, Northern
2014		Environmental	Саре
		Services	
	South		Rezoning and realignment of borders for Betty's Bay,
2014	Africa	Cape Nature	Goukamma and Robberg marine protected areas in
			South Africa

I

1.2.2 Curriculum vitae: Vera Massie

Academic qualifications:

- MSc Conservation Biology, 2013, University of Cape Town
- BSc (Hons) Environmental Management, 2011, University of Cape Town
- BSc Marine Biology and Environmental Science, 2010, University of Cape Town

Language proficiency: English (excellent), Afrikaans (basic), German (first language), Japanese (second language, basic)

Employment history:

- 2010-2012 Research laboratory assistant (water quality analysis)
- 2012 Marine ecology research field assistant
- 2013-Present Consultant, Anchor Environmental Consultants

Summary profile:

Vera earned degrees in marine biology, environmental management and conservation biology from the University of Cape Town. Her training has equipped her to consult on research projects incorporating the maintenance and conservation of marine and estuarine ecosystems. She also consults on the biophysical, socio-economic and legal aspects in the assessment of human impacts on coastal and terrestrial environments in the temperate and tropical regions of South Africa. Working at Anchor Environmental Consultants, she has gained experience in drafting environmental legislation, preparing guidelines and developing frameworks to facilitate successful implementation of legislation. Many of her projects involve the monitoring and evaluation of compliance with environmental laws and their associated regulations across varying economic sectors.

Period	Client	Project	Tasks	Aspects
2014-2016	Saldanha Bay Water Quality Trust	The State of Saldanha Bay and Langebaan Lagoon	 Ongoing annual ecological monitoring of Saldanha Bay and Langebaan Lagoon 	 Compliance monitoring (water quality) Environmental law and management Field research Data analysis
2014-2016	Transnet	Baseline environmental monitoring study for the expansion of Berth 203-205 in the Port of Durban	 Ongoing quarterly ecological monitoring of the Port of Durban 	Field researchData analysisStatistical analysis
2016	SIROCCON Consulting Engineers & Project Managers; Atlantic Salmon	Prepare a marine specialist study and impact assessment and application for a Coastal Waters Discharge Permit for a land-based salmon farm	 Prepare a Marine Specialist Study and Impact Assessment Prepare an application for a Coastal Waters Discharge Permit in terms of ICMA 	 Assess the impacts of a land- based salmon farm on the marine environment (water quality and ecology) Ensure compliance with ICMA
2016	ACC South Africa	Preparation of a permit application and associated risk assessment for the introduction and growing of <i>Camelina sativa</i> in South Africa	 Prepare a risk assessment in terms of the NEMBA Alien and Invasive Species Regulations Submit an application for a permit in terms of NEMBA Section 65(1) 	 Alien invasive species research Ensure compliance with NEMBA
2016	Abagold Ltd	Prepare and guide application for amendment of Environmental Authorisation	 Prepare a Risk Assessment to assess environmental impacts due to changes to the Abagold combined abalone and seaweed facility since the EA was granted in 2009 Prepare application for amendment of Environmental Authorisation in terms of NEMA Conduct public participation 	 Compliance in terms of NEMA Stakeholder liaison
2016	Overstrand	Preparation of an	 Compile Situation 	 Legislation review

Period	Client	Project	Tasks	Aspects
	Municipality and Onrus Lagoon Preservation Trust	estuary management plan for the Onrus Estuary	Assessment Report Compile Estuary Management Plan Conduct public participation Assist in setting up an Estuary Management Forum Stakeholder consultation report	 Stakeholder liaison
2015-2016	Mossel Bay Municipality	Preparation of an estuary management plan for the Hartenbos Estuary	 Compile Situation Assessment Report Compile Estuary Management Plan Conduct public participation Assist in setting up an Estuary Management Forum Stakeholder consultation report 	 Legislation review and application Management strategies Zonation plans Stakeholder liaison
2015	AquaTech	Risk assessment for in-water hull cleaning operations in the Port of Durban, South Africa	 Establish the environmental risks associated with the in-water diver operated vessel hull cleaning device (water quality and biological invasion) 	 Risk assessment Compliance in terms of NEMBA
2015	Chevron	Prepare a marine specialist study for a Coastal Waters Discharge Permit Application	 Describe the receiving environment Assess impacts on receiving environment 	 Compliance in terms of ICMA
2015	Department of Environmental Affairs	Development of an assessment framework for management of effluent discharged from land-based sources to the marine environment in South Africa	 Review of international legislation, guidelines and management practice Design an assessment framework tailored to the South African context Workshop with government departments and I&APs 	 Review of international legislation Research on effluent and contaminant types and their impacts on the environments Research technical aspects of near-field and far-field modelling of effluent in the receiving environment

Period	Client	Project	Tasks	Aspects
2014	Molapong Aquaculture	Risk Assessment for culture of King and Coho salmon in South Africa	 Prepare a risk assessment in terms of the NEMBA Alien and 	 Implementation of the Integrated Coastal Management Act Alien invasive species research Ensure compliance with
2014	AquaConcepts	Risk assessment for import of ornamental marine fish species into South Africa	 Invasive Species Regulations Provide assistance in obtaining relevant licenses and rights and ensure that the business is in compliance with the MLRA and NEMBA. Complete a Risk Assessment for the facility. 	 NEMBA Ensure compliance with various environmental legislation
2014	CapeNature	Rezoning and realignment of borders for Betty's Bay, Goukamma and Robberg marine protected areas in South Africa	 Manage the stakeholder participation process Produce a stakeholder consultation report 	 Stakeholder liaison Implementation of environmental legislation
2013	Department of Environmental Affairs and Development Planning	Develop Norms and Standards for land- based abalone and trout aquaculture and implementation guidelines	 Prepare Norms and Standards for both sectors Prepare implementation guidelines for both sectors 	 Drafting of legislation Identify all environmental impacts associated with land-based abalone and trout aquaculture Develop norms and standards for the management of these sectors

2 A declaration that the specialist is independent in a form as may be specified by the competent authority;

2.1 Barry Clark

I Barry Clark, as the appointed specialist hereby declare/affirm the correctness of the information provided or to be provided as part of the application, and that I:

- in terms of the general requirement to be independent:
 - other than fair remuneration for work performed/to be performed in terms of this application, have no business, financial, personal or other interest in the activity or application and that there are no circumstances that may compromise my objectivity; or
 - am not independent, but another specialist that meets the general requirements set out in Regulation 13 have been appointed to review my work (Note: a declaration by the review specialist must be submitted);
- in terms of the remainder of the general requirements for a specialist, am fully aware of and meet all of the requirements and that failure to comply with any the requirements may result in disqualification;
- have disclosed/will disclose, to the applicant, the Department and interested and affected parties, all material information that have or may have the potential to influence the decision of the Department or the objectivity of any report, plan or document prepared or to be prepared as part of the application;
- have ensured/will ensure that information containing all relevant facts in respect of the application was/will be distributed or was/will be made available to interested and affected parties and the public and that participation by interested and affected parties was/will be facilitated in such a manner that all interested and affected parties were/will be provided with a reasonable opportunity to participate and to provide comments;
- have ensured/will ensure that the comments of all interested and affected parties were/will be considered, recorded and submitted to the Department in respect of the application;
- have ensured/will ensure the inclusion of inputs and recommendations from the specialist reports in respect of the application, where relevant;
- have kept/will keep a register of all interested and affected parties that participate/d in the public participation process; and
- am aware that a false declaration is an offence in terms of regulation 48 of the 2014 NEMA EIA Regulations.

Signature of the specialist

Name of company: Anchor Environmental Consultants (Pty) Ltd.

Date: 7 September 2016

2.2 Vera Massie

I Vera Massie, as the appointed specialist hereby declare/affirm the correctness of the information provided or to be provided as part of the application, and that I:

- in terms of the general requirement to be independent:
 - other than fair remuneration for work performed/to be performed in terms of this application, have no business, financial, personal or other interest in the activity or application and that there are no circumstances that may compromise my objectivity; or
 - am not independent, but another specialist that meets the general requirements set out in Regulation 13 have been appointed to review my work (Note: a declaration by the review specialist must be submitted);
- in terms of the remainder of the general requirements for a specialist, am fully aware of and meet all of the requirements and that failure to comply with any the requirements may result in disqualification;
- have disclosed/will disclose, to the applicant, the Department and interested and affected parties, all material information that have or may have the potential to influence the decision of the Department or the objectivity of any report, plan or document prepared or to be prepared as part of the application;
- have ensured/will ensure that information containing all relevant facts in respect of the application was/will be distributed or was/will be made available to interested and affected parties and the public and that participation by interested and affected parties was/will be facilitated in such a manner that all interested and affected parties were/will be provided with a reasonable opportunity to participate and to provide comments;
- have ensured/will ensure that the comments of all interested and affected parties were/will be considered, recorded and submitted to the Department in respect of the application;
- have ensured/will ensure the inclusion of inputs and recommendations from the specialist reports in respect of the application, where relevant;
- have kept/will keep a register of all interested and affected parties that participate/d in the public participation process; and
- am aware that a false declaration is an offence in terms of regulation 48 of the 2014 NEMA EIA Regulations.

Note: The terms of reference of the review specialist must be attached.

mana

Signature of the specialist

Name of company: Anchor Environmental Consultants (Pty) Ltd.

Date: 9 July 2016

3 An indication of the scope of, and the purpose for which, the report was prepared;

West Coast Resources (Pty) Ltd (WCR) is a private company owned by Trans Hex Operations (Pty) Ltd (Trans Hex), RE:CM and Calible Limited (RAC), the Government of South Africa, Dinoka Investment Holdings (Pty) Ltd and the Namagualand Diamond Trust Fund. Trans Hex has entered into an agreement with the other shareholders of WCR to oversee and manage the operations WCR. WCR is re-establishing diamond mining operations in the Koingnaas area on the Namagualand coast, which was previously mined by De Beers and under the existing mining environmental authorisation (EA) that was issued in terms of the National Environmental Management Act (Act No. 107 of 1998) in July 2012. As part of their operations, WCR intend to mine deposits that are located on land as well as specific deposits that extend seaward from the land potentially for several hundred metres. While some of the intended activities remain authorised in terms of the existing EA, other activities require a new EA. Myezo Environmental Management Services were appointed by WCR to undertake the Scoping and Environmental Impact Assessment (EIA). The scoping phase was been completed recently and revealed that various specialists would be required to complete the EIA. Henceforth, Anchor Environmental Consultants (Pty) Ltd. were appointed by Myezo Environmental Management Services in June 2016 to conduct a specialist study for the Swartlintjies Estuary. Both, data collected during a site visit in June 2016 as well as existing literature were used to describe the current biophysical state of the estuary. This specialist report assesses future prospecting and mining impacts on estuarine ecology and functioning based on available biophysical data and elaborates on future rehabilitation requirements.

The site visit was conducted in Winter on the 22 June 2016 during sunny weather conditions. The Namaqualand receives most of its rainfall between April and September resulting in episodic peak flows during this time (Heydorn & Tinnley, 1980). The Swartlintjies catchment had received some rain prior to the site visit, which was favourable in assessing biophysical characteristics of the estuary. Firstly, vegetation within the Estuarine Functional Zone had come to life after the rain, which allowed us to identify most plant species. Furthermore, although closed to the sea, the estuary contained some water, attracting a number of water associated bird species, who were feeding primarily on brine shrimp. We were also able to record water quality (water temperature, dissolved oxygen, salinity, conductivity and pH) and to sample benthic macrofauna, which represents the first invertebrate record for the estuary. Finally, wet soils preserved animal foot prints and therefore facilitated the identification of various mammals that visit the estuary and its flood plain.

5 A description of the methodology adopted in preparing the report or carrying out the specialised process;

A site visit was undertaken on 22 June 2016 to collect biophysical data on water quality, sediment characteristics, benthic macrofauna, fish, bird and vegetation. Data and observations from the site visit along with existing literature (Heinecken, 1980) and data (e.g. historic aerial photographs) were used to describe the current biophysical state of the Swartlintjies Estuary and to identify potential impacts of future prospecting and mining activities on the estuary. The impact assessment was completed according the template provided by Myezo Environmental Management Services. The following sections elaborate on the methods used to collect and analyse biophysical data obtained on 22 June 2016.

5.1 Water quality

Water quality measurements for temperature, salinity, conductivity, dissolved oxygen and pH were taken at three sites in the estuary using a handheld Hach water quality meter (Figure 1). Depth profiles were not produced due to the fact that the water was very shallow (< 50 cm deep).

5.2 Sediments

Sediment samples were collected at three sites distributed along the length of the estuary (Figure 1). Samples were placed in sterile sampling jars on ice immediately after collection and submitted to an SANAS accredited analytical laboratory for determination of grain size distribution, as well as organic and trace metal (Al, As, Cd, Cu, Mn, Ni, Pb, Zn, Hg) content.

Data on sediment grain size distribution for both intertidal and subtidal sediments were analysed using GRADISTAT (Blott & Pye 2001). GRADISTAT software automates the process of classifying and characterising sediments both quantitatively and qualitatively.

Sediments were also analysed for concentrations of aluminium (AI), arsenic (As), cadmium (Cd), Copper (Cu), manganese (Mn), nickel (Ni), lead (Pb), zinc (Zn) and mercury (Hg). Trace metals concentrations in the sediments were determined using a Nitric Acid (HNO3) / Perchloric Acid (HCIO3)/ Hydrogen Peroxide (H2O2)/ Microwave digestion and JY Ultima Inductively Coupled Plasma Optical Emission

Spectrometer. The concentrations of metals in the sediments of the Swartlintjies Estuary on 22 June 2016 are shown in (Section 10.3.2.1).

Trace metals were normalised against aluminium by dividing the concentration of each metal by the concentration of aluminium, a procedure commonly conducted for metal analysis (Summers, Wade, Engle, & Malaeb, 1996). As concentrations of metals in sediments are affected by total organic content, sediment grain size, and mineralogy, correct interpretation requires normalising their concentrations rather than using their raw concentrations (Summers et al., 1996). Metal concentrations are commonly normalised against the concentration of aluminium, as aluminium ubiquitously coats all sediments and thus occurs in proportion to the surface area of the sediment (Gibbs, 1994).

5.3 Benthic macrofauna

Benthic macrofauna samples were collected at Site 1 and 2 (Figure 1). The estuary was not connected to the sea at the time of the survey and sampling was therefore not dependent on tidal cycles. Samples were collected by inserting a 14.5 cm diameter corer into the sediment to a depth of 30 cm, plugging the open end, extracting the core and transferring the contents to a 0.5 mm mesh bag. Two cores with a surface area of 0.02 m² were taken and pooled at each sampling station (A-E) of Site 1. Due to shallower water and associated difficulties in processing the sample, only one core was sampled at each sampling station (A-E) of Site 2. The mesh bag was submerged and agitated until all the fine sediment was removed and the remaining contents placed in a sample jar. 5% formalin was added as a preservative. No benthic macrofauna was present in the samples and negated further analysis.

5.4 Fish

Experimental seine netting was conducted using a beach-seine net, 30 m long, 2m deep, with a stretched mesh size of 12 mm at Site 1. No fish were caught due to hypersaline conditions in the estuary, which negated any further sampling and analysis.

5.5 Birds

Water-associated birds (i.e. wading birds, waders, gulls and terns) were identified and counted prior to sediment, benthic macrofauna and fish sampling activities to avoid disturbance. Bird species in the surrounding shrub and flood plain were identified by call and/or sight and counted during a 30 minute walk through the flood plain (Figure 1).

5.6 Mammals

Recent rain had resulted in a muddy terrain, which preserved animal footprints well. Photos of these footprints were taken and identified using The Field Guide to the Animal Tracks of Southern Africa by Liebenberg (2008).

5.7 Vegetation

Vegetation was delineated prior to the field visit using Google Earth imagery and a high resolution aerial photograph dated 2011 and provided by WRC. The preliminary vegetation map was ground truthed by delineating/confirming vegetation groups (i.e. salt marsh, shrub, dune vegetation) and identifying the species that make up these groups. Identification was facilitated by taking photos and vegetation samples. Photos were also taken from higher ground (haul road and edge of flood plain) to

confirm vegetation groups from a birds eye perspective. Lists of important species for specific vegetation types were obtained from the BGIS website (National Vegetation Map 2012 beta2: Map Viewers).

5.7.1 Delineation of the Swartlintjies Estuary

An estuary is defined in terms of the National Environmental Management: Integrated Coastal Management Act (ICMA) (Act No. 24 of 2008) and the NEMA 2014 EIA Regulations as "a body of surface water—

- a. that is permanently or periodically open to the sea;
- b. in which a rise and fall of the water level as a result of the tides is measurable at spring tides when the body of surface water is open to the sea; or
- c. in respect of which the salinity is higher than fresh water as a result of the influence of the sea, and where there is a salinity gradient between the tidal reach and the mouth of the body of surface water."

While this definition is in line with those used internationally in respect of estuary water bodies it is considered somewhat limited inasmuch as it encapsulates only the estuary water body and not the adjacent physical and biological processes and habitats required to support estuarine function and health. Thus, as part of the Estuary Component of the National Biodiversity Assessment (NBA) (Van Niekerk & Turpie, 2012) a definition for the estuarine functional zone (EFZ) was formulated which extended the lateral boundaries of an estuary up to the 5 m contour, with the downstream boundary taken as the estuary mouth and the upstream boundary taken as the limits of tidal variation or salinity penetration, whichever penetrates furthest.

Protection/rehabilitation of the estuarine functional zone is considered essential for protection of estuarine biodiversity and associated ecological processes (Van Niekerk & Turpie, 2012).

The Swartlintjies Estuary has been classified as a small ephemeral river outlet and is not considered one of the 289 functional estuaries in South Africa (Van Niekerk & Turpie, 2012). Using the NBA definition for delineating the extent of the Swartlintjies Estuary would result in a very small and meaningless management unit, which is not practically implementable. Consequently, the extent of the estuary, i.e. the EFZ, was determined according to the 5 m contour above mean sea level (MSL) (Figure 1).



Figure 1 The Swartlintjies Estuarine Functional Zone showing biological and physico-chemical sampling sites (Source: Contour lines provided by WCR).

6 The specific identified sensitivity of the site related to the activity and its associated structures and infrastructure;

None of the proposed land based, surf zone, beach- and offshore channel mining activities are planned to be carried out within the Swartlintjies EFZ. However, mining activities occurring outside the boundaries of the EFZ could have an impact on the estuary and were assessed in Section 10.4.

While the preferred sites for future slimes dams (Sites C and G) are not going to impact on the Swartlintjies Estuary, the alternative (Site 2) to sites A, C and G is situated 9 km upstream of the Swartlintjies Estuary and may be problematic. This alternative site is an existing slimes dam and is located within the Swartlintjies River catchment (Figure 2). Although the prevailing wind carries most of the dried saline sediment to the northeast, it is likely that the surface runoff during episodic rainfall events washes salt from the dam into the Swartlintjies River. This salt will eventually reach the EFZ, impacting on biodiversity through accelerated salinisation. This problem is compounded by the 10-15 m high haul road situated 3 km upstream of the mouth, which runs through the Swartlintjies EFZ and prevents much of the runoff from the catchment reaching the estuary. Pipes in the haul road provide a conduit for water to flow past this barrier, but the inlets for the pipes are elevated at least 1 m above the river bed, which means that very little (if any) water is actually able to pass through this barrier (Figure 3). Prior to the commencement of mining activities in the area, the Swartlintjies River would have come down in flood unhindered during episodic rainfalls, creating a braided flood plain with channels of varying depths (Section 10.3.1). These channels were then colonised by plants during dry periods, creating a biodiverse habitat that reflects the topographic mosaic of the floodplain (Section 10.3.3.1). This suggests that the episodic flooding of the Swartlintjies River

is an important ecological process for maintaining biodiversity of the Swartlintjies

EFZ.



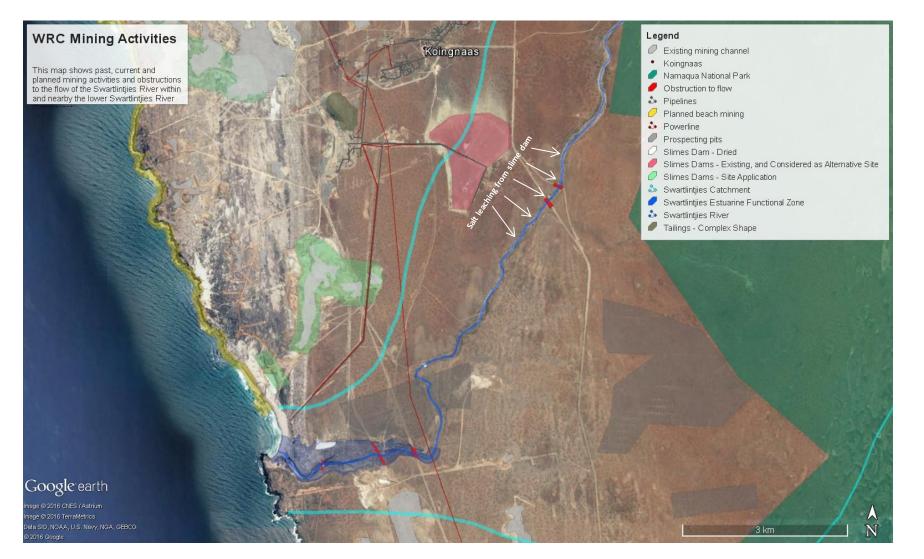


Figure 2 Past, current and proposed mining activities that impact on the Swartlintjies Estuary.

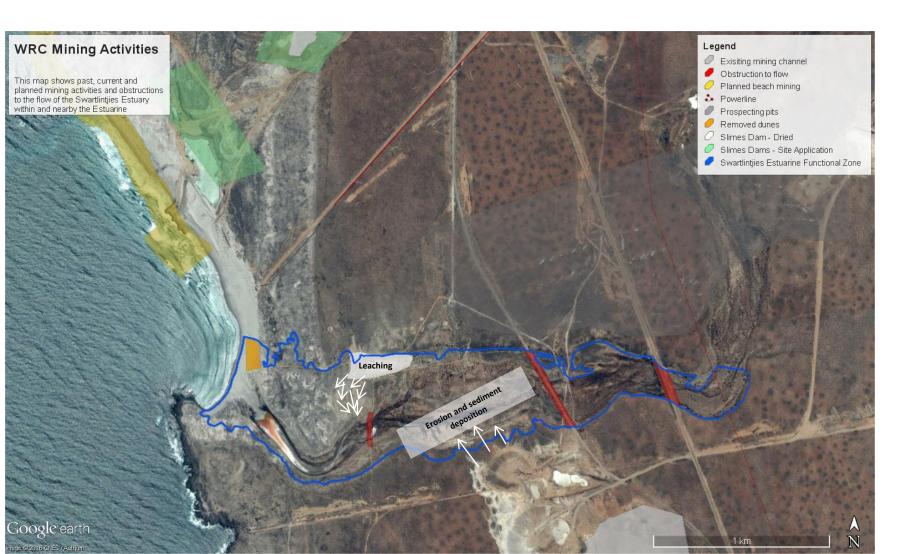


Figure 3 Past, current and planned mining activities and impacts on the Swartlintjies Estuarine Functional Zone.

22

7 An identification of any areas to be avoided, including buffers;

No new and continued use of slimes dams within the Estuarine Functional Zone and the Swartlintjies River catchment should take place (Figure 2 and Figure 3). Further fragmentation of the vegetation by roads and pathways within the EFZ must be prevented.

8 A map superimposing the activity including the associated structures and infrastructure on the environmental sensitivities of the site including areas to be avoided, including buffers;

Refer to Figure 2 and Figure 3.

9 A description of any assumptions made and any uncertainties or gaps in knowledge;

It is unknown whether slimes dams indeed cause significant acceleration of salinisation of the system. It is, however, clear that the obstructions in the catchment and the EFZ have removed any possibility that excess salts can be flushed from the system flush out during episodic flood events. A precautionary approach is therefore highly recommended. This is especially important considering that it remains unknown whether the system will flush sufficiently (magnitude and frequency) under natural conditions (i.e. restored flows).

10 A description of the findings and potential implications of such finding on the impact of the proposed activity, including identified alternatives on the environment;

10.1 Abbreviations

EA	Environmental Authorisation
WCR	West Coast Resources (Pty) Ltd
RAC	RE:CM and Calible Limited
EIA	Environmental Impact Assessment
ECRU	Estuarine and Coastal Research Unit
MAR	Mean Annual Runoff
Mm ³	Million Meters Cubed
SANBI	South African National Biodiversity Institute
GIS	Geographical Information System

10.2 Glossary of terms used in this report

Barchanoid dune	Crescent-shaped and moving forward continually, the horns of the crescent pointing downwind
Benthic	Bottom-living
Berm	A natural or artificially constructed narrow terrace, shelf or ledge of sediment
Endemic	Confined to and evolved under the unique conditions of a particular region or site and found nowhere else in the world.
Episodic	Sporadic and tending to be extreme
Eutrophication	The process by which a body of water is greatly enriched by the natural or artificial addition of nutrients. This may result in both beneficial (increased productivity) and adverse effects (smothering by dominant plant types.
Habitat	Area or natural environment in which the requirement of a specific animal or plant are met
Hummock dune	A low rounded hillock or mound of sand
Hydrology	The study of water, including its physical characteristics, distribution and movement
Salinity	The proportion of salts in pure water, in parts per thousand by mass. The mean figure for the sea is 34.5 parts per thousand

10.3 Description of the Estuary

10.3.1 Catchment and hydrology

The Swartlintjies Estuary is situated on the West Coast of South Africa, approximately 6.5 km south of Hondeklip Bay within a strict security area of the Koignaas mining concession, which was previously mined by De Beers and where WCR is currently re-establishing diamond mining operations. The estuary is situated within the cool temperate biogeographic region of South Africa (Harrison, Cooper, & Ramm, 2000) and spans the Kamiesberg and Nama Khoi Local Municipalities (part of the Namaqua District Municipality) in the Northern Cape Province. The estuary is fed by the Swartlintjies River, which is approximately 65 km long with a catchment size of 1748.48 km² (RSA DWA, 2009) (Figure 4).

The ephemeral Swartlintjies River only flows for short periods of time after rainfall events which occurring mostly between April and August. The Swartlintjies river and its tributaries have zero flow for more than 75% of the time and hence the catchment receives a low Mean Annual Runoff (MAR) of 1.45 Mm³ (RSA DWA, 2009). The riverbed in the upper catchment is deeply incised and the presence of braided channels indicates that the river should, if unhindered, come down in flood during episodic rainfall events (Heinecken, 1980). As is the case with other west coast rivers, the Swartlintjies is young in geological terms and is fast flowing when in flood. Such floods cause considerable erosion and the river is expected to deposit its silt load in the coastal flood plain (Heinecken, 1980; RSA Department of Agricultural Technical Services, 1975).

Flow in the lower catchment and into the estuary has been severely reduced as a result of the result of the construction of roads through the riverbed. The road connecting Hondeklip Bay with the Hondeklip Bay with the Koingnaas mining entrance crosses the river 9 km from the mouth connecting mouth connecting the river on either side by a pipe with a diameter of approximately 50 cm. The pipe 50 cm. The pipe is not visible on the upstream side of the gravel road and it is suspected that the inlet suspected that the inlet is buried, causing the road to act as a flood attenuating, and minimally minimally permeable barrier (

Figure 5). The haul road situated 3 km upstream of the mouth within the restricted mining concession area of the WCR represents another barrier to the flow of the Swartlintjies River, preventing runoff from much of the catchment from reaching the estuary and the river from reaching the floodplain. In an attempt to connect the river to the estuary, a number of pipes have been buried in the gravel of the

haul road. These pipes are, however, ineffectual as the inlets for the pipes are elevated approximately 1 m above the river bed (

Figure 6). Two smaller roads situated 1 km and 2.2 km from the mouth are no longer

in use but are still in place and are further impeding the very limited flow that would

otherwise reach the estuary.

Two small excavated trenches on the estuary banks just north of the estuary mouth

contained stagnant and eutrophic water at the time of the field survey for this study.

At the time of the ECRU survey in 1980, these trenches contained water to a depth

of 20 cm. The water level in these hollows was approximately 1.25 m below the level

of the dry riverbed, indicating a relatively high water table.

Rainfall had been followed by spring tide conditions (high tide approximately 1.75 m on 22 June) on on 22 June) on the day of the field visit (South African Navy, 2016). The estuary was filled with filled with hypersaline seawater of up to 50 cm depth and a continuous water body extended extended approximately 450 m inlands from the berm (Figure 7). Stagnant pools and water in narrow channels extended up to approximately 980 m upstream above this point. The presence of recent and bleached dried kelp 500 m upstream coincides with observations made during the Estuarine and Coastal Research Unit (ECRU) survey on 16 October 1980, and indicates that seawater regularly penetrates the river outlet at spring tide. Hypersaline conditions and stagnant water with signs of eutrophication 980 m from the mouth (Figure 7) indicates that seawater possibly penetrates 1 km inland during spring tide and evaporates slowly, thereby forming a salt crust (Figure 7) until the next spring tide occurs. It is, however, possible that rainfall prior to the field visit also contributed to the amount of water that was present in the upper reaches of the estuary. The impact of the rain was evident in very muddy conditions in depressions on the floodplain and on the banks of the narrow channels (

Figure 8).



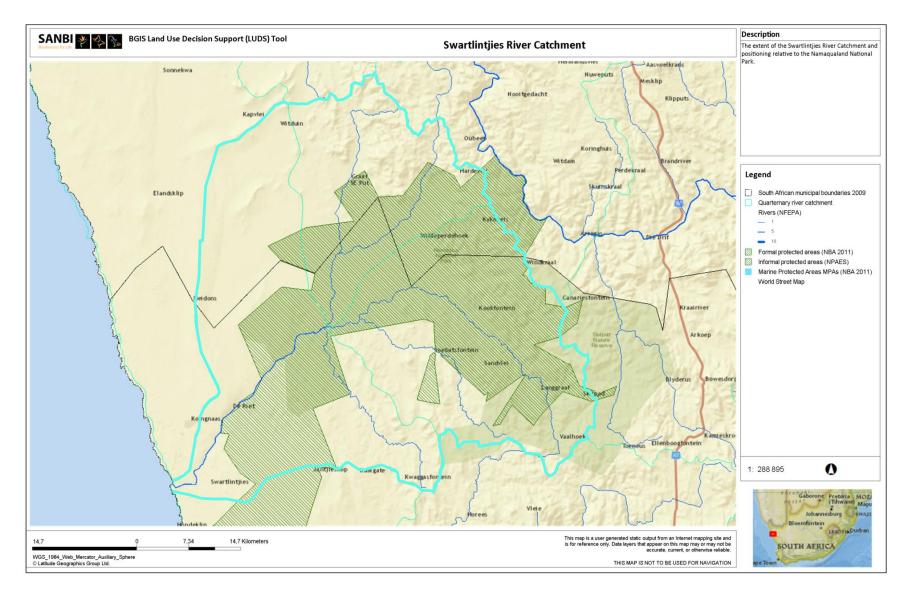


Figure 4 The catchment area (in light blue with dotted boundary) of the Swartlintjies River and its tributaries in relation to the Namaqua National Park (Source: Biodiversity GIS Online Map viewer 2016).

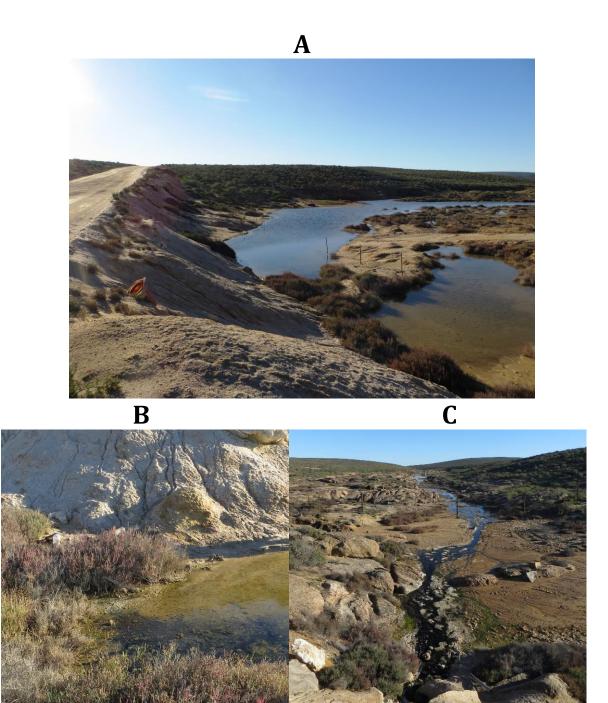


Figure 5 Photos of the road that connects Koignaas mine entrance with Hondeklip Bay. The road crosses the river approximately 9 km from the Swartlintjies Estuary mouth and acts as a minimally permeable flood attenuating barrier (C). Stagnation and signs of eutrophication are evident in the upstream water body (B). Photos were taken on 22 June 2016.

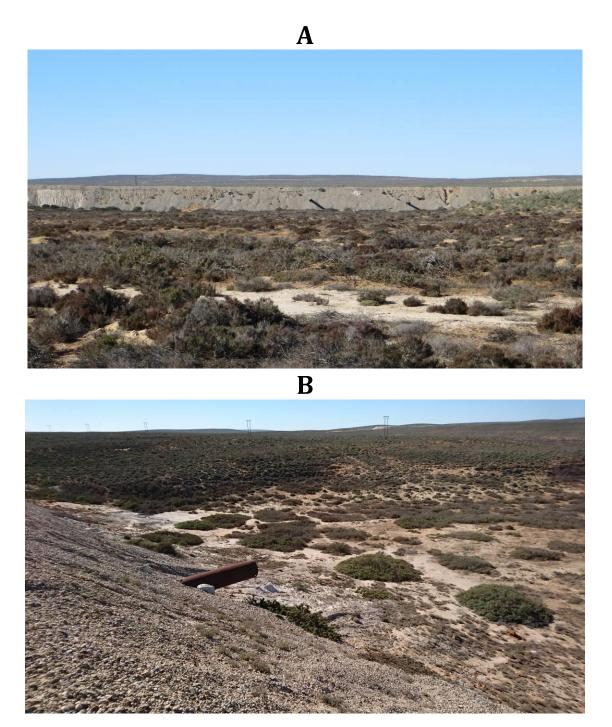


Figure 6 Photos of the main haul road situated 3 km upstream of the mouth within the restricted mining concession area of the WCR. This road prevents the river from reaching the floodplain. Photo A faces upstream and photo B shows how the intake pipe is elevated at least 1 m above the riverbed. Photos were taken on 22 June 2016.

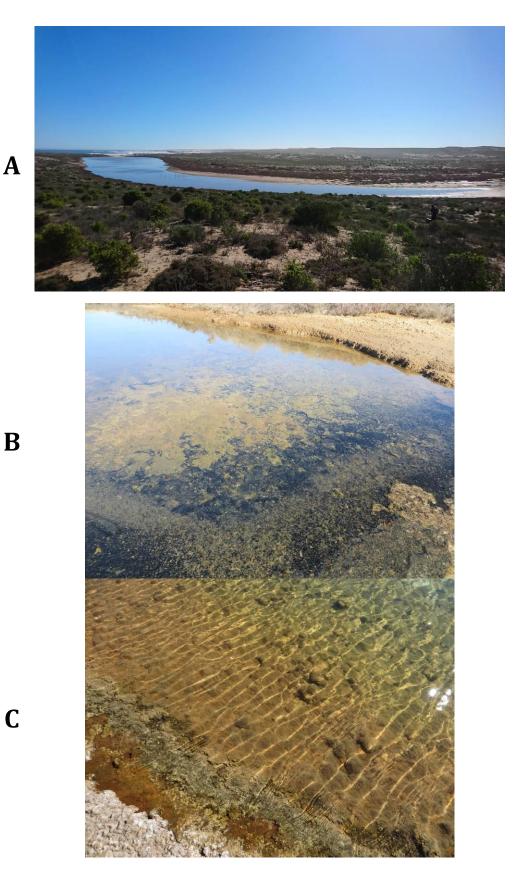


Figure 7 Photos of the upper reaches of the Swartlintjies Estuary, approximately 1 km upstream from the estuary mouth. Photo A shows the continuous water body extending from the mouth 480 m inland. Photo B shows signs of eutrophication in the water body that were found approximately 1 km from the mouth. Photo C shows the salt crust and salt crystals that overlaid the sediment in all water bodies. Photos were taken on 22 June 2016.

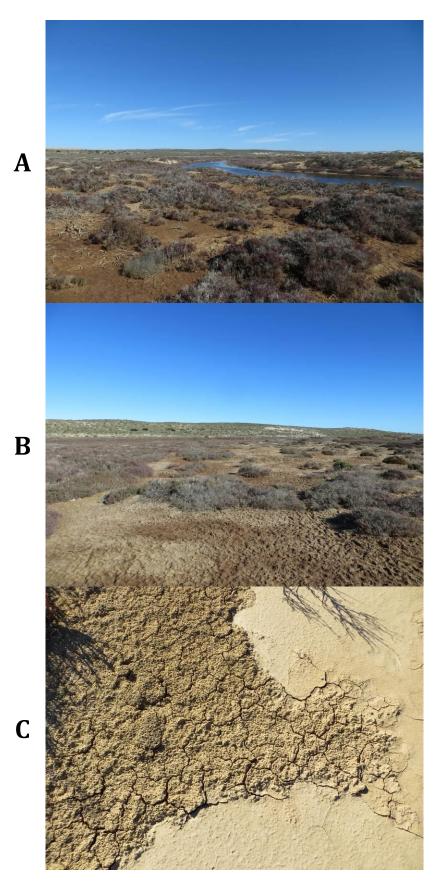


Figure 8 Photos of the upper reaches of the Swartlintjies Estuary and its floodplain. Photo A shows muddy banks of the upper estuary channel, demonstrating that rainfalls could have contributed to relatively high water levels in the estuary. Photo B shows muddy sediment on the otherwise dry floodplain (Photo C). Photos were taken on 22 June 2016.

10.3.2 Physical and chemical characteristics of the estuary

The Swartlintjies EFZ covers 1.37 km². The lower reaches of the Swartlintjies riverbed is characterised by two extended meanders that widen out into the floodplain that was created by an extensive network of braided flood channels. The floodplain is approximately 400 m wide and 1.8 km long. The riverbed then narrows into a channel that is flanked by low-lying vegetated dunes but widens again slightly towards the mouth, which opens northwards into a small bay (Heinecken, 1980). Low hummock dunes can be found south of the flat sandbar (approximately 0.5 m above Mean High Water Spring tide level) (Heinecken, 1980) that separates the river outlet from the sea. Parts of the barchanoid dunes to the north of the mouth were removed permanently during trench excavation in the past (Section 10.3.3.1).

10.3.2.1 Geology and sediments

The basement rock of the area falls within the Namaqualand –Natal belt of metamorphism and granitisation and is overlain by a number of sedimentary sequences. The sediments of the Swartlintjies Estuary and surroundings are derived from these sequences and are locally known as the Koignaas Complex (Heinecken, 1980). The soil type has been categorised as "Red and yellow, well drained sandy soils with high base status" (SANBI, 2016a). More detailed information was provided by Heinecken (1980), who described three distinct bands of surface soil formations. The triangle of barchanoid dunes north of the estuary were not vegetated in 1980 but have since then been colonised by Namaqualand Seashore Vegetation (SANBI, 2016b) (Section 10.3.3.1). However, these dunes have been largely destroyed by mining activities along the coast. Inland of the barchanoid dunes, a band of

vegetated white dunes approximately 400 m wide were followed by vegetated red sands with darker termitaria "heuweltjies" extending inland.

A 1 cm salt crust covered grey riverbed sand mixed with black organic sludge. Particle size analysis of the sediment showed that sand was coarse and poorly sorted at the mouth, suggesting the presence of marine sediments that were transported into the lower estuary by spring tides. At Sites 2 and 3, the sand was medium-grained and sorted moderately and poorly respectively (classification according to Forbes and Demetriades (2003)). The organic content (measured as Total Organic Carbon) of the riverbed sand underlying the water bodies was high at all sites with an average of 11.1 ± 1 %. It is generally accepted that organic content > 4% is indicative of a eutrophic system (Forbes & Demetriades, 2003). Heinecken (1980) also described a black organic sludge near the surface of the dry river bed, although this was covered by a thin layer of light grey fine sand instead of a salt crust. A sediment core taken in the dry riverbed during the ECRU survey showed that black organic sludge was separated by a thin layer of rust coloured fine sand and medium to coarse grained sand at 6 cm and 44 cm depths, respectively. This black organic sludge overlaid fine grey sand (Forbes & Demetriades, 2003).

Trace metal levels in the estuary sediments were compared with guideline screening levels published by The National Oceanic and Atmospheric Administration (NOAA), which cover a broad spectrum of concentrations from toxic to non-toxic levels as shown in Table 1. The Effects Range Low (ERL) represents the concentration at which toxicity may begin to be observed in sensitive species. The ERL is calculated as the lower 10th percentile of sediment concentrations reported in literature that co-occur with any biological effect.

The metal concentrations in the sediment collected at the Swartlintjies Estuary were all below the ERL threshold, except for Cadmium at Site 2, which exceeded the threshold by $0.1 \mu g/g$. It was not only Cadmium that was elevated at this site. All of the trace metals that were assayed at this site were elevated, indicating that this location acts as a trace metal sink.

It is unlikely that the high metal levels occur as a result of point source pollution, but rather as a result of accumulation over time. Due to the obstructions to freshwater flow within the lower catchment and EFZ (Section 10.3.1), the estuary has not, for a while, experienced floods with the capacity to flush sediments, salts and trace metals to sea.

Manganese levels in the estuary are high, however, it has been shown that substrate along the west coast of South Africa is naturally high in Manganese (. Overall, the diamond mining industry does not use chemicals for the processing of diamonds and is therefore not considered to pollute the environment (with the exception of salinisation as a result of the seawater used for diamond washing).

Table 1	Metal concentrations in sediment collected at Site 1-3 compared to the National
Oceanic and	Atmospheric Administration (NOAA) sediment quality guidelines (where
applicable). C	Concentrations are parts per million dry weight, ERL = Effects Range Low.

Metal	Effect Range- Low (μg/g)	Site 1	Site 2	Site 3
Arsenic	8.2	0.2	3.6	1.3
Cadmium	1.2	0.3	1.5	0.4
Copper	34	3.7	11.4	3.6
Lead	46.7	2.6	15.1	4
Mercury	0.15	34.6	138.5	34.6
Nickel	20.9	9.1	17.3	10.3
Zinc	150	12.5	67.6	14
Aluminium	-	0.79	3.58	1.48
Manganese	-	299	634.8	268.1

10.3.2.2 Water quality

The Swartlintjies estuary was dry during the ECRU Survey that was carried out in October 1980 and therefore water quality data collected during the field visit on 22 June 2016 represents the first record for the Swartlintjies Estuary.

Hypersaline conditions prevailed at all three sites within the EFZ (Figure 1), with conductivity ranging from 147-172 mS/cm (> 100 ppt salinity) (Table 2). The primary reason for hypersalinity is the regular intrusion of seawater during spring tides. Seawater enters the riverbed and remains trapped behind the berm, evaporating slowly and leaving salts behind. This is combined with the fact that episodic floods no longer reach the estuary due to obstructions to flow in the lower catchment and the EFZ. The little surface water runoff that occurs within the EFZ during rainfall events between April and September are not enough to temporarily dilute the water. Rainfall also carries salts from sediments outside the EFZ into the riverbed, which is responsible for the saline conditions within the dry flood plain (saltmarsh vegetation dominates in the main river channel). Generally, the Namaqualand area experiences higher evaporation rates than precipitation, which naturally leads to the formation of salt pans (Heinecken, 1980; RSA DWA, 2009). Lastly, it is possible that the abandoned slimes dam north of the estuary leaches additional salt into the riverbed. A saltpan is present in the river bed below the abandoned slime dam (Figure 3).

Water temperature gradually increased from the mouth upstream, although it must be noted that the first reading was taken at the mouth in the late morning and the last reading in the upstream river (9 km from the mouth) was taken in the late afternoon. Dissolved oxygen was relatively high and did not indicate eutrophic conditions, although the sediments underneath the salt crust were classified as eutrophic based on the organic content (Section 10.3.2.1).

The water was slightly basic near the mouth (pH > 7.3) and neutral in the upper estuary and in the river (pH 6.6-7.3). The spatial variability can be attributed to the inverse relationship between temperature and pH.

Table 2 Water quality data collected at three sites in the Swartlintjies Estuary on 22 June 2016.

Site	Temperature (°C)	Conductivity (mS/cm)	Dissolved oxygen (mg/l)	Dissolved oxygen (% saturation)	рН
Site 1	11.8	147	10.72	102	7.54
Site 2	18.1	172	14.81	155.5	7.42
Site 3	17.6	166	10.64	106	7.33
River (9 km from the mouth)	18.0	67.9	11.88	125	7.25

10.3.3 Fauna and Flora

Only specialised organisms can exist and thrive in the extreme hypersaline conditions of this estuary (>100 ppt). Artemia is a genus of aquatic crustaceans known as brine shrimp, which are adapted to such conditions and were found in the water column during the field visit. A variety of wading birds and waders were feeding on the brine shrimp throughout the day. No fish or benthic invertebrates were found in the estuary and these groups have therefore been omitted from the sections below.

10.3.3.1 Flora

A total of 36 semi-aquatic and terrestrial plant species from 15 families have been identified within the Swartlintjies EFZ to date (Table 3). *Leipoldtia sp.* could not be identified to species level with confidence. The growth form shows that it could be *Leipoldtia frutescens*, which is listed as vulnerable on the Red List of South African

West Coast Resources (Pty) Ltd Impact Assessment Methodology

Plants (SANBI, 2016c). Although all other species that were identified have not been listed as threatened on the Red List of South Africa (i.e. least concern), three species are endemic to South Africa, namely *Limonium equisetinum*, *Chaetobromus involucratus subsp. Dregeanus* and *Eragrostis sabulosa*. The latter two species are important and unique to the Namaqualand Strandveld and Namaqualand Coastal Duneveld respectively (Table 3).

The National Vegetation Map published by the South African National Biodiversity Institute (SANBI) Institute (SANBI) provides a rough guide to the vegetation types and associated species that can be species that can be expected to occur in the Swartlintjies EFZ and surroundings. This rough guide This rough guide was then ground truthed during the field visit on 22 June 2016, from which a more from which a more detailed vegetation map was produced in Google Earth Pro (

Figure 9). The vegetation in the EFZ had come to life after the rainfall event prior to

the field trip with some species being in flower (Figure 10).

The only species found at the Swartlintjies Estuary which could be considered as

semi-aquatic when water is present in the system are the saltmarsh plants such as

Sarcocornia natalense, Sarocornia pillansii and Eragrostis sabulosa, which is also

present along the coast just above High Spring tide level (Heinecken, 1980).

Seashore vegetation can be found in near the mouth on the dunes and extends as a thin band north thin band north and south of the estuary encompassing the beach and dune fields (note that this (note that this excludes Namaqualand Coastal Duneveld Vegetation type (

Figure 9)). Seven species unique to this vegetation type have been identified to date (Table 3). At the estuary mouth, patches of *Sarcocornia perennis* on slightly elevated beach sand were present avoiding inundation by regular penetration of the sea during spring tide (Figure 11). Filamentous algae were growing on the edge of the water body near the mouth and further upstream (

Figure 11).

The riverbed and core of the floodplain provides suitable conditions for Arid Estuary Salt Marsh. Perennial *Sacrocornia natalensis* and *Sarcocornia pillansii* were found to dominate the main river channel on the floodplain, where salt has accumulated over time (

West Coast Resources (Pty) Ltd Impact Assessment Methodology

Figure 12). Away from the main river channels, less pronounced channels could be found which were characterised by transitional vegetation with a mix of salt marsh species and various shrubs types (Figure 9 and Table 3). A variety of succulent shrubs was found on ground slightly elevated relative to the old channels (as little as 0.5 m) and included species such as *Othonna cylindrica, Drosanthemum luderitzii* and *Amphibolia rupis-arcuatae* (Figure 13). Prior to mining activities in the area, the Swartlintjies River came down in flood unhindered during episodic rainfalls, creating a braided flood plain with channels of varying depths (Section 10.3.1). These channels were then colonised during dry periods, creating a biodiverse habitat that reflects the topographic mosaic of the floodplain. This shows that the episodic flooding of the Swartlintjies River is an important ecological process for maintaining biodiversity of the Swartlintjies EFZ. The elevated edges of the floodplain transitioned to the surrounding vegetation type, namely Namaqualand Coastal Duneveld to the northwest and south of the EFZ.

Although the vegetation in the Swartlintjies EFZ is still largely intact, several areas, amounting to 17.8 amounting to 17.8 ha have been impacted by previous mining activities (

Figure 9). A large strip of barchanoid dunes was removed north of the estuary mouth, while the northern portion of the EFZ has been fragmented by an old slimes dam and roads leading to and away from this area. The slimes dam also seems to have leached on the western side towards the river channel, leaving only sparse vegetation behind. The old and current haul roads through the EFZ have also fragmented the vegetation in places. The mining area south of the EFZ is a source of sediment that erodes towards the EFZ during episodic rainfall events and has resulted in sparser vegetation on the edges of the EFZ.

39


Table 3 Family and growth form of 36 species that have been identified in the Swartlintjies Estuarine Functional Zone (EFZ) to date. The applicable vegetation types for each species are marked with X. Some species were not listed in the vegetation types and were allocated to likely vegetation types (marked with a red X) (Source: Heinecken 1980 and Anchor Environmental Consultants (Pty) Ltd., Vegetation types and associated species lists sourced from SANBI). The table also shows the approximate size of the intact extent of each vegetation type (in ha) (obtained from Google Earth Pro). Note that approximately 17.8 ha of the EFZ have been impacted by mining activities.

Family	Growth form	Scientific name	Namaqualand Seashore Vegetation	Namaqualand Coastal Duneveld	Namaqualand Stranveld	Arid Estuarine Saltmarsh	Namaqualand Saltpans
	Total ar	rea within the EFZ	10.6 ha	17.7 ha	3.4 ha	36.3 ha	N/A
Aizoaceae	Low Shrubs	Galenia fruticosa		Х	Х		
Aizoaceae	Succulent Shrubs	Tetragonia fruticosa	Х	Х	Х		
Aizoaceae		Amphibolia laevis	X	Х	Х		
Aizoaceae		Leipoldtia sp (possibly Leipoldtia frutescens)		Х	Х		
Amaranthaceae		Sarcocornia pillansii				Х	
Amaranthaceae		Sarcocornia perennis	Х				
Asparagaceae	Low Shrubs	Asparagus capensis var littoralis	Х	Х			
Asteraceae	Succulent Shrubs	Othonna floribunda (Synonym Crassothonna floribunda)	Х				
Asteraceae	Succulent Shrubs	Othonna cylindrica (Synonym Crassothonna cylindrica)		Х	Х		
Asteraceae	Succulent Shrubs	Arctotis decurrens(Synonym Arctotis scullyi)	Х				
Asteraceae	Succulent Shrubs	Didelta carnosa (L.f.) Aiton var. tomentosa (Less.) Roessler	Х	Х			
Asteraceae	Succulent Herbs	Arctotheca populifolia	Х				
Asteraceae	Succulent Shrubs	Othonna sedifolia		Х	Х		
Asteraceae	Herb	Gazania sp. Cf. rigida	Х	Х			
Asteraceae	Herb	Oncosiphon suffruticosum		Х	Х		
Chenopodiaceae	Succulent Shrubs	Salsola aphylla					Х
Chenopodiaceae	Succulent Shrubs	Sarcocornia littorea	Х				
Chenopodiaceae	Succulent Shrubs	Sarcocornia natalensis				Х	
Ebenaceae	Tall Shrubs	Euclea racemosa		Х	Х		
Fabaceae	Low Shrubs	Lebeckia cinerea	Х	Х			

West Coast Resources (Pty) Ltd Impact Assessment Methodology

Family	Growth form	Scientific name	Namaqualand Seashore Vegetation	Namaqualand Coastal Duneveld	Namaqualand Stranveld	Arid Estuarine Saltmarsh	Namaqualand Saltpans
	Total ai	rea within the EFZ	10.6 ha	17.7 ha	3.4 ha	36.3 ha	N/A
Frankeniaceae	Low Shrub	Frankenia repens	Х				
Malvaceae	Low Shrubs	Hermannia pfeilii			X (?)		
Mesembryanthemaceae	Succulent Shrubs	Lampranthus sp.			X (?)		
Mesembryanthemaceae	Succulent Shrubs	Drosanthemum luderitzii	Х				
Mesembryanthemaceae	Succulent Shrubs	Amphibolia rupis-arcuatae	Х	Х			
Mesembryanthemaceae	Succulent Shrubs	Stoeberia utilitis	Х	Х	Х		
Mesembryanthemaceae	Succulent Herbs	Mesembryanthemum crystallinum (synonym: guerichianum)	Х				Х
Molluginaceae	Succulent Shrubs	Hypertelis (Kewa) angrae-pequenae	Х				
Molluginaceae		Pharnaceum microphyllum			X (?)		
Plumbaginaceae	Herb	Limonium equisetinum	Х				Х
Poaceae	Graminoids	Chaetobromus involucratus subsp. Dregeanus			Х		
Poaceae	Graminoids	Cladoraphis cyperoides (synonyms Eragrostis cyperoides)	Х	Х	Х		
Poaceae	Graminoid	Eragrostis sabulosa		Х			
Poaceae	Graminoids	Sporobolus virginicus	Х			Х	Х
Solanaceae	Succulent Shrubs	Lycium sp.	X (?)				
Zygophyllaceae	Succulent Shrubs	Zygophyllum morgsana	Х	Х	Х		



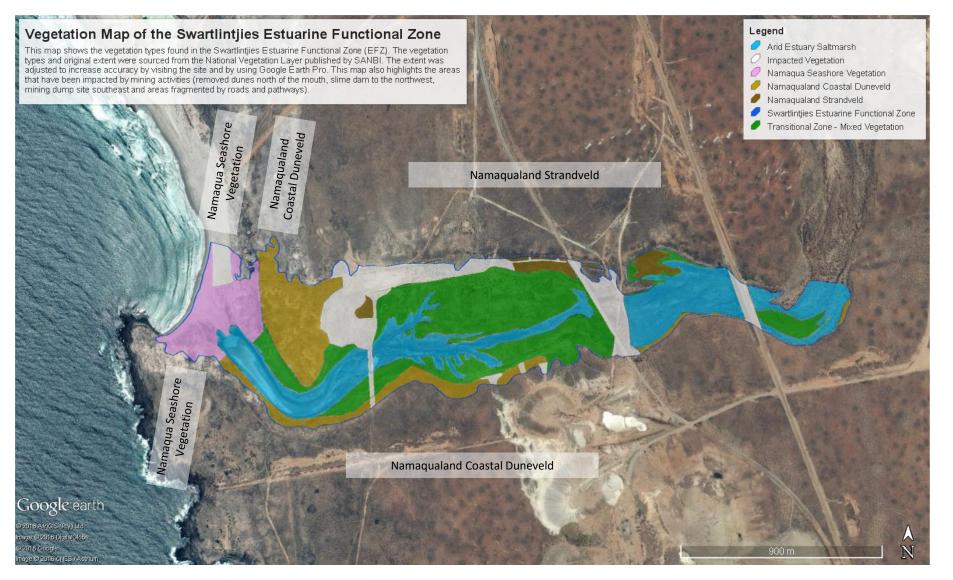



Amphibolia laevis

Othonna cylindrica



Oncosiphon suffruticosum

Unidentified succulent



Unidentified succulent



Figure 10 Photos of flowering terrestrial plants in the Swartlintjies Estuarine Functional Zone. The Photos were taken on 22 June 2016.



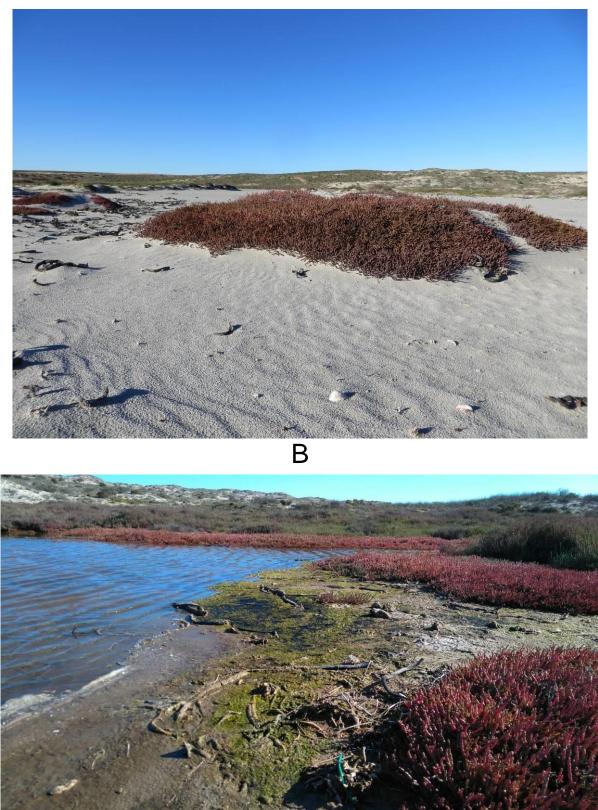


Figure 11 Patches of *Sarcocornia perennis* (A) and filamentous algae on the water's edge (B). The Photos were taken on 22 June 2016.



Figure 12 The river channel is shown by the red saltmarsh vegetation (*Sarcocornia natalense and Sarcocornia pillansii*). Transitional vegetation with a mix of saltmarsh and shrub can be seen on elevated ground.

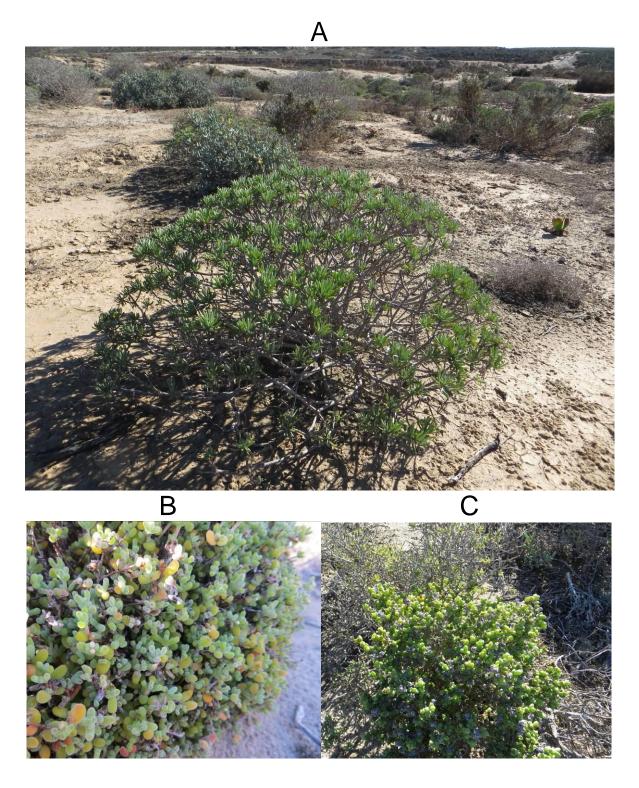


Figure 13 Photos showing (A) *Othonna cylindrical* (B) *Drosanthemum luderitzii* and (C) *Amphibolia rupis-arcuatae*.

10.3.3.2 Insects and other invertebrates

During the ECRU survey in 1980, Heinecken (1980) found a hydrophilid beetle (*Berosus spretus*) at the saline pools in the estuary. The bladder grasshopper (*Pneumoridae*) and a tenebrionid beetle were collected in the vicinity of the estuary. Casts of the marine crabs *Guinusia chabrus* and *Ovalipes punctatus* were found at the edges of the dry estuary, which were likely washed into the estuary by the springtide or when the mouth had been opened artificially at the beginning of the year. Dead millipedes were found in the dry floodplain and in on the edges of the hypersaline water Figure 14.



Figure 14 Photos of dead millipedes in the dry flood plain (bleached) and drowned in shallow hypersaline water. Photos were taken on 22 June 2016.

10.3.3.3 Birds

A total of 26 bird species have been recorded at the Swartlintjies Estuary and on the floodplain to date (Table 4). The waterbirds of the Swartlintjies Estuary can be divided into five taxonomic orders, the most species-rich being the Charadriiformes, which include the waders, gulls and terns (Table 5).

At the time of this survey, a family of greater flamingos, avocets, black-winged stilts and possibly also the Cape teals (omnivorous) were feeding on brine shrimp near the mouth (Figure 15 A&B). Hartlaub's gull and kelp gull were resting on the banks, while the Antarctic tern and pied crow flew overhead. Cape wagtails, white-fronted plovers and the common-ringed plover were feeding in the mud and shallow water near the edges of the water body. A number of passerines were also seen on the estuary banks and during a 30 minute transect walk through the dry flood plain. These included, Cape long-billed larks, grey-backed cisticola, bokmakierie and flocks of yellow canaries. Rufous-eared warbler and Karoo prinia were also frequently heard on the flood plain. The common ostrich roams the EFZ, which is evident by footprints in muddy parts of the upper estuary and the floodplain (

Figure 15).

The seasonal effect on bird species composition (types of species and abundance) of the Swartlintjies Estuary is well pronounced. In comparison to the species found during this survey, summer migratory waders, including sanderling and curlew sandpiper, were present in large numbers at the estuary in October 1980 (Table 4). Furthermore, the estuary was dry at that time and water was only available in the excavated trenches north of the estuary mouth (Heinecken, 1980) and would have been too deep to provide feeding grounds for flamingos, avocets and black-winged stilts. It is apparent that when the estuary contains water, the hypersaline conditions produce a thriving population of brine shrimp, which in turn support a number of bird species.

Table 4 Birds recorded in the Swartlintjies Estuary (Source: Heinecken 1980; Field visit by Anchor Environmental Consultants (Pty) Ltd. on 22 June 2016).

Common name	Scientific name	ECRU survey 16 October 2016	Anchor Environmental 22 June 2016
Cape Teal	Anas capensis		11
South African Shelduck	Tadorna carna	6	
Red-knobbed Coot	Fulica cristata	10	
Greater flamingo	Phoenicopterus ruber		17 (including 5 juveniles)
White-fronted plover	Charadrius marginatus	19	7
Diack wingood stilt	Himantopus	2	30
Black-winged stilt	himantopus	1	6
Pied avocet	Recurvirostra avosetta	2	0
Three-banded plover	Charadrius tricollaris		
Sanderling	Calidris alba	12	
Curlew sandpiper	Calidris ferruginea	23	
Blacksmith lapwing	Vanellus armatus	4	
Common-ringed plover	Charadrius hiaticula		1
Kelp gull	Larus dominicanus		1
Hartlaub's gull	Larus hartlaubii		2
Antarctic tern	Sterna vittara		1
Cape wagtail	Motacilla capensis	6	3
Grey-backed cisticola	Cisticola subruficapilla		11
African stonechat	Saxicola torquatus	2	6
Yellow canary	Crithagra flaviventris		10
Bokmakierie	Telophorus zeylonus		3
Cape long-billed lark	Certhilauda curvirostris		7
Rufous-eared Warbler	Malcorus pectoralis		2
Southern double-			1
collared sunbird	Cinnyris chalybeus		
Karoo prinia	Prinia maculosa		2
Pied crow	Corvus albus	3	2
Sand martin	Riparia riparia	2	11
Common ostrich	Struthio camelus		? (Footprints)

Table 5 Taxonomic composition of waterbirds in the Swartlintjies Estuary (Source: Heinecken1980; Field visit by Anchor Environmental Consultants (Pty) Ltd. on 22 June 2016).

Common groupings	Order	No. SA resident species	No. of migrant species
Waterfowl	Anseriformes (Ducks, geese)	2	
	Gruiformes (Rails, crakes, gallinules, coots)	1	
Wading birds	Phoenicopteriformes (Flamingos)	1	
Waders	Charadriiformes (Sandpipers, stints, 'shanks', stilts, plovers etc)	5	3
Gulls, terns	Charadriiformes	2	1
Wagtails	Passeriforms	1	

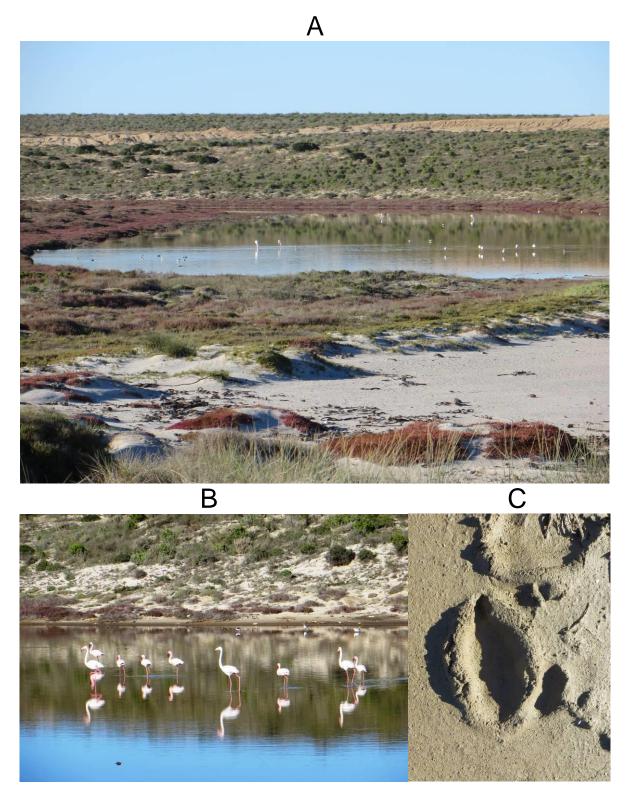


Figure 15 Birds feeding on brine shrimp at the Swartlintjies Estuary mouth (A&B). Photo C: Common ostrich footprint approximately 1 km from the mouth (Liebenberg 2008). Photos were taken on 22 June 2016.

10.3.3.4 Mammals

No live mammals were seen during the field survey on 22 June 2016. However, the spur and faeces of several animals were found and identified where possible. The tracks and faeces of a small antelope (Liebenberg, 2008) were found approximately 800 m from the mouth and in the dry floodplain (Figure 16). These could belong to the steenbok (*Raphicerus campestris*) (seen during EPRU survey in 1980) or the common duiker (*Sylvicapra grimmia*) (skull found during EPRU survey in 1980) as they commonly occur in the area. The tracks of medium sized antelope were found in 1980 and it was confirmed that springbok (*Antidorcas marsupialis*) were present in the area.

The tracks of water mongoose (*Atilax paludinosus*) was found during both surveys (Figure 16), while porcupine tracks (*Hystrix sp.*) and a dassie (*Procavia* capensis) skull were only found in 1980. The tracks in Figure 16C best match those of the African civet, although the spur lacks visible claw marks (Liebenberg, 2008). The size (5.5 cm) and the shape (round front foot, oval hind foot) of the spur match the description in Liebenberg (2008).

Domestic horse tracks (unless plain zebra has been introduced into the area) were also found during the site visit. To date, 13 mammal species have been recorded within the Swartlintjies EFZ surroundings (including Hondeklip Bay). Species and sources are listed in Table 6.

West Coast Resources (Pty) Ltd Impact Assessment Methodology

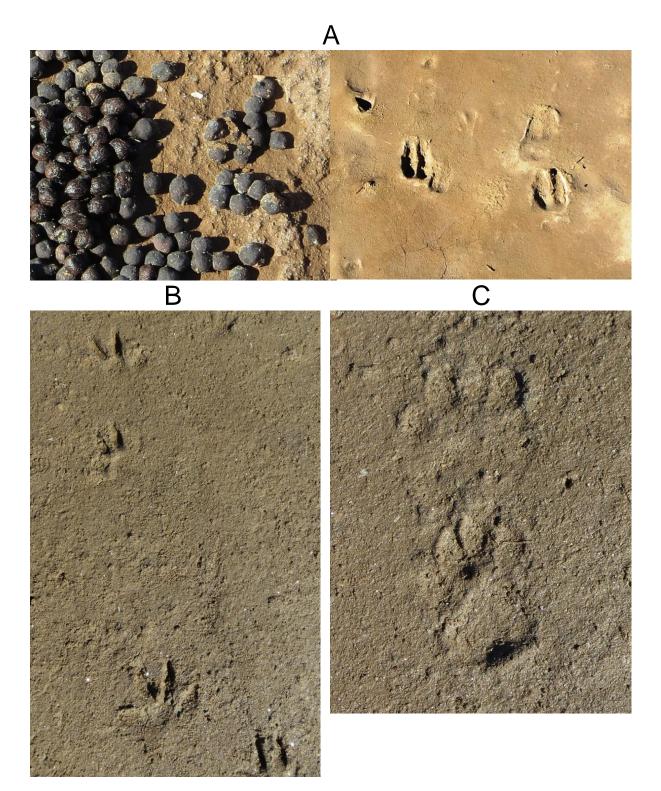


Figure 16 Photos of mammal tracks and faeces in the Swartlintjies Estuarine Functional Zone. The top pictures show the dung and tracks of a small unidentified antelope, which is likely to be a steenbok or a common duiker. Photo B shows the tracks of a water mongoose (track length is approximately 5 cm). Photo C shows the possible tracks of an African civet (track length is approximately 5.5 cm). Photos were taken on 22 June 2016.

Common name	Scientific name	Swartlintjies EFZ	Greater area	Source A=Heinecken, 1980 B= Current survey 2016
Steenbok	Raphicerus campestris	Х	X	А, В
Dassie	Procavia capensis	Х		A
Common duiker	Sylvicapra grimmia	Х		A
Springbok	Antidorcas marsupialis	Х		В
Porcupine	Hystrix africaeaustralis	Х		A
Water mongoose	Atilax paludinosus	Х		А, В
African civet	Civetictis civetta	X?		В
Brant's Karroo rat	Parotomys brantsi		Х	A
South African Pygmy gerbil	Gerbillurus paeba		X	A
Bush Karoo Rat	Otomys unisulcatus		Х	A
Bat	Eidolon helvum		Х	A
Suricate	Suricata suricatta		Х	В
Horse	Equus caballus	Х		В

Table 6 List of mammals identified in the Swartlintjies EFZ and greater Hondeklip area.

10.3.4 Management history

The Swartlintjies Estuary has been situated within a strictly access controlled Koignaas mining concession area for quite some time and management of the estuary has been minimal. De Beers Consolidated Diamond Mines (DBCDM) attempted to artificially open the mouth with bulldozers in 1978 and 1980 for unknown reasons. While the mouth closed immediately after the two attempts in 1978, it stayed open/contained seawater for six months after it had been opened in early 1980. The altered flow regime (Section 10.3.1) in combination with the artificial opening of the estuary mouth is likely to have permanently and artificially increased salinity in the soil. Abandoned roads leading through the riverbed and slimes dams impacting on estuary health have not been removed at this point in time.

10.3.5 Current ecosystem health

The Swartlintjies Estuary ecosystem health is largely dependent on episodic flood events that maintain biodiversity by shaping the topography of the floodplain. The estuary has not experienced a flood since several roads associated with mining activities filled the riverbed at various points in the lower catchment of the Swartlintjies River. Fragmentation of the ecosystem is moderate and focused near the slimes dam in the northern EFZ and in the vicinity of roads cutting through the EFZ.

10.3.6 Conservation importance

Although the Swartlintjies EFZ is not part of a formally protected area, the upper reaches of the river and its tributaries occur within the Namaqua National Park (Figure 4). The Swartlintjies Estuary has not been earmarked for conservation at the time of writing. However, rehabilitation of this estuary by restoring flow to the lower catchment could have major benefits to conserving biodiversity in the EFZ. Rehabilitation could also contribute towards ensuring that endemic plant species such as *Limonium equisetinum*, *Chaetobromus involucratus subsp. Dregeanus* and *Eragrostis sabulosa* remain species of 'least concern'.

10.4 Impact Assessment

None of the proposed land based, surf zone, beach- and offshore channel mining activities are planned to be carried out within the Swartlintjies EFZ. However, mining activities occurring outside the boundaries of the EFZ could have an impact on the estuary itself and are assessed in the sections below.

10.4.1 Surf zone, beach- and offshore channel mining

The southern boundary of the proposed surf zone, beach- and offshore channel mining area is located 600 m north of the Swartlintjies Estuary (Figure 3). A seawall will be built from gabions, protruding into the bay to an unknown distance. The Swartlintjies bay is very small and open, and is influenced by the northward flowing Benguela current. Due to the small size and shape of the bay, as well as the direction of the current, the Swartlintjies Estuary is unlikely to be impacted by these mining operations. It is, however, recommended that the seawall does not extend more than 300 m seaward from the high water mark. The potential impact on sedimentation processes of the Swartlintjies Estuary is assessed in terms of a seawall that does not extend beyond the area as indicated in (Figure 3 and Table 7). No mitigation measures are required.

	Without mitigation	Assuming mitigation
Severity	Low	N/A
Duration	Permanent: The wall will only be removed once mining activities have been completed.	N/A
Extent	Local: The estuary is situated within the mining concession area.	N/A
Consequence	Medium	N/A
Probability	Unlikely	N/A
Significance	Low	N/A
Status	Negative	N/A
Confidence	Medium	N/A
Reversibility	Fully reversible	N/A
Nature of cumulative impact	N/A	N/A
Degree of which impact may cause irreplaceable loss of resources	Low	N/A
Degree to which impact can be mitigated	None: Shortening the wall will not influence sedimentation dynamics of the estuary	N/A

Table 7 The potential impact of surf zone, beach- and offshore channel mining on sedimentation processes in the Swartlintjies Estuary.

10.4.2 Slime dams

While the preferred sites for future slimes dams (Sites C and G) are not going to impact on the Swartlintjies Estuary, the alternative (Site 2) to sites A, C and G is situated 9 km upstream of the Swartlintjies Estuary and may be problematic. This alternative site is an existing slimes dam and is located within the Swartlintjies River catchment (Figure 2). Although the prevailing wind carries most of the dried saline sediment to the northeast, it is likely that the surface runoff during episodic rainfall events washes salt from the dam into the Swartlintjies River.

It is evident that the rainfall has carried salty sediment from the small abandoned slimes dam situated in the northern part of the EFZ down towards the river channel and has had an impact on the vegetation (Section 10.3.3.1). A salt pan is situated directly below the dam, which could be an indication of increased rates of salt accumulation in the soil. The proposed alternative site for the slimes dam could have a similar effect on the river and therefore may impact on the upper reaches of the estuary. This impact would be further exacerbated by the current inability of the system to flush accumulated salts out to sea. Very few plant species can survive in saline soils, which results in the increasing extent of saltmarsh vegetation outcompeting Namaqualand Duneveld and Strandveld vegetation patches.

It is not feasible to cover slimes dams while they are in use and salt water runoff into the riverbed can therefore not be mitigated. The impacts on the estuary can only be prevented by utilising the preferred sites north of the estuary, which are situated outside of the Swartlintjies River catchment and are anticipated to drain into the sea via existing abandoned mining channels. The potential impact on biodiversity as a result of accelerated salinisation of the Swartlintjies Estuarine Functional Zone is assessed in Table 8.

	Without mitigation	Assuming mitigation
Severity	High	N/A
Duration	High	N/A
Extent	Medium: The river is situated outside the concession area and would be impacted too.	N/A
Consequence	High	N/A
Probability	Medium	N/A
Significance	High	N/A
Status	Negative	N/A
Confidence	Medium	N/A
Reversibility	Partially reversible	N/A
Nature of cumulative impact	High	N/A
Degree of which impact may cause irreplaceable loss of resources	Medium	N/A
Degree to which impact can be mitigated	None: No mitigation measures available	N/A

Table 8 The potential impact of saltwater runoff from the proposed alternative slimes dam site on the biodiversity of the Swartlintjies Estuarine Functional Zone.

10.4.3 Obstructions to freshwater inflow

The 10-15 m high haul road situated 3 km upstream of the mouth leads through the Swartlintjies EFZ and prevents the river from entering the estuary. Pipes in the haul road connect either side of the river, but the inlet is elevated at least 1 m above the river bed, making it impossible for water to pass through during episodic rainfall events. Prior to mining activities in the area, the Swartlintjies River came down in flood unhindered during episodic rainfalls, creating a braided flood plain with channels of varying depths (Section 10.3.1). These channels were then colonised by plants during dry periods, creating a biodiverse habitat that reflects the topographic mosaic of the floodplain (Section 10.3.3.1). This shows that the episodic flooding of the Swartlintjies River is an important ecological process for maintaining biodiversity of the Swartlintjies EFZ.

Restoring freshwater flows to the estuary should not be left until mine closure. The pipes in the haul road should be replaced with larger culverts (at least 1 m wide) that allow the Swartlintjies River to flow into the lower EFZ.

	Without mitigation	Assuming mitigation	
Severity	High	Medium	
Duration	High	Medium	
Extent	Low: The direct impact is restricted to the Estuarine Functional Zone	Low	
Consequence	High	Medium	
Probability	High	Medium	
Significance	High	Medium	
Status	Negative	Negative	
Confidence	High	Medium	
Reversibility	Partially reversible: It is not known whether the restoration of flow will ensure that excess salt is flushed into the sea.		
Nature of cumulative impact	Impacts on the extent and plant diversity within the Namaqualand Stranveld and Namaqualand Coastal Dunveld vegetation types ar amplified due to the widespread mining activities and destruction habitat in the area.		
Degree of which impact may cause irreplaceable loss of resources	High	Medium	
Degree to which impact can be mitigated	Low	Low	

Table 9 The impact of the haul road on the hydrological functioning and biodiversity of the Swartlintjies Estuary.

10.5 References

Forbes, A., & Demetriades, N. (2003). Ecology of the "Little Lagoon Area" of Durban

Bay. Report prepared for the National Port Authority by Marine & Estuarine

Research.

Gibbs, R. (1994). Metals in sediments along the Hudson River Estuary.

Environmental International, 20, 507–516.

Harrison, T. D., Cooper, J. A. G., & Ramm, A. E. L. (2000). Geomorphology,

Ichthyofauna, Water Quality and Aesthetics of South African Estuaries.

Prepared by Division of Water, Environment and Forestry Technology,

Environmentek, CSIR, for the Department of Environmental Affairs and Tourism.

Heinecken, T. (1980). Report No. 4 Swartlintjies (CW4). (A. E. F. Heydorn & J.

Grindley, Eds.). CSIR Research Report 403. Stellenbosch.

- Heydorn, A. E. F., & Tinnley, K. L. (1980). Estuaries of the Cape, Part I Synopsis of the Cape Coast. Natural features, dynamics and utilisation. CSIR Research Report 380.
- Liebenberg, L. (2008). *A Field Guide to the Animal Tracks of Southern Africa* (4th ed.). David Philip Publishers (Pty) Ltd.
- RSA Department of Agricultural Technical Services. (1975). *Memorandum. Riviermonde* 14/3/3/6 Springbok voorligtingswyk (Unpublished).
- RSA DWA. (2009). Development of an Integrated Water Quality Management
 Strategy for the Upper and Lower Orange Water Management Areas. Desktop
 Catchment Assessment Study: Lower Orange Water Management Area (WMA
 14). Report No. 2.2 (P RSA D000/00/7909/3). Edition 1, August 2009.
- SANBI. (2016a). *Biodiversity GIS: Map Viewers*. Available Online at http://bgis.sanbi.org/MapViewer [11 July 2016].
- SANBI. (2016b). *National Vegetation Map 2012 beta2*. Available Online at http://bgis.sanbi.org/MapViewer [5 June 2016].
- SANBI. (2016c). *Red List of South African Plants*. Available Online at http://redlist.sanbi.org [Accessed on 13 June 2016].
- South African Navy. (2016). *Hydrographic Office: Tide information*. Available Online at http://www.sanho.co.za/tides/tide_index.htm.
- Summers, J., Wade, T., Engle, V., & Malaeb, Z. (1996). Normalization of Metal Concentrations in Estuarine Sediments from the Gulf of Mexico. *Estuaries*, *19*(3), 581–594.
- Van Niekerk, L., & Turpie, J. K. (2012). South African National Biodiversity

Assessment 2011: Technical Report. Volume 3: Estuary Component. CSIR Report Number CSIR/NRE/ECOS/ER/2011/0045/B. Council for Scientific and Industrial Research, Stellenbosch.

11 Any mitigation measures for inclusion in the EMPr;

No mitigation measures are required for future mining activities. The pipes in the haul road should be replaced with larger culverts that allow the Swartlintjies River to flow into the lower EFZ.

12 Any conditions for inclusion in the environmental authorisation;

Environmental Authorisation should include the need to rehabilitate the estuary by implementing the Swartintjies Estuary Management Plan (to be finalised).

13 Any monitoring requirements for inclusion in the EMPr or environmental authorisation;

None

14 A reasoned opinionas to whether the proposed activity or portions thereof should be authorised; and if the opinion is that the proposed activity or portions thereof should be authorised, any avoidance, management and mitigation measures that should be included in the EMPr, and where applicable, the closure plan;

There are no direct impacts on the Swartlintjies Estuary by the proposed mining activities. Future slimes dams at Sites C and G are favoured over the alternative Site 2, which is situated 9 km upstream of the Swartlintjies Estuary and may be problematic. The alternative site (Site 2) should be avoided to prevent accelerated salinisation of the Swartlintjies Estuarine Functional Zone and associated negative long-term impacts on biodiversity. The freshwater flow to the estuary should be

restored as best as possible prior to closure focusing on replacing the ineffectual pipes in the haul road with proper culverts.

15 A description of any consultation process that was undertaken during the course of preparing the specialist report;

Not applicable

16 A summary and copies of any comments received during any consultation process and where applicable all responses thereto; and

Not applicable

17 Any other information requested by the competent authority

The competent authority requested WCR to submit an Estuarine Management Plan.

This plan is currently being drafted by Anchor Environmental Consultants (Pty) Ltd.

and will be available for comment by 5th August 2016.